



Standard Guide for Painting Inspectors (Metal Substrates)¹

This standard is issued under the fixed designation D3276; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ε) indicates an editorial change since the last revision or reapproval.

^ε¹ NOTE—Editorial corrections were made in Section 2 and 5.3.5.1 in November 2016.

1. Scope

1.1 This guide is intended as an information aid to painting inspectors in carrying out their task efficiently. It includes the key elements of surface preparation, coatings application, and final approval for both field and shop work. The items should be selected that are pertinent to the specification of a particular job.

NOTE 1—For additional helpful information, refer to the following documents:

*Manual of Coating Work for Light-Water Nuclear Power Plant Primary Containment and Other Safety-Related Facilities*²

*New Concepts for Coating Protection of Steel Structures*³

D16 Terminology for Paint, Related Coatings, Materials, and Applications⁴

D4538 Terminology Relating to Protective Coatings and Lining Work for Power Generation Facilities⁴

Steel Structures Painting Manual Vol 1 Good Painting Practice⁶

Steel Structures Painting Manual Vol 2 Systems and Specifications⁶

Manufacturers Specifications and Instructions (made available to the inspector for reference to special requirements for proper application)

Safety Data Sheets (needed to ensure that personnel take necessary precautions in handling hazardous materials). Available from Materials manufacturer.

1.2 Certain industries or owners may require certified inspection personnel. See Guide **D4537** for establishing procedures to certify inspectors for coatings work in nuclear facilities.

1.3 The values stated in SI units are to be regarded as the standard. The values given in parentheses are for information only.

¹ This guide is under the jurisdiction of ASTM Committee **D01** on Paint and Related Coatings, Materials, and Applications and is the direct responsibility of Subcommittee **D01.46** on Industrial Protective Coatings.

Current edition approved July 1, 2015. Published September 2015. Originally approved in 1973. Last previous edition approved in 2007 as D3276 – 07. DOI: 10.1520/D3276-15E01.

² ASTM, 1979.

³ *ASTM STP 841*, ASTM, 1984.

⁴ For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

⁶ Available from Society for Protective Coatings (SSPC), 40 24th St., 6th Floor, Pittsburgh, PA 15222, http://www.sspc.org.

1.4 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

1.5 This guide is arranged in the following order:

Referenced Documents	Section
ASTM Standards	2
OSHA Standards	2.1
Steel Structures Painting Council Publications	2.2
International Standards Organization (ISO)	2.3
ASTM Adjuncts	2.4
Significance and Use	2.6
Preparation for Inspection	3
Surface Preparation Methods and Requirements	4
Surface Preparation	5
Pictorial Standard D2200	5.1
Factors Affecting Coating Performance	5.1.1
Cleanliness	5.2
Mill Scale	5.2.1
Surface Profile	5.2.2
Sharp Edges	5.2.3
Cleaning Procedures	5.2.4
Chemical Cleaning	5.3
Solvent Vapor Cleaning	5.3.1
Hand Tool Cleaning	5.3.1.1
Power Tool Cleaning	5.3.2
Power Tool Cleaning to Bare Metal	5.3.3
Commercial Grade Power Tool Cleaning	5.3.4
Blast Cleaning	5.3.4.1
Pressurized Water Cleaning	5.3.5
Cleaning and Preparation of Various Surfaces	5.3.6
Steel Surfaces	5.4
Galvanized Surfaces	5.4.1
Aluminum Surfaces	5.4.2
Precautions in Preparing Unpainted and Previously Painted Surfaces	5.4.3
Inspection of Surfaces Prior to Field Painting	5.4.4
New Construction	5.5
Maintenance Repainting	5.5.1
Coating Storage and Handling	5.5.2
Storage of Coating and Thinner	6
Mixing of Coatings	6.1
Thinning	6.2
Initial Samples	6.3
Thinning of Coating	6.3.1
Sampling of Thinned Coating	6.3.2
Heating of Coating	6.3.3
Weather Considerations	6.4
Drying	7
Low Temperature	7.1
High Temperature	7.2
Moisture	7.3
	7.4

Wind	7.5
Coating Application	8
Residual Contaminants	8.1
Quality Assurance	8.2
Film Defects	8.2.1
Brush Application	8.3
Spray Application	8.4
Roller Application	8.5
Miscellaneous Methods	8.6
Rate of Application	8.7
Additional Considerations	9
Ventilation	9.1
Shopcoat Repair	9.2
Painting Schedule	9.3
Film Integrity	9.4
Recoat Time	9.5
Coating System Failure	9.6
Inspection Equipment	10
General	10.1
Surface Profile Gages	10.1.1
Adhesion of Existing Coating	10.1.2
Portable Pull-Off Adhesion Testers	10.1.3
Field Inspection Equipment	10.2
Drying and Curing Times	10.2.1
Thermometers	10.2.1.1
Relative Humidity and Dew Point	10.2.1.2
Wet-Film Thickness Gages	10.2.2
Interchemical Gage	10.2.2.1
Notched Gage	10.2.2.2
Dry-Film Thickness Gages	10.2.3
Nondestructive Film Thickness Gages	10.2.3.1
Magnetic-Type Gages	10.2.3.2
Current-Type Gages	10.2.3.3
Destructive Thickness Gage	10.2.3.4
Holiday Detectors	10.2.4
Comparison of Surface Preparation	
Specifications	Table 1
Comparison of Water Jetting Standards	Table 2
Inspection Checklist	Appendix X1

D4541 Test Method for Pull-Off Strength of Coatings Using Portable Adhesion Testers
D4752 Practice for Measuring MEK Resistance of Ethyl Silicate (Inorganic) Zinc-Rich Primers by Solvent Rub
D4940 Test Method for Conductimetric Analysis of Water Soluble Ionic Contamination of Blast Cleaning Abrasives
D5064 Practice for Conducting a Patch Test to Assess Coating Compatibility
D5162 Practice for Discontinuity (Holiday) Testing of Non-conductive Protective Coating on Metallic Substrates
D5402 Practice for Assessing the Solvent Resistance of Organic Coatings Using Solvent Rubs
D6386 Practice for Preparation of Zinc (Hot-Dip Galvanized) Coated Iron and Steel Product and Hardware Surfaces for Painting
D6677 Test Method for Evaluating Adhesion by Knife
D6913 Test Methods for Particle-Size Distribution (Gradation) of Soils Using Sieve Analysis
D7091 Practice for Nondestructive Measurement of Dry Film Thickness of Nonmagnetic Coatings Applied to Ferrous Metals and Nonmagnetic, Nonconductive Coatings Applied to Non-Ferrous Metals
D7127 Test Method for Measurement of Surface Roughness of Abrasive Blast Cleaned Metal Surfaces Using a Portable Stylus Instrument
D7393 Practice for Indicating Oil in Abrasives
E337 Test Method for Measuring Humidity with a Psychrometer (the Measurement of Wet- and Dry-Bulb Temperatures)

2.2 *Occupational Safety and Health Administration (OSHA) Standard:*

29 CFR 1926.59 Hazard Communication⁵

2.3 *SSPC: The Society for Protective Coatings (SSPC) Standards:*⁶

- SSPC-AB 1 Mineral and Slag Abrasives
- SSPC-AB 2 Cleanliness of Recycled Ferrous Metallic Abrasives
- SSPC-AB 3 Newly Manufactured or Re-Manufactured Steel Abrasives
- SSPC-AB 4 Recyclable Encapsulated Abrasive Media
- SSPC-SP 1 Solvent Cleaning
- SSPC-SP 2 Hand Tool Cleaning
- SSPC-SP 3 Power Tool Cleaning
- SSPC-SP 5/NACE No. 1 White Metal Blast Cleaning
- SSPC-SP 6/NACE No. 3 Commercial Blast Cleaning
- SSPC-SP 7/NACE No. 4 Brush-off Blast Cleaning
- SSPC-SP 8 Pickling
- SSPC-SP 10/NACE No. 2 Near-White Blast Cleaning
- SSPC-SP 11 Power Tool Cleaning to Bare Metal
- SSPC-SP 14/NACE No. 8 Industrial Blast Cleaning
- SSPC-SP 15 Commercial Grade Power Tool Cleaning
- SSPC-SP 16 Brush-Off Blast Cleaning of Non-Ferrous Metals
- SSPC-SP WJ-1/NACE WJ-1 Clean to Bare Substrate

⁵ Available from Standardization Documents Order Desk, DODSSP, Bldg. 4, Section D, 700 Robbins Ave., Philadelphia, PA 19111-5098, <http://www.dodssp.daps.mil>.

2. Referenced Documents

2.1 *ASTM Standards:*⁴

- D16 Terminology for Paint, Related Coatings, Materials, and Applications
- D1212 Test Methods for Measurement of Wet Film Thickness of Organic Coatings
- D1730 Practices for Preparation of Aluminum and Aluminum-Alloy Surfaces for Painting
- D2200 Practice for Use of Pictorial Surface Preparation Standards and Guides for Painting Steel Surfaces
- D3359 Test Methods for Measuring Adhesion by Tape Test
- D3363 Test Method for Film Hardness by Pencil Test
- D4138 Practices for Measurement of Dry Film Thickness of Protective Coating Systems by Destructive, Cross-Sectioning Means
- D4212 Test Method for Viscosity by Dip-Type Viscosity Cups
- D4285 Test Method for Indicating Oil or Water in Compressed Air
- D4414 Practice for Measurement of Wet Film Thickness by Notch Gages
- D4417 Test Methods for Field Measurement of Surface Profile of Blast Cleaned Steel
- D4537 Guide for Establishing Procedures to Qualify and Certify Personnel Performing Coating and Lining Work Inspection in Nuclear Facilities
- D4538 Terminology Relating to Protective Coating and Lining Work for Power Generation Facilities

- SSPC-SP WJ-2/NACE WJ-2 Very Thorough Cleaning
- SSPC-SP WJ-3/NACE WJ-3 Thorough Cleaning
- SSPC-SP WJ-4/NACE WJ-4 Light Cleaning
- SSPC-PA 1 Shop, Field and Maintenance Painting of Steel
- SSPC-PA 2 Procedure for Determining Conformance to Dry Coating Thickness Requirements
- SSPC-PA Guide 11 Protecting Edges, Crevices, and Irregular Steel Surfaces by Stripe Coating
- SSPC-PA 17 Procedure for Determining Conformance to Steel Profile/Surface Roughness/Peak Count Requirements
- SSPC-VIS 1 Guide and Reference Photographs for Steel Surfaces Prepared by Dry Abrasive Blasting
- SSPC-VIS 5/NACE VIS 9 Guide and Reference Photographs for Steel Surfaces Prepared by Wet Abrasive Blasting
- SSPC-VIS 3 Guide and Reference Photographs for Steel Surfaces Prepared by Hand and Power Tool Cleaning
- SSPC-VIS 4/NACE No. 7 Visual Standard for Steel Cleaned by Water Jetting
- SSPC Paint 27 Basic Zinc Chromate-Vinyl Butyral Wash Primer
- SSPC Guide 6 Guide for Containing Debris Generated During Paint Removal Operations
- SSPC Guide 7 Guide for the Disposal of Lead Contaminated Surface Preparation Debris
- SSPC Guide 15 Field Methods for Retrieval and Analysis of Soluble Salts on Steel and Other Nonporous Surfaces
- 2.4 *International Standards Organization (ISO):*⁷
 - ISO 8501-4 Preparation Grades and Flash Rust Grades in Connection with High-Pressure Water Jetting
 - ISO 8502-3 Preparation of Steel Substrates before Application of Paints and Related Products – Tests for the assessment of surface cleanliness
- 2.5 *NACE International (NACE):*⁸
 - SP0178-2007 (formerly NACE RP0178) Design, Fabrication, and Surface Finish Practices for Tanks and Vessels to be Lined for Immersion Service
- 2.6 *ASTM Adjuncts:*
 - Pictorial Surface Preparation Standards for Painting Steel Surfaces⁹

3. Significance and Use

3.1 This guide is intended as a reference for those concerned with the inspection of industrial coating work. The requirements for inspection should be addressed in all protective coating and lining work specifications. This guide may be used by specification writers when selecting and establishing the inspection requirements for coating and lining specifications. A checklist for use by inspectors in the field is included in **Appendix X1**.

⁷ Available from International Organization for Standardization (ISO), 1, ch. de la Voie-Creuse, CP 56, CH-1211 Geneva 20, Switzerland, <http://www.iso.org>.

⁸ Available from NACE International (NACE), 15835 Park Ten Pl., Houston, TX 77084, <http://www.nace.org>.

⁹ The pictorial surface preparation standard Method A (ISO/Swedish Standard) is available from ASTM International Headquarters. Request Adjunct No. **ADJD2200**.

4. Preparation for Inspection

4.1 The guide describes the duties of the inspector and discusses inspection methods, both visual and instrumental, that can be used to determine that the specification requirements have been met by the painting contractor.

4.2 Before painting is started the project engineer should provide the inspector with information from the official plans and specifications as to coating type, thinner to be used, mixing ratios to be used, specified application thickness, primer, tie coat, topcoat, time between coats, surface preparation, method of application, and any special precautions to be followed such as limits on ambient conditions. These details should be recorded in an inspector's record book to eliminate any misunderstanding between the inspector and the contractor.

4.3 The inspector should obtain copies of the Safety Data Sheets (SDS) for all products that will be used on the project, review any hazard communications program in accordance with 29 CFR 1926.59 that will apply to the project, and review other safety information related to the work that will be performed by the contractor. The inspector should examine these materials and be supplied with appropriate protective equipment and devices.

4.4 The Product Data Sheets (PDS) for the coating products to be used, including thinners where applicable, shall be provided with the procured product. Note that the coating specification may allow only specific pre-qualified coatings to be used.

5. Surface Preparation Methods and Requirements

5.1 *Surface Preparation* is one of the most important factors affecting the performance of coatings. The specifier determines the proper level in accordance with the expected service life and type of coating specified.

5.1.1 *Pictorial Standard D2200 (SSPC-VIS 1)* should be provided to the inspector on a job involving blast cleaning of structural steel. The standard is used by the inspector to assist in determining whether the degree of surface preparation specified in a contract has been attained by the contractor. For large jobs it is recommended that before work starts, an actual steel sample of adequate size be blasted to the satisfaction of the project engineer. This blasted surface should be protected by a clear acrylic coating or encased in plastic and used for reference purposes as the work progresses.

5.2 *Factors Affecting Coating Performance*—There are a number of factors that should be considered to ensure a proper painting job.

5.2.1 *Cleanliness*—Many materials, if not removed from the surface, will affect the life of the coating. These include oil, grease, soil, weld spatter, and slag, that make it impossible to obtain proper adhesion to the metal surface. Surface soluble salts shall be removed to the degree specified or long term coating performance may be adversely affected. SSPC/NACE issues detailed surface preparation specifications that cover various methods for cleaning.

5.2.2 *Mill Scale*, The bluish-black oxide resulting from the hot-rolling process, is a constant source of trouble leading to coating failure. This scale is very brittle and can crack or

loosen due to temperature changes (both in fabricating and weathering in the field) leading to failure of the coating.

5.2.3 Surface Profile—The texture of the metal surface has a significant effect on the performance of coatings, since it increases the surface area to which the coating can develop adhesion. In fact, the term “anchor pattern” is sometimes used to describe the depth of profile. Profile varies both with the type and size of the abrasive used. Coarser abrasives generally produce a coarser and deeper profile. Deep profiles are advantageous for adhesion, but require more coating to fill in the valleys and cover the peaks of the profile; they cannot be used with low-build coatings that do not cover the peaks even when several coats are applied. The angularity (sharpness) and density of the profile may affect adhesion. Methods for measuring surface profile can be found in Test Methods **D4417** and **D7127**. Frequency of surface profile measurement and the acceptability of the measurements is described in SSPC-PA 17.

5.2.4 Sharp Edges—Sharp edges and rough welds can compromise coating performance, particularly in immersion service. Sharp edges and outside corners should be radiused, and rough welds should be smoothed or ground flat. NACE SP0178 and SSPC-PA Guide 11 may be used as guides. This operation should be specified during fabrication, but is frequently done by the coating contractor. The coating inspector should verify that such work has been done, if required by the coating job specification prior to other steps in surface preparation.

5.3 Cleaning Procedures—Safety precautions are not addressed separately for each of the following cleaning methods. Each has its own safety-related hazards, and U.S. Occupational Health and Safety Administration regulations should be followed. Safety Data Sheets (SDS) for the solvents and cleaning compounds provided by the manufacturer should also be consulted for proper worker protection.

5.3.1 Chemical Cleaning—Solvents are used to remove oil, grease, and related materials. The solvent is applied to the surface by wiping or scrubbing with rags or brushes. The contaminants should be removed (not simply spread out) by a thorough wiping of the affected areas with cloths saturated with clean solvent. Contaminated cloths should not be dipped into clean solvent. The cleaning should be repeated with clean rags and fresh clean solvent. Emulsions, cleaning compounds, steam cleaning, or similar methods and materials may also be used. Where emulsion cleaners, soaps, or detergents are used, they should be removed completely by washing with clean hot water. SSPC-SP 1 covers cleaning procedures using these materials.

5.3.1.1 Solvent Vapor Cleaning is a procedure that can be adapted to a production line or piecework operation. Vapor cleaning removes all soluble contaminants but does not disturb the natural oxide film. If this film should be removed, mechanical cleaning will be necessary as well. The part to be cleaned is placed in the saturated vapor above the heated solvent so that the solvent vapor condenses on the metal surface. Vapor degreasing does not remove particulate matter, so parts should be wiped to remove any insoluble soils. Vapor degreasing has

the advantages over solvent wiping in that hot solvents are used and the solvent condensation removes oils without recontamination.

5.3.2 Hand Tool Cleaning is the method used for the removal of loose mill scale, loose rust, loose or otherwise defective coating, weld flux, slag and spatter from metal surfaces by hand brushing, hand sanding, hand chipping or scraping using wire, fiber or bristle brushes, sandpaper, steel wool, hand scrapers or chisels, and chipping hammers. Material is considered tightly adherent if it cannot be lifted with a dull putty knife. SSPC provides a detailed specification, SSPC-SP 2. A visual standard, SSPC-VIS 3, may be used to assist in determining compliance.

5.3.2.1 Hand tool cleaning requires that all weld flux, tar, oil and grease, and other greasy contaminants be removed first by solvent cleaning (**5.3.1**).

5.3.2.2 Wire brushes should be rigid enough to clean the surface thoroughly, and shaped to penetrate into all corners and joints. Brushes should be kept free of all materials that may clog the wires of the brush.

5.3.2.3 Hand scrapers should be made of tool steel, tempered and ground to a sharp edge, and should be of the proper size and shape to enable cleaning to be done as specified. Scrapers should be kept sharp at all times.

5.3.3 Power Tool Cleaning is a method used for the removal of loose mill scale, loose rust, loose or otherwise defective coating, and weld flux from metal surfaces by power wire brushes, power impact tools, power grinders, power sanders, or by a combination of these methods. Material is considered tightly adherent if it cannot be lifted with a dull putty knife. SSPC-SP 3 is the detailed specification for power tool cleaning. A visual standard, SSPC-VIS 3, may be used to assist in determining compliance.

5.3.3.1 Power tool cleaning requires that all oil, grease, weld flux, and other contaminants be removed first by solvent cleaning (**5.3.1**). Hand tool cleaning in accordance with **5.3.2** may be used prior to power tool cleaning.

5.3.3.2 All equipment should be suitable for the configuration of the work to be cleaned and maintained free of material that clogs the wire or disks making them ineffective. All impact tools should be kept sharp.

5.3.4 Power Tool Cleaning to Bare Metal is a method used for the total removal of coating, rust, and mill scale. It also requires a minimum of 1-mil anchor profile. Surface cleaning, power tools, and surface profile producing media are used to

TABLE 1 Comparison of Surface Preparation Standards

Preparation Guide	SSPC	ASTM D2200		NACE
		Method A ^A	Method B ^B	
Blast clean to white metal	SSPC-SP 5	Sa 3	SP 5	1
Blast clean to near-white metal	SSPC-SP 10	Sa 2½	SP 10	2
Commercial blast cleaning	SSPC-SP 6	Sa 2 ^C	SP 6	3
Brush-off blast cleaning	SSPC-SP 7	Sa 1	SP 7	4
Industrial blast cleaning	SSPC-SP14	8

^A Method A is ISO/Swedish Standard.

^B Method B is SSPC- VIS-1.

^C Pictorial Standard Sa 2 shows mill scale and conflicts with SSPC definition of commercial blast (SP 6), which does not allow mill scale.

TABLE 2 Comparison of Water Jetting Standards

Cleanliness Description	SSPC/NACE	ISO
Clean to Bare Metal	SSPC-WJ-1/NACE WJ-1	Wa 3
Very Thorough Cleaning	SSPC-WJ-2/NACE WJ-2	Wa 2.5
Thorough Cleaning	SSPC-WJ-3/NACE WJ-3	Wa 2
Light Cleaning	SSPC-WJ-4/NACE WJ-4	Wa 1

obtain the specified finish. Surface cleaning power tools consist of non-woven abrasive wheels and discs, coated abrasive discs or sanding pads, coated abrasive fly wheels, and coated abrasive bands. Surface profile producing media consist of rotary impact flap wheel assemblies and needle guns. SSPC-SP 11 is the detailed specification for power tool cleaning to bare metal.

5.3.4.1 Depending on the initial condition of the surface and existing profile conditions, it may be necessary to use one or both of the types of power tools. All oil, grease, weld flux, and other contaminants should be removed first by solvent cleaning (5.3.1). Hand tool cleaning (5.3.2) or power tool cleaning (5.3.3) may be used prior to power tool cleaning to bare metal.

5.3.4.2 All equipment should be suitable for the configuration of the work to be cleaned and maintained free of material that clogs the wire or discs making them ineffective. For example, needle guns require 2-mm diameter needles to produce a suitable surface profile.

5.3.4.3 The finished surface should be bare, bright metal. Slight residues of rust and paint may remain in the lower portions of pits if the original surface was pitted. SSPC-VIS 3 is a visual standard to assist in determining compliance. Surface profile is determined by procedures in 10.1.1.

5.3.4.4 *Commercial Grade Power Tool Cleaning, SSPC-SP 15* is performed in a manner similar to SSPC-SP 11. The finished surface should be bare, bright metal. Staining is allowed on 33 percent of the evaluation unit area, and slight residues of rust and paint may remain in the lower portions of pits if the initial surface was pitted. It also requires a minimum of 1-mil anchor profile.

5.3.5 *Blast Cleaning* is used to remove coating, rust and mill scale from a metal surface and to provide a roughened surface by striking the surface with a stream of small, hard abrasive particles such as (dry) sand, grit, or shot.

5.3.5.1 One method utilizes compressed air, special blast nozzles, and abrasive. Water may be injected into the air stream to control dust, and a rust inhibitor may be needed (5.3.6). In another method used primarily in fabricating shop, wheels propel the abrasive centrifugally against the work. The minimum and maximum particle size of the abrasive may be specified as a means of controlling the surface profile. The particle size can be verified by sieve test in accordance with Test Method D6913.

5.3.5.2 Blast cleaning requires that all oil, grease, and weld flux be removed by solvent cleaning (5.3.1). The compressed air used for blast cleaning should be free of condensed water or oil by making certain that separators and traps are in working order. Test the compressed air supply in accordance with Test Method D4285. The abrasive material should be free of soluble contaminants when tested in accordance with Test Methods

D4940, D7393, or the appropriate SSPC abrasive specification (AB 1, AB 2, AB 3, or AB 4) for the type of abrasive material.

5.3.5.3 Blast-cleaning operations should be performed so that no damage is done to the completed portion of the work. Blast cleaning is often performed from the top to bottom of the structure and should only be carried on downwind from any recently painted areas. Dry blast cleaning operations should not be conducted on surfaces that will be wet after blasting and before painting. Steel temperature should be at least 3°C (5°F) above the dew point temperature.

5.3.5.4 The degree of blast cleaning required should be at least equal to the appropriate surface preparation specification and the applicable visual standard. Standards from ASTM, SSPC, and National Association of Corrosion Engineers (NACE) are listed in Table 1. Note that Pictorial Surface Preparation Standards D2200 is divided into two methods for abrasive blasting. Method A describes photographic standards available from International Standards Organization (ISO) Pictorial Surface Preparation Standards. Method B describes photographic standards available from SSPC. The two sets of photographs are not directly comparable.

5.3.5.5 Blast cleaned surfaces should be examined for any traces of oil, grease, or smudges; where present, the contaminants should be removed by solvent cleaning (5.3.1). Surfaces that have been dry blasted should be brushed with clean brushes, blown with compressed air free of oil and moisture, or vacuum cleaned to eliminate any traces of blast products, dust, or dirt from the surface. This also serves to remove abrasive from pockets and corners.

5.3.5.6 Blast cleaned surfaces should be further treated, primed or painted on the same day they are blasted, preferably within 8 h, or in any event before any visible flash rusting occurs. Reblasting will be necessary on any surface if rust bloom forms before coating can be applied.

5.3.6 *Pressurized Water Cleaning*—A high-pressure water blast using potable water, either with or without an abrasive injected into the stream, is used as an alternative to open blasting, since it reduces the release of dust into the atmosphere. Pressures over 137 900 KPa (20 000 psi) are needed to achieve total coating removal when using only water. Pressurized water alone will not remove mill scale efficiently, or impart an anchor profile. Inhibitors may be added to the water to prevent flash rusting. The surface should be dried or allowed to dry before coating. Table 2 contains a comparison of the SSPC/NACE water jetting standards to the ISO 8501-4 standard. SSPC-VIS 4/NACE No. 7 is a visual standard to assist in determining compliance with the SSPC/NACE joint standard. It includes photographs with three levels of rustback, if allowed by the specification.

5.4 *Cleaning and Preparation of Various Surfaces*—Before application of any coating, all surfaces to be coated should be thoroughly cleaned and properly prepared to the requirements of the specification. All dust, dirt, oil, grease, moisture, soot, tar, or other contaminants should be removed from unpainted surfaces. Previously painted surfaces should be similarly cleaned of all foreign matter; all deteriorated coating should be removed as well. Mortar or cement drippings from earlier repairs should be removed by mechanical or chemical means.

Tree limbs or other growth obstructing the structure should be cut away to provide ready access.

5.4.1 *Steel Surfaces*—Removal of rust and scale should be done in the manner and to the degree specified, that is, hand, power tool, or blast cleaned.

5.4.1.1 On complex structures, all dirt and debris should be removed from pockets, crevices, obstructed areas such as gusset plates and connections, and tops of horizontal surfaces. Blasting debris that accumulates on horizontal surfaces should be removed. Special attention should be placed on examining hard to reach areas, the back side of nuts and bolts, sides of members in close proximity to other members or walls, and undersides of members.

5.4.2 *Galvanized Surfaces* that are to be painted should be cleaned and then treated in accordance with the specified method in Practice D6386. Alternatively, the surface may be allowed to weather a minimum of 6 months before cleaning and painting. The method and inspection of brush-off blast cleaning of galvanized surfaces is presented in SSPC-SP 16.

5.4.3 *Aluminum Surfaces:*

5.4.3.1 Complete removal of oil and grease and, for unanodized aluminum, treatment is essential. Vapor degreasing or immersion in an alkaline or acid cleaning solution are commonly used in shop work. In the field, water wash followed by solvent, steam or detergent cleaning is a good starting point. Consult SSPC-SP 16 if brush-off blast cleaning is performed.

5.4.3.2 Vinyl wash primer is one of the metal pretreatments commonly used on unanodized aluminum. The material is described in Practices D1730, Type B, Method 8 and is covered by SSPC in Paint 27. Lead pigmented primers should never be used over aluminum surfaces. The minimum treatment for aluminum is Type B, Method 3 of Practices D1730, which describes the use of an alcoholic phosphoric acid cleaner.

5.4.4 *Precautions in Preparing Unpainted and Previously Painted Surfaces*—Cleaning should proceed by sections, bays, or other readily identifiable parts of the work. The cleaning of each section, bay, or part of the work should be entirely completed, inspected, and accepted before any coating is applied. The specification should contain limits on the amount or area that can be cleaned and painted at one time. The system of alternately cleaning and painting short sections by one workman is not good practice since this can lead to surface or intercoat contamination.

5.4.4.1 If traffic, or any other source, produces an objectionable amount of dust, it is customary to control the dust by using tarpaulins, etc., for a sufficient distance around the structure and take any other precaution necessary to prevent dust and dirt from coming into contact with the cleaned or freshly painted surfaces. It may sometimes be necessary to clean newly coated surfaces using some of the specified methods between the various coats.

5.4.4.2 Some areas to be painted or repainted may be exposed to chemical fumes and, if so, should be washed with water before painting. Washing may also be necessary between coats of paint. Be aware that standing water on uncured paint can result in early failure.

5.4.4.3 Residual contaminants present on pitted steel can be a problem. Chloride from deicing salts or a marine

environment, and sulfate contamination from air pollution have been recognized as main factors in premature breakdown of existing coating systems. High-pressure water blasting is often used to remove these contaminants.

5.4.4.4 Current regulations require containment and collection of surface preparation debris for disposal. When the existing coating contains regulated heavy metals such as lead or chromium, or other regulated compounds such as organotin, special precautions and handling of debris may be necessary. Inspection of contaminant and disposal requirements, especially site storage requirements, are part of a Coating Inspector's activities. SSPC Guides 6 and 7 present information useful to the inspector and sections of these guides may be referenced in the specification. On lead removal projects, inspectors should be familiar with OSHA requirements for their own health and safety.

5.5 *Inspection of Surfaces Prior to Field Painting:*

5.5.1 *New Construction*—It should be emphasized that the first coat should be applied to the cleaned surfaces before any soiling or deterioration can occur. If painting is done outside, the cleaned areas should receive the first protective coat well before nightfall brings lower temperatures and possible moisture condensation on the surfaces. When surface preparation and painting are carried on indoors, overnight delays between coating and painting may be permissible except on blast-cleaned surfaces.

5.5.1.1 Shop-coated steel that has been shipped to the erection site should be stored on blocks to prevent contact with the ground, and where it is least likely to be marred, scratched, or subjected to harmful contamination by grease, oil, salt, etc. Insofar as practicable, the steel should be stored to avoid the formation of waterholding pockets. If outdoor storage lasts for several months, the inspector should check the integrity of the coating from time to time and verify that deficiencies are corrected in accordance with the contract document. The length of time between shop priming and erection and subsequent topcoating should be kept to a minimum to avoid the problem of intercoat adhesion.

5.5.1.2 Immediately before applying the first field coat, the shop-coated surfaces should be cleaned of dust. If necessary to remove grime and oil substances, they can be wiped, steam cleaned, power washed with detergents or cleaned with solvents selected so as not to soften the film appreciably. Miscellaneous scratches and breaks in the shop coat, including those occasioned by field welds, bolts, or rivets, should be cleaned, feathered and touched-up as specified before the steel receives the first overall field coat.

5.5.1.3 The inspector should ensure that field rivets have been cleaned of slag and weld spatter. It is important that every coat of the system be applied over dry, soil-free surfaces, and that all previous coats be free of mechanical damage. Great care should be exercised to prevent trapping corrosive salts under or between coats.

5.5.1.4 The inspector should determine whether the specifications are being followed with reference to the painting or prohibition of painting of contact surfaces in bolted or riveted surfaces of construction. He should ensure that surfaces not in contact but that will be made inaccessible by assembly or

erection, have received the full number of specified coats before they become inaccessible.

5.5.2 *Maintenance Repainting*—In most cases, maintenance repainting will consist of spot-cleaning and priming of small isolated areas of deterioration, followed by application of one overall new finish coat to all surfaces of the structure. The inspector of maintenance repainting should be alert for several conditions not encountered in the painting of new work.

5.5.2.1 Sound coating not intended to be removed should not be damaged by cleaning operations on adjacent areas. This is particularly important with spot-blast cleaning.

5.5.2.2 The junctions between sound coating and spot-cleaned areas should present a smooth, feathered appearance. The application of coating to spot-cleaned areas should overlap the old, adjacent coating to a slight extent to ensure full coverage of the cleaned areas. Before the overall finish coat is applied, the inspector should ensure that oil, grime, dust, and other contaminants are cleaned from the old coating surfaces.

5.5.2.3 Salt contamination of the substrate for both total coating removal and overcoating can be an issue. Some specifications put limits on the allowable amount of surface soluble salts. Inspectors may be called upon to measure soluble salt concentrations on the substrate surface. SSPC Guide 15 presents several methods for extracting salts from the surface and several methods for measuring the salt concentration in the extract. Surface soluble salt concentrations should be measured in areas where salt would most likely be present such as pitted areas.

5.5.2.4 Adhesion of the newly applied coat to the old coating should be carefully checked. Practice **D5064** presents the procedure for evaluating adhesion of maintenance coatings.

5.5.2.5 Under the direction of the engineer, the inspector may explore beneath the surface of the existing or new coating film for covered-over rust or loosening of the old film, and where he discovers such conditions, require that the surface be cleaned and repainted.

5.5.2.6 The effect of the newly applied coating on the old underlying coating should be noted. Any coating that shows curling, lifting, or wrinkling should be reported to the engineer immediately since it may have to be removed and the area repainted. If the defects are general, rather than existing in a few isolated areas, use of a different type of coating may be necessary.

6. Coating Storage and Handling

6.1 *Storage of Coating and Thinner*—All coatings and thinners should be stored in areas or structures that are well-ventilated and not subject to excessive heat, open flames, electrical discharge, or direct rays of the sun. Storage should be in compliance with applicable regulations and the manufacturer's written instructions. Materials susceptible to damage at low temperatures should be stored to prevent freezing, such as in heated areas. Too high a storage temperature reduces the shelf life of the coating. If a coating is stocked for a considerable length of time (several months), it is desirable to invert the containers at monthly intervals. This will prevent hard settling and thus make mixing quicker and easier when the coating is to be used.

6.1.1 Coating containers should remain unopened until needed, and the oldest should be used first. The manufacturer's written instructions should be followed regarding shelf life. Coatings that have livered, gelled, skinned, or otherwise deteriorated during storage should not be used. If a particular material is in question, do not use it until it has been tested by the manufacturer or independent laboratory and found to be satisfactory.

6.1.2 Where a skin has formed in the container, the skin should be cut loose from the sides of the container, removed, and discarded. If it is felt that the skins are thick enough to have a practical effect on the composition, the remaining paint should not be used until it has been tested and found to be satisfactory.

6.2 *Mixing of Coatings*—All coatings should be thoroughly and completely mixed in the containers in which they were supplied. When it is not possible to use the supplied containers other clean containers may be used for mixing. Where there is noticeable settling, and mixing is done either by power agitators or by hand, most of the vehicle should be poured off into a clean container. The pigment is then lifted from the bottom of the container with a clean, broad, flat paddle, lumps broken up and the pigment thoroughly mixed with the vehicle present. The poured-off vehicle should be returned slowly to the original container with simultaneous agitation. It is also useful at this point to mix or pour repeatedly from one container to another (boxing) until the composition is uniform. The bottom of the original container should be inspected for the unmixed pigment. Two component paints should be mixed by agitation only, and not with boxing. After the individual components are homogenous, they are intermixed with agitation in the order stated in the manufacturer's instructions, that is, add Part B to Part A. The coating should not be mixed or kept in suspension by means of an air stream bubbling under the coating surface.

6.2.1 Some coatings may require straining after mixing, to ensure homogeneity and to remove skins and foreign matter. The strainers should be of a type to remove only skins, etc., but not to remove pigment. For example, a 297- μm (50-mesh) strainer is normally satisfactory for most coatings, unless some specific size is required in the specification. Containers should be covered when not in use, to reduce volatile losses and skinning.

6.2.2 Coatings should be agitated enough during application to ensure homogeneity. Some materials may even require constant agitation during use.

6.2.3 Coating materials which cure by chemical reaction may require an induction time to allow the components to partially react prior to thinning or application.

6.2.4 The components of plural component coatings should be thoroughly mixed as described in 6.2.1 and then pre-heated to the temperature recommended by the coating manufacturer. The two components are subsequently pumped in the required volume ratio by plural component equipment through heated or insulated lines coating lines to specialized mixing equipment located immediately before the spray gun.

6.3 *Thinning*—Some specifications permit field thinning of coatings while others do not. This section describes some commonly accepted procedures when thinning is permitted.

6.3.1 *Initial Samples*—When thinning on the job site is permitted unless other arrangements have been made, (for example using manufacturer-supplied thinner from unopened containers and complying with the manufacturer’s written thinning instructions), the painting inspector may need to submit to an agreed-upon testing laboratory a sample from each batch to be thinned, together with a sample of the thinner to be used, using clean sample containers in both cases. A request is submitted with these samples for advice on the proper thinning rate for the conditions prevailing and the consistency limits of the thinned coating.

6.3.2 *Thinning of Coating*—All additions of thinner should be made in the presence of the inspector, and only amounts or types of thinner permitted by the specification or manufacturer, or both, should be added. Thinning is carried out by pouring about half of the thoroughly mixed coating into an empty, clean container. The required thinner is then added and the two portions are remixed to obtain a homogenous mixture.

6.3.3 *Sampling of Thinned Coating*—During the work, unless otherwise specified, additional samples need not be submitted for testing unless a deviation is noted in the coating consistency, or if it is suspected that there has been a change in the thinner.

6.3.3.1 When an inspector is qualified and has the necessary equipment available at the field office, arrangements may be made for on-site inspection of thinning and of the thinned coating. This speeds acceptance of a coating. The inspector should keep a record of all paint modifications, amount of thinning, weight per gallon, and viscosity. Where dry-film thickness is specified, the inspector should verify the new wet film thickness necessary to obtain the desired dried thickness with the thinned coating. Compliance with the specification should be based on dry-film thickness when specified.

6.3.3.2 To estimate the wet-film thickness of the thinned coating required to obtain the specified dried-film thickness, the percent volume of the nonvolatile (solids) in the original coating must be known. This figure is readily obtained from the manufacturer. With this information the calculation may be made as follows:

$$W = \frac{D(1.0+T)}{S} \quad (1)$$

where:

- W = wet-film thickness,
- D = desired dry-film thickness,
- S = percent by volume (expressed as a fraction) of coating solids, and
- T = percent by volume (expressed as a fraction) of thinner added.

6.4 *Heating of Coating*—Coating as delivered in the manufacturer’s containers and mixed thoroughly is ready for use unless the specification permits on-site thinning of high-viscosity material. When the temperature of the liquid coating is low (below 10°C (50°F)) the consistency (viscosity) may increase to the point that application is difficult. When thinning

is not permitted, the coating may be heated. Should the contractor wish to reduce the viscosity by heating, to make application easier, the containers may be warmed in hot water, on steam radiators, by storing in a warm room, or by other acceptable indirect heating processes. In-line heaters are also available for application equipment. Direct application of flame to the containers is forbidden by fire regulations. It should be noted, however, that heating of the coating alone will not compensate for ambient or surface temperatures, or both, if they are below the minimum specified for that material. For products to be applied by plural component spray this section does not apply, see 6.2.4.

7. Weather Considerations

7.1 *Drying*—Temperature and relative humidity limitations presented in the specification or manufacturer’s product data sheet are mandatory. Environmental conditions such as temperature and relative humidity can affect the cure of most coatings.

7.2 *Low Temperature*—Many specifications indicate temperature limits between which painting may be undertaken. The typical minimum temperature (air, material and surface) is usually 5°C (40°F), but may be as low as –18°C (0°F) for “cold-curing” one or two component systems or 10°C (50°F) for conventional two component systems. The requirements may state further that painting should not be undertaken when the temperature is dropping and within 3°C (5°F) of the lower limit. However, some authorities believe that some coatings may be applied at (or below) 0°C (32°F) without adverse effects. Within the limitations of the composition of the coating, this may be satisfactory, depending upon the type of coating and providing the surface is dry. Painting over ice or frost will result in early adhesion failure of the coating.

7.3 *High Temperature*—The maximum reasonable surface temperature for application is 50°C (125°F) unless clearly specified otherwise. A surface that is too hot may cause the coating solvents to evaporate so fast that application is difficult, blistering takes place, or a porous film results. To keep the temperature down it may be desirable, where practical, to paint under cover at a shop or to protect the surface from the sun with tarpaulins.

7.4 *Moisture*—Painting should not be performed in rain, snow, fog, or mist, or when the temperature of the surface is less than 3°C (5°F) above the dew point. This is especially true in spring and fall when days are warm and nights are cool. Wet surfaces should not be painted unless the coatings are specifically designed for that condition. Relative humidity is usually an indicator of condensing conditions. High humidity can also affect the cure of some coatings. Specifications often contain an 85 % upper limit. If it is suspected that the temperature and humidity conditions are such that moisture is condensing upon the surface, measure the relative humidity and dew point as described in 10.2.1.2.

7.4.1 When coatings must be applied in damp or cold weather, the substrate should be painted under cover, or protected from the surrounding air, and the steel heated to a satisfactory temperature. The steel should remain under cover

until the applied coating is dry or until weather conditions permit its exposure in the open.

7.4.2 Newly applied coatings improperly exposed to freezing temperatures, excessive humidity, rain, snow, or condensation should be removed, the surface again prepared and painted with the same number of coats as the undamaged area.

7.5 *Wind*—The wind direction and velocity should be considered when applying coatings in areas where airborne overspray could damage automobiles, boats, and structures nearby. Heavy winds result in considerable loss of coating and excessive drying of the droplets reaching the surface. This results in an inability of the film to flow together (dry spray). If uncorrected, dry spray may create holidays, leading to poor performance, and it can interfere with adhesion of the applied or subsequent coat. Thinning with slower evaporating solvents may reduce or eliminate dry spray and produce a smooth surface. These problems can be avoided by utilizing brush or roller application methods instead of spray, scheduling the work at the less windy times of day, changing materials to the fast-dry types that do not adhere or damage adjacent property, or scheduling the work when the wind is blowing in a direction where dry spray will not cause damage.

8. Coating Application

8.1 *Residual Contaminants*—Visually inspect the surface immediately prior to painting to ensure that spent abrasive, dust, and debris have been completely removed. ISO 8502-3 can be used to determine levels of residual dust. Dust removal should be considered satisfactory when the path left by a gloved hand wiped over the surface is barely discernible when viewed from a distance of 1 m (3 ft). During the inspection, also ensure that any oil or grease contamination that may have become deposited on the surface is completely removed. Removal of oil or grease contamination can be accomplished by solvent, steam, or detergent cleaning in accordance with SSPC-SP 1.

8.2 *Quality Assurance*—The inspector should consult the manufacturer's product data sheet and ensure that (1) coatings received meet the description of the products acceptable under the requirements of the specification; (2) they are properly mixed and thinned (where allowed); (3) colors match a visual standard provided; (4) that proper precautions have been taken to prevent damage to adjacent areas from cleaning and painting operations; (5) working practices are so scheduled that damage to newly applied coating is minimized; (6) application equipment (brushes, spray) is acceptable for type, cleanliness, and usability; (7) weather conditions are acceptable under the requirements of the specification; (8) field-testing equipment on hand is in satisfactory working order ready for use; and (9) only the methods of application permitted under the specification are used, and that their use is in accordance with 8.3 – 8.7. SSPC-PA 1 is a specification for application of coating.

8.2.1 *Film Defects*—All coats should have nearly smooth surfaces relatively free of dry spray, overspray, orange peel, fish eyes, pinholes, craters, bubbles, or other significant defects. Bleed-through, insufficient hiding, skips, and misses are not acceptable. Runs and sags should be brushed out during application or removed by sanding if the coating has cured.

Abrasive, dirt, or other debris that becomes embedded in the paint film should be removed and the affected area touched up with the same coating prior to the application of subsequent coats.

8.3 *Brush Application*—Painting by brush should be done in a neat, workmanlike manner to produce a smooth coat as uniform in thickness as possible. The technique is from dry to wet, with the coating applied to the surface and spread back to the wet edge of the previous strokes. Coating should be worked into all irregularities in the surface, crevices, and corners. Runs, sags, or curtains should be brushed out. Surfaces that are inaccessible for painting with brushes and on which spraying is not permitted should have coating applied by means of sheepskin daubers. The specification may require “stripe coating” to provide adequate film thickness on places prone to premature breakdown. Edges and corners of all metal work, nut heads, bolts and nuts, and all individual members, bars, shapes, and plates should be striped by brush painting in advance of the application of coating to other parts. SSPC-PA Guide 11 addresses “stripe coating” technique.

8.3.1 Brushes should be of good quality, with pliable bristles that are compatible with the coating, and of suitable size to match the area being coated. They should not exceed 100 mm (4 in.) in width, and bristle length should be no less than 90 mm (3½ in.). The brushes should be kept in a clean, acceptable condition when not in use. The inspector should prohibit the use of any brush not in an acceptable condition.

8.4 *Spray Application*—Spray application may or may not be allowed. Often it is acceptable in fabricating shops, but because of the possibility of damaging surrounding property or coating films overspray, it may not be permitted in the field. The inspector should be familiar with the different kinds of spraying, which are compressed air spray, airless spray, air-assisted airless spray, plural component, electrostatic spray, and high-volume low-pressure spray.

8.4.1 The equipment should be suitable for the intended purpose, capable of properly atomizing the coating to be applied, and be equipped with suitable pressure regulators and gages. The equipment should be kept in a suitably clean condition to permit proper coating application without depositing dirt, dried coating, and other foreign materials in the film. Any solvents left in the equipment should be completely removed before applying coating to the surface being painted.

8.4.1.1 The air supply for conventional and hot spray application should be free of moisture or oil. This can be verified by performing the white blotter test in accordance with Test Method D4285.

8.4.1.2 Airless spray equipment should be properly grounded.

8.4.1.3 In the case of plural component spray equipment, the equipment must be set to deliver the correct ratio of coating components to the spray gun. The temperature of the coating components shall be strictly maintained per the manufacturer's application instructions.

8.4.2 Coating ingredients should be kept properly mixed in spray pots or containers during coating application, either by continuous mechanical agitation or by intermittent agitation. Coating should be applied in a uniform layer, with overlapping

at the edge of the spray pattern. The spray pattern should be adjusted so that the coating is deposited uniformly. During application the gun should be held at right angles (perpendicular) to the surface (not arced or fanned) and at a distance that will ensure that a wet layer of coating is deposited on the surface. The trigger of the gun should be released at the end of each stroke. Poor spray technique resulting in excessive overspray (a sand-like finish) should not be tolerated. All runs, sags, or curtains should be brushed out immediately or sanded out if the coating has cured.

8.4.3 Brush striping of edges, welds, and other vulnerable locations may be specified. Brush or sheepskin daubers are used to coat all areas inaccessible to the spray gun and brushes are used to work coating into cracks, crevices, and blind spots that cannot be adequately spray painted.

8.4.4 Particular care should be observed with respect to type and amount of thinner, coating temperature, and operating techniques in order to avoid depositing coating that is too viscous, too dry, or too thin when it reaches the surface.

8.5 *Roller Application*—Rollers that are clean and of a material not soluble in the coating to be applied should be used. Roller covers are available in a variety of diameters, lengths, types of fabric, and fiber lengths. The nap (length) used on metal surfaces, generally varies from 6 to 19 mm ($\frac{1}{4}$ to $\frac{3}{4}$ in.). The longer fibers hold more coating but do not provide as smooth a finish. Therefore their use is generally restricted to rougher surfaces such as the substrate and faster drying coatings. Short nap rollers give a smoother finish and are generally used for applying the top coat. There are also specialized rollers available for use on pipes and fences, and even pressure rollers that continually feed the coating to the roller cover.

8.5.1 The roller cover should be dipped into the coating until it is saturated and then rolled along the tray ramp until the coating is completely wetted in. The first load of coating on the roller should be applied to scrap material to force out air bubbles trapped in the nap. Proper roller technique requires application in the form of a V or W depending on the size of the area involved. The coating should then be cross-rolled to fill in the square created by the boundaries of the initial application. Only moderate pressure should be used, as heavy pressure can cause foaming and possible cratering by entrapped air. Application should be finished with light perpendicular strokes in one direction (usually vertical) to provide the smoothest, most uniform finish.

8.6 *Miscellaneous Methods*—Methods such as pads, mitts, and squeegees or trowels are used for specialized products or in situations where the conventional methods are not suitable due to the location or configuration of the work.

8.6.1 Painter's pads generally consist of a roller-type synthetic fabric attached to a foam pad. The size is generally 100 by 175 mm (4 by 7 in.) and the fiber length is 5 mm ($\frac{3}{16}$ in.). Application technique with a pad on large surface areas is similar to that used with a roller.

8.6.2 Painter's mitts are lamb skin gloves that are dipped into the coating and are rubbed across the surface. They are ideal for application of coatings to small, odd-shaped surfaces.

8.6.3 Squeegee or trowel application is generally used for heavy-bodied thick-film coatings that cannot be applied by spray.

8.7 *Rate of Application*—Properly written specifications require certain minimum and maximum dry-film thicknesses for each coat. Wet-film thickness measurements are useful to check as the work progresses to determine reasonably well that the desired amount of coating is being applied. Later, when the films are dry, the inspector may make spot checks with a dry-film measuring gage to ascertain acceptability of the coatings. Film thickness measurements are more informative than visual inspection, which may show only obvious nonuniform application. Instruments for measuring film thickness and the procedures for their use are described in 10.2.3. Nondestructive dry-film thickness gages and measurements are preferred, and applicable to metal substrates only.

8.7.1 Thickness or coverage requirements apply to the whole structure, not some specific part. It is important to note that the painting inspector check all areas and determine the film thickness for each coat. For instance, if the "shop coat" requires a minimum of 50 μ m (2 mils) dry-film thickness, the inspector should ensure that it is obtained within the tolerance permitted in SSPC-PA 2. The areas tested should be identified and recorded so that the dry-film thickness of added coating can also be determined. With nondestructive measuring instruments a 15-m (50-ft) long and 1.8-m (6-ft) high I-beam can be tested in 30 min, and low areas if any, properly marked and recorded in the inspector's book. Because the shop prime coat inspector may not be the person doing the field coat application inspection, it is very important to record test results and send a copy to the field inspector in order to better determine thicknesses of subsequently applied coats.

9. Additional Considerations

9.1 *Ventilation*—It is essential when performing surface preparation or painting in enclosed spaces that adequate ventilation is provided for removal of dust and solvents.

9.2 *Shopcoat Repair*—Normally after erection work, such as riveting, bolting, welding, straightening, etc., has been completed satisfactorily, areas of the shopcoat will be found to have been damaged. Damaged or bare areas should be thoroughly cleaned, prepared, feathered and repainted with one new coat of shop or field primer. In addition, crevices and small cracks should be thoroughly cleaned and spot-primed. After drying, the crevices and cracks can be filled with an acceptable caulking compound as required by the specification. The specified field coats should then be applied over the entire structure.

9.3 *Painting Schedule*—As indicated in 5.4.4, painting should proceed by sections, bays, or parts of the work, and each coat in each section should be applied entirely and accepted by the inspector before a succeeding coat is applied. Except for any shop coat touch-ups made necessary by welding, etc., none of the metal that will be exposed to view in the completed structure should be field-painted until all associated concrete has been placed. Care should be taken by the contractor during painting operations to protect adjacent surfaces from being stained by the coating being applied. Any

stained surface will need to be restored to its original condition without damage to that surface.

9.4 *Film Integrity*—Each coat should be applied as a continuous film of uniform thickness, free of holidays and pores. Any thin spots or areas missed in the application should be repainted and permitted to dry before the next coat is applied.

9.5 *Recoat Time*—Each coat should be dried throughout the full thickness of the film before application of the next succeeding coat. Coating is considered dry for recoating when the next coat can be applied without the development of any detrimental film irregularities such as wrinkling, lifting, or loss of adhesion of the previous coat. For most coatings the time to dry for recoat, even under optimum conditions varies with their composition and that of the subsequent coat. Thus, an oil-based coating may take 2 to 3 days to harden sufficiently to be overcoated with a coating of the same type. However, it may take 3 or 4 months to harden to be satisfactorily overcoated with a vinyl coating or other type of coating containing strong solvents. Some coatings have maximum recoat times. The coating manufacturer's written instructions should be followed for recoat times.

9.6 *Coating System Failure*—Defective coatings should be removed in their entirety, the surface re-cleaned, and the specified coatings, or their alternatives, applied.

10. Inspection Equipment

10.1 *General*—Visual observation is the most important part of inspecting the coating application. There are, however, instruments and mechanical aids that help the inspector. They make the painter aware that his work can be checked during progress and even after completion. The different instruments that can be used are described in this section.

10.1.1 *Surface Profile Gages*—The inspector can determine the surface profile of blast-cleaned steel substrates using Test Methods D4417, SSPC-PA 17 provides a procedure to determine conformance with the profile requirements. Some of the common instruments are:

10.1.1.1 Surface profile comparator for visual comparisons of the profile against a reference disk for sand, grit, and shot blast-cleaned steel.

10.1.1.2 Depth micrometers with conical points to project into the valleys to determine profile depth.

10.1.1.3 Tape, to create an exact replica of the profile on a special material. The tape is measured in the field using a spring micrometer to determine average maximum profile height.

10.1.2 *Adhesion of Existing Coating*—The inspectors should carry a pocket knife that can be used to determine the soundness of existing paint where there might be blistering underfilm corrosion. This is a subjective test and its value depends upon the inspector's experience. The cross-cut test, Test Methods D3359, and knife adhesion test, Test Method D6677, are more reproducible.

10.1.3 *Portable Pull-Off Adhesion Testers* are available as described in Test Method D4541. The testers measure the force required to remove a metal stud that has been cemented to the coated surface.

10.2 *Field Inspection Equipment* in good working order should be available to the inspector so that he may perform his function properly.

10.2.1 *Drying and Curing Times*—These are both important considerations, since dry time and cure time can both be affected. Minimum temperatures are required for reactive and water-borne coatings while too high a temperature can make application difficult or cause film defects such as pinholing. Inorganic zinc-rich primers and moisture-cure urethanes require certain minimum humidity conditions for proper cure. The manufacturer's recommendations should be followed.

10.2.1.1 *Thermometers*—The paint inspector may need several types of thermometers and should have at least an accurate pocket thermometer with a range from about -18 to 65°C (0 to 150°F) for measuring the air temperature. The same thermometer or a floating dairy thermometer may be used to determine the temperature of liquid coating, solvent, etc. Flat surface-temperature thermometers are also available for measuring the substrate temperature, as in an infrared gun.

10.2.1.2 *Relative Humidity and Dew Point*—A psychrometer containing a wet and dry-bulb thermometer for determining relative humidity and a dew point chart is a useful inspection tool. Hand-held sling or electrical types are available as well as a direct-reading digital type. Atmospheric conditions, including air temperature, relative humidity, dew point, and surface temperature should be measured and recorded at the location where work is being performed.

10.2.2 *Wet-Film Thickness Gages*—This type of instrument is used to measure the thickness of a wet film of paint *immediately* after it is applied to a surface. Note that erroneous readings may result when using the gage on fast-drying paints such as inorganic zinc or vinyl. If a wet-film gage is used to determine the thickness of coats subsequent to the first, great care must be taken that partially hardened undercoats are not indented by the gage, thus giving high readings. If the coat being measured has an appreciable softening effect on the previous coat, a wet-film thickness gage cannot be used with accuracy. It is very important to record and retain test results.

10.2.2.1 *Interchemical Gage*—This instrument is rolled over the newly applied wet film on a *smooth* flat portion of the surface and the thickness read directly in mils (micrometers). Complete details are given in Method A of Test Methods D1212.

10.2.2.2 *Notched Gage*—This device has a series of calibrated steps for measuring thin to heavy coats. This gage with the proper face is placed squarely on the fresh, wet film. It is then withdrawn perpendicularly *without a sliding movement*. The true wet-film thickness lies between the highest step coated and the next highest, which was not coated. The procedure is described in Practice D4414.

10.2.3 *Dry-Film Thickness Gages*—Dry-film thickness measurements are of great importance because the film thickness of many coatings must be within a specific range in order to provide the intended level of service. There are two ways of making the measurements, nondestructively or destructively. Nondestructive dry-film thickness gages are preferred, as they do not damage the coating. Destructive gages involve penetrating or cutting through the film to the substrate with a needle or

blade and measuring by some means the distance between the top and bottom of the film. This type of gage destroys the film, necessitating touch up with primer and finish to prevent corrosion at these spots. One kind of cutting device is described in 10.2.3.4.

10.2.3.1 *Nondestructive Film Thickness Gages* are widely used for field and shop inspection. For ferrous metals they are based on magnetism, and for nonmagnetic metals on inductance and eddy currents. All of the different types require verification of accuracy on standards, the thickness of which is known and in the same range as the coating to be measured. Gage adjustment can be made on metal of the same kind, temper, thickness, and contour as that beneath the coating. Practice **D7091** describes the procedures. Measurements on rough surfaces, such as a blast-cleaned surface, may be misleading unless the instrument is adjusted to an identical surface.

10.2.3.2 *Magnetic-Type Gages* use either an electromagnet requiring a permanent power supply or a permanent magnet. Practice **D7091** describes the procedure for using magnetic gages. SSPC-PA 2, includes instructions on the number of measurements for different areas and tolerances on the required film thickness.

10.2.3.3 *Eddy-Current-Type Gages* are based on inductance and eddy current techniques, and are described in Practice **D7091**. SSPC-PA 2 includes instructions on the number of measurements for different areas and tolerances on the required film thickness.

10.2.3.4 *Destructive Thickness Gage*—This inspection gage is designed to measure coating film thickness by microscopic observation of a cut into the film. A tungsten carbide cutting tip is specially shaped to slice a precise narrow groove or cone through a film into the substrate. Thickness of coating on any type of stable substrate may be determined, and individual coats may be measured separately providing they are distinguishable, for example, by color. The coating cannot be too brittle or soft, otherwise the cutting tip will tear rather than precisely cut through the coating, making accurate readings impossible. Test Methods **D4138** presents the procedure for using this type of gage.

10.2.4 *Holiday Detectors*—Pinholes and holidays are discontinuities in a coating film that may be invisible to the naked eye. They allow moisture to penetrate to the substrate. Holiday testing is usually performed on coatings intended for immersion service. Holiday testing is performed before final cure of the coating has occurred so that a successful repair can be made if any are detected. Pinhole and holiday detectors are either low voltage or high voltage. Their use and operation is presented in Practice **D5162**.

11. Keywords

11.1 coating application; coating inspection; industrial structures; metal substrates; painting

APPENDIX

(Nonmandatory Information)

X1. INSPECTION CHECKLIST

X1.1 The checklist in **Fig. X1.1** lists the key elements to be used for inspection of industrial coating work. Many of the details covered may be in a specification for a particular

project. A job specification for painting should include the coatings to be used. The various items are explained in detail in the text of this guide.

TASK

I	<p><i>Surface Condition Examination:</i></p> <ol style="list-style-type: none"> 1. Condition of edges, weld splatter 2. Grease or oil, or both 3. Chalk, mildew 4. Protective coverings in place 	<p><i>Test Method/Equipment:</i></p> <ol style="list-style-type: none"> 1. Visual observation and touch 2. Visual observation and clean white rag 3. Visual observation and magnifying glass 4. Visual observation 	<p><i>Comments:</i></p> <p>Many materials if not removed from the surface will affect the life of the coating. These include oil, grease, soil, weld splatter, and slag, which make it impossible to obtain proper adhesion to the metal surface (5.2.1, 5.4). Careful observation is the key to making certain that a sound surface is available for painting.</p>
II	<p><i>Environmental Conditions:</i></p> <ol style="list-style-type: none"> 1. Air temperature 2. Surface temperature 3. Wind direction, velocity 4. Dew point, RH 5. Visible moisture 	<p><i>Test Method/Equipment:</i></p> <ol style="list-style-type: none"> 1. Air thermometer 2. Surface thermometer 3. Wind gage 4. Psychrometer 5. Direct observation 	<p><i>Comments:</i></p> <p>Environmental conditions must be within specified limits to obtain adhesion and proper film formation. Verify that air temperature, humidity surface temperature, and dew point spread are appropriate (see Test Method E337).</p>
III	<p><i>Safety on the Job:</i></p> <ol style="list-style-type: none"> 1. Protective clothing 2. Respirator 3. Safety glasses 4. Ear protection 	<p><i>References:</i></p> <ol style="list-style-type: none"> 1. OSHA Hazard Communication Standard 2. Product SD sheets 3. Municipal and state regulations 	<p><i>Comments:</i></p> <p>There are a number of hazards associated with any painting operation; safety regulations should be observed and unsafe conditions or practices should be reported promptly to management (1.2, 5.3).</p>
IV	<p><i>Blast Cleaning:</i></p> <ol style="list-style-type: none"> 1. Type and size abrasive 2. Clean and dry abrasive 3. Recycled abrasive test 4. Compressed air check 5. Nozzle air pressure 6. Ambient conditions and dew point 	<p><i>Test Method/Equipment:</i></p> <ol style="list-style-type: none"> 1. Sieve analysis and visual observation 2. Visual observation 3. Water test 4. White blotter 5. Pressure gage 6. Thermometers and psychrometers 	<p><i>Comments:</i></p> <p>Verify the abrasive cleanliness and proper size and type to achieve specified profile (see Test Method D4940). Verify that air supply is clean and dry (see Test Method D4285). Verify that air temperature, humidity, surface temperature, and dew point spread are appropriate (see Test Method E337).</p>
V	<p><i>Surface Preparation:</i></p> <ol style="list-style-type: none"> 1. Dust and abrasive removal 2. Surface Anomalies 3. Degree of cleanliness 4. Profile measurement 5. Magnetic base reading 	<p><i>Test Method/Equipment:</i></p> <ol style="list-style-type: none"> 1. Verify that all visible surface contaminants including oil, grease, dust, etc. have been removed. 2. Identify any burrs, slivers, scabs, and weld spatter visible after blasting. 3. Written definitions and pictorial standards 4. Replica tape, depth micrometers, or surface profile comparator (Test Method D4417). 5. Magnetic thickness gage (10.2.3) 	<p><i>Comments:</i></p> <p>Surface preparation is one of the most important factors affecting the performance of paint. The specifier will determine the proper level according to the expected service life of the structure and type of paint specified (5.1). <i>Surface Profile</i>—The texture of the metal surface has a significant effect on the performance of coatings since it increases the surface area to which the coating can develop adhesion.</p>
VI	<p><i>Coatings Application:</i></p> <ol style="list-style-type: none"> 1. Time from surface preparation to application 2. Materials 3. Coating viscosity 4. Compressed air check 5. Equipment 6. Protective coverings in place 7. Time application began 8. Surrounding air cleanliness 9. Continue to monitor temperature and humidity conditions 10. Correct coating and mixing procedure 11. Induction time observed 12. Proper percent agitation 13. Film thickness—wet —dry 14. Recoat Times observed 15. Intercoat Cleanliness 	<p><i>Test Method/Equipment:</i></p> <ol style="list-style-type: none"> 1. Record 2. Verify that the coating materials and thinners are as specified, properly labeled and stored, and are within their shelf life. 3. Dip-type viscosity cup Test Method D4212 4. Verify that air supply is clean and dry (see Test Method D4285). 5. Visual observation 6. Visual observation 7. Record 8. Visual observation 9. Verify that air temperature, humidity, surface temperature, and dew point spread are appropriate (see Test Method E337). 10. Record coatings batch numbers mixing procedure. Verify that the coating materials are mixed in accordance with the manufacturer's instructions. 11. Visual observation 12. Visual observation 13. Verify that the applicator is checking wet film thickness during the application process when required (see Practice D4414). Verify that the dry film thickness is within the specified range after each coat (see Practice D7091). Verify that the total coating system's dry film thickness is within the specified range (see Practice D7091). 14. Record time application completed. 15. Verify that parameters during recoat are observed and that no surface contaminants are present. 	<p><i>Comments:</i></p> <p>Many factors are important in ensuring proper application of coatings. The details are covered in this guide (Section 8). In particular, note: Dry-film thickness measurements are of great importance because the protection of the substrate is directly related to the thickness of the coating. There are two ways of making the measurements, nondestructively or destructively (10.2.3).</p>

TASK

- | | |
|-------------------------------|--|
| 16. Film defects, voids, etc. | 16. Visually inspect each coat for defects and uniform appearance; a holiday detector can be used to verify continuity of the coating film. |
| 17. Repairs | 17. Verify that all identified repairs have been properly made. Repeat inspection requirements and testing as appropriate. |
| 18. Final cuts | 18. Verify that the coating is cured in accordance with project requirements. Guidance for assessing degree of cure is found in Test Method D4752 (solvent rub of inorganic zinc), Practice D5402 (solvent rub of organic coatings), Test Method D3363 (pencil hardness). |

VII	<p><i>Recordkeeping:</i></p> <ol style="list-style-type: none"> 1. Record all details <ul style="list-style-type: none"> Applicator Manufacturer Batch #s Container condition 2. Record observations from Sections I, II, IV, V and VI 	<p><i>Test Method/Equipment:</i></p> <ol style="list-style-type: none"> 1. Inspector's log book 	<p><i>Comments:</i></p> <p>Maintenance of record book containing all transactions between the inspector and the contractor is essential to eliminate contract disputes. Details of the many steps involved in proper coatings application should be recorded (Section 4).</p>
-----	---	--	---

FIG. X1.1 Inspection Checklist

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org). Permission rights to photocopy the standard may also be secured from the Copyright Clearance Center, 222 Rosewood Drive, Danvers, MA 01923, Tel: (978) 646-2600; http://www.copyright.com/