



Standard Practice for Preparation of Zinc (Hot-Dip Galvanized) Coated Iron and Steel Product and Hardware Surfaces for Painting¹

This standard is issued under the fixed designation D6386; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

This standard has been approved for use by agencies of the U.S. Department of Defense.

1. Scope*

1.1 This practice describes methods of preparing surfaces of new and weathered hot-dip galvanized steel for painting with liquid paint and coating products. Preparing surfaces of new and partially weathered galvanized steel for powder coating is addressed in Practice D7803. Hot-dip galvanized steel is produced by the immersion of fabricated or unfabricated products in a bath of molten zinc, as specified in Specifications A123/A123M or A153/A153M. This practice covers surface preparation on iron and steel products and hardware that have not been painted previously. Galvanized surfaces may have been treated with protective coatings to prevent the occurrence of wet storage stain. This practice does not apply to sheet galvanized steel products nor to the coil coating or continuous roller coating processes. Sheet and coil surface preparation can be done in accordance with Practice D7396.

1.2 The values stated in SI units are to be regarded as the standard. The values given in parentheses are for information only.

1.3 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and to determine the application of regulatory limitations prior to use.*

2. Referenced Documents

2.1 ASTM Standards:²

A123/A123M Specification for Zinc (Hot-Dip Galvanized) Coatings on Iron and Steel Products

A153/A153M Specification for Zinc Coating (Hot-Dip) on Iron and Steel Hardware

¹ This practice is under the jurisdiction of ASTM Committee D01 on Paint and Related Coatings, Materials, and Applications and is the direct responsibility of Subcommittee D01.46 on Industrial Protective Coatings.

Current edition approved June 15, 2016. Published June 2016. Originally approved in 1999. Last previous edition approved in 2016 as D6386 – 16. DOI: 10.1520/D6386-16A.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

A780 Practice for Repair of Damaged and Uncoated Areas of Hot-Dip Galvanized Coatings

B201 Practice for Testing Chromate Coatings on Zinc and Cadmium Surfaces

D4285 Test Method for Indicating Oil or Water in Compressed Air

D6492 Practice for Detection of Hexavalent Chromium On Zinc and Zinc/Aluminum Alloy Coated Steel

D7091 Practice for Nondestructive Measurement of Dry Film Thickness of Nonmagnetic Coatings Applied to Ferrous Metals and Nonmagnetic, Nonconductive Coatings Applied to Non-Ferrous Metals

D7396 Guide for Preparation of New, Continuous Zinc-Coated (Galvanized) Steel Surfaces for Painting

D7803 Practice for Preparation of Zinc (Hot-Dip Galvanized) Coated Iron and Steel Product and Hardware Surfaces for Powder Coating

E376 Practice for Measuring Coating Thickness by Magnetic-Field or Eddy-Current (Electromagnetic) Testing Methods

2.2 Society for Protective Coatings Specifications:³

Surface Preparation Specification No. 1 Solvent Cleaning
Surface Preparation Specification No. 2 Hand Tool Cleaning
Surface Preparation Specification No. 3 Power Tool Cleaning

Surface Preparation Specification No. 7 Brush-Off Blast Cleaning

Surface Preparation Specification No. 11 Power Tool Cleaning to Bare Metal

Surface Preparation Specification No. 16 Brush-Off Blast Cleaning of Non-Ferrous Metals

Paint Specification No. 27 Basic Zinc Chromate-Vinyl Butyral Wash Primer

SSPC Guide 15 Field Methods for Extraction and Analysis of Soluble Salts on Steel and Other Nonporous Substrates

3. Summary of Practice

3.1 This practice describes the preparation methods that provide clean and suitable galvanized surfaces for painting,

³ Available from Society for Protective Coatings (SSPC), 40 24th St., 6th Floor, Pittsburgh, PA 15222-4656, http://www.sspc.org.

*A Summary of Changes section appears at the end of this standard

specifically so that an applied coating system can develop the adhesion necessary for a satisfactory service life.

3.2 The zinc coating is constantly in a state of change. From the time the steel part is removed from the galvanizing kettle, the exposed zinc coating interacts with the environment to form, first zinc oxides, next zinc hydroxides, and then zinc carbonates.⁴ The process of complete conversion of the outer layer of zinc carbonates can take up to two years of exposure to the environment, depending on the local climatological conditions. During the first stage, known as newly galvanized steel, the exposed surface consists mainly of zinc metal with a small amount of zinc oxide. During the second stage, known as partially weathered galvanized steel, the exposed surface consists mainly of zinc oxides and zinc hydroxides with some zinc carbonates. At the final stage, known as weathered galvanized steel, when the part has been openly exposed to the elements for more than twelve months, the exposed surface consists mainly of water-insoluble zinc carbonates, some zinc oxides, and rarely, zinc hydroxides. The surface preparation for each of these stages must be treated separately.

3.3 Variations in surface preparation produce end conditions that differ, hence they do not necessarily yield identical results when paints are subsequently applied. Service conditions will dictate the type of surface preparation to be selected, although the quality produced by any individual process may vary with different compositions of the zinc surface.

4. Significance and Use

4.1 This practice describes the procedures that can be used to prepare new and weathered zinc-coated surfaces on after-fabrication steel products for painting, and that can improve the bond of paint to the zinc surface.

5. Processes for Newly Galvanized Steel

5.1 *Newly Galvanized Steel*—The category of newly galvanized steel refers to zinc-coated steel that has no surface treatment after galvanizing, such as water quenching or chromate conversion coating, and has been galvanized within the previous 48 h. There also should be no visible signs of zinc oxide or zinc hydroxide, which first appear as a fine white powder.

5.2 *Surface Smoothing*—Hot-dip galvanized surfaces generally are relatively smooth after galvanizing. There may be some thick/rough edges at the drip line due to excess liquid zinc run-off during the galvanizing process, or high spots in the coating due to included iron-zinc intermetallics (dross) or zinc oxide particles. These high spots and rough edges must be smoothed to avoid paint film gaps in the areas of the high spots.

5.2.1 Zinc high spots, those that would cause paint film gaps such as the metal drip line, should be removed by smoothing with hand or power tools as described in SSPC Surface Preparation Specification No. 2 or No. 3. The zinc should be removed until it is level with the surrounding area, taking care

that the base coating is not removed by the smoothing methods. After smoothing, the surface shall be inspected for conformance to the required zinc thickness in accordance with Specifications [A123/A123M](#) or [A153/A153M](#) utilizing a magnetic thickness instrument in accordance with Practice [E376](#) and/or Practice [D7091](#). Any item falling below the required zinc thickness, before or after removal of any high spots, shall be repaired in accordance with Practice [A780](#).

5.3 *Surface Cleaning*—Hot-dip galvanized surfaces must be clean and free of oil and grease before they are painted. Soluble salts shall be removed to the degree specified in the painting/coating specification. Removal of Soluble salts can be extracted using SSPC Guide 15. Adhesion problems have been experienced with newly galvanized articles that have been water quenched or treated with chromate conversion coatings. These two post-galvanizing treatments are not recommended for galvanized articles that are to be painted. Practice [B201](#) or [D6492](#) can determine if contamination is on the galvanized surface prior to painting.

5.3.1 *Aqueous Alkaline Cleaning*—An alkaline solution, pH in the range of 11 to 12 definitely not greater than 13, can be used to remove traces of oil, grease, or dirt. The alkaline solution nominally is 2 to 5 % sodium compounds, with small additions of emulsifying, chelating, or sequestering agents, or a combination thereof. This solution can be applied through immersion in a tank filled with the solution, sprayed, or brushed with a soft bristle brush, usually nylon and not steel or copper. When dipping or spraying, the solution works best in the temperature range from 60 to 85°C (140 to 185°F). After cleaning, rinse thoroughly in hot water or water under pressure. Allow to dry completely before proceeding. Whenever galvanized steel is rinsed, it is desirable to use heated drying to accelerate the complete removal of water from the surface.

NOTE 1— An alkaline cleaner is unsuitable for removal of heavy build-up of zinc oxide or wet storage stain (see American Galvanizers Publications, *Wet Storage Stain*,⁵ for description of these conditions). See [5.3.3](#) or [5.4](#) for removal of zinc oxide layer.

5.3.2 *Solvent Cleaning*—Typical cleaning solvents, such as mineral spirits or high-flash naphtha, can be used to remove oil and grease. The procedure to be used is as specified in SSPC Surface Preparation Specification No. 1. Proper rags or brushes should be used to wipe the galvanized parts. (**Warning**—These rags or brushes should be cleaned or recycled often since oil can accumulate on their surfaces and be transferred back to the galvanized part.) Small parts may be dipped or cleaned in ultrasonic baths of solvents. After cleaning, rinse thoroughly in hot water or water under pressure. Allow to dry completely before proceeding.) Whenever galvanized steel is rinsed, it is desirable to use heated drying to accelerate the complete removal of water from the surface.

5.3.3 *Hand or Power Tool Cleaning*—Hand or power tool cleaning using equipment as specified in SSPC Surface Preparation Specification No. 2 or No. 3 is one method to clean light deposits of zinc reaction by products, such as light wet-storage stain.

⁴ This interaction is described in “Duplex Systems,” van Eijnsbergen, J.F.H., Elsevier Science, New York, NY 1994, and in *Zinc Handbook*, Porter, F., Marcel Dekker, Inc., New York, NY 1991.

⁵ Available from American Galvanizers Association (AGA), 6881 S. Holly Circle, Suite 108 Centennial, CO 80112, <http://www.galvanizeit.org>.

5.4 *Surface Preparation*—Hot-dip galvanized surfaces have a layer of zinc oxide and zinc hydroxide that must be removed before paint will adhere to the zinc coating. Zinc coatings generally are relatively smooth and may be slightly roughened prior to painting. The following five methods may be used to prepare the galvanized surface for painting.

5.4.1 *Sweep Blasting*—Abrasive sweep or brush blasting in accordance with procedures described in SSPC Surface Preparation No. 16, which uses a rapid nozzle movement will roughen the galvanized surface profile. The abrasive material must be chosen with care to provide a stripping action without removing excess zinc layers, removal of up to 25 microns (1 mil) is acceptable. One of the materials that has been used successfully is aluminum/magnesium silicate. Particle size should be in the range of 200 to 500 μm (8 to 20 mils). Other materials that can be used are soft mineral sands with a MOH hardness of five or less, organic media, such as corn cobs or walnut shells, corundum, and limestone. Depending on the value of hardness for the abrasive medium, blasting pressure may need to be determined for the appropriate nozzle to work-piece distance, geometry of the component, and blasting medium. For some all-alloy coatings, even the relatively low-pressure blast of 0.15 to 0.25 MPa (20 to 40 psi) can be too great, causing cohesion problems. Oil contamination of the compressed air will degrade paint adhesion to sweep-blasted hot-dip galvanized surfaces, Test Method for determining this contamination is D4285. Care is needed in averting this type of contamination. Care must be taken to leave zinc layers intact. The purpose of sweep blasting is to deform, not remove the galvanized metal. Any area falling below the required zinc thickness, before or after sweep blasting, should be repaired in accordance with Practice A780. The procedure for this process can be found in SSPC Surface Preparation Specification No. 16. Sweep blasting of zinc should be not less than 110 m^2/h (1200 ft^2/h) using these abrasive materials. The substrate should be maintained at a temperature greater than 3°C (5°F) above the dew point temperature. This procedure should be completed at the same location as the paint application.

5.4.2 *Surface Grinding*—Power tools such as grinders or sanders will roughen the surface of galvanized steel and produce a surface profile suitable for paint adhesion as per SSPC Surface Preparation Specification No. 11. The grinder or sander shall not be applied with sufficient force to remove all of the zinc coating rather a removal of up to 25 microns (1.0 mil) is acceptable. This procedure should be completed at the same location as the paint application.

NOTE 2—This grinding or sanding process may produce a sharper surface profile if the galvanized steel is over 50°C (122°F) as the zinc metal is softer at elevated temperatures.

5.4.3 *Zinc-Phosphate Treatment*—This conversion-coating process consists of reacting the newly galvanized zinc surface in an acidic zinc phosphate solution containing oxidizing agents and other salts for accelerating the coating action. The zinc surface is converted to a crystalline phosphate coating of the proper texture to inhibit corrosion and increase the adherence and durability of the paint film. This process may be applied by immersion, spray or soft bristle brush application. After a time period of 3 to 6 min, the surface should be washed

with clean water and allowed to completely dry before application of the paint system. Whenever galvanized steel is rinsed, it is desirable to use heated drying to accelerate the complete removal of water from the galvanized surface. This procedure should be completed at the same location as the paint application.

5.4.4 *Wash Primer Treatment*—This process involves the use of a metal conditioner to neutralize surface oxides and hydroxides along with etching the surface. One example of a wash primer is SSPC Paint Specification No. 27. The process is based on three primary components: a hydroxyl-containing resin; a pigment capable of reacting with resin and acid; and, an acid capable of making the resin insoluble by reacting with the resin, the pigment, and the zinc surface. The result is a film of approximately 8 to 13 μm (0.3 to 0.5 mils). Failures can occur if the film exceeds 13 μm (0.5 mils). The film usually is applied by spray but may be applied by soft bristle brush, dip, or roller coater. Using these latter coating methods, it may be difficult to control the film thickness. For drying time prior to top coating, follow the manufacturer's instructions. This wash primer treatment may be better suited to certain types of paint systems. See SSPC Paint Specification No. 27 for the best match of this treatment to a paint system. This procedure should be completed at the same location as the paint application.

5.4.5 *Acrylic Passivation/Pretreatment*—The passivation/pretreatment process consists of applying an acidic acrylic solution to the newly galvanized surface and then allowing it to dry, forming a thin film coating. When applied, the solution first reacts with the zinc surface forming a passivating conversion coating while simultaneously forming an acrylic coating suitable for painting on top of the passivation layer. The underlying conversion coating provides strong adhesion to the galvanized surface while the thin film acrylic layer provides barrier protection, which inhibits corrosion and provides a highly compatible surface for the application of organic paint films. There are versions of these solutions that contain chrome and versions without chrome. The application methods for these water based treatments are dipping, flow coating, spraying, or other appropriate means. Following application the coating is dried in an oven or in air. In some instances, the coating is applied to hot-galvanized articles, in which case separate drying is not necessary. Rinsing is not required. The coating is approximately 1- μm (0.04-mils) thick. Painting is possible any time during a period of four months after application, as long as the surface is free of visible zinc oxides or zinc hydroxides; however, if harmful contaminants, such as dust, dirt, oils, grease or deposits are present, they must be removed with a mild alkaline degreasing solution (pH 11.5 max) followed by a thorough rinse with hot water (60°C maximum temperature) or a pressure wash, then thoroughly dried. This treatment is applied in the galvanizing plant or later in the paint shop. When applied in the paint shop, the surface must first be appropriately cleaned as just described to remove contaminants picked up after galvanizing.

5.4.6 *Notification of Surface Treatment*—The paint shop must be notified as to how the galvanized articles have been processed and which surface treatment method, if any, is used

to prepare the surface. The method and extent of surface preparation shall be mutually agreeable to the purchaser and the supplier.

5.5 Coating Application Time—Blow down prepared surfaces with clean, dry compressed air following surface preparation. In some atmospheric conditions, such as high humidity or high temperature or both, the formation of zinc oxide on the freshly prepared surfaces will begin very quickly. Zinc oxide formation is not visible to the unaided eye; therefore, in any atmosphere, painting should be started as soon as possible and preferably within one hour after surface preparation but no later than eight hours after surface preparation.

6. Processes for Partially Weathered Galvanized Steel

6.1 Before preparing the surface of partially weathered galvanized steel, the surface must be checked for the presence of chromate conversion coating. The presence of a chromate conversion coating can severely impair the adhesion of some paint coating system. Chromate conversion coatings can be applied at the galvanizing facility to protect the newly galvanized surface from excessive growth of zinc oxide and zinc hydroxide, commonly called wet storage stain. The presence of chromate conversion coatings can be detected by the procedure outlined in [Appendix X1](#). The removal of the chromate conversion coating also is outlined in [Appendix X1](#). The acrylic passivation/pretreatment coating described in [5.4.5](#) is not a chrome conversion coating, but it may test positive using the procedure in [Appendix X1](#). The acrylic passivation/pretreatment coating does not need to be removed if it tests positive. If the galvanized surface has thick edges or high spots, these should be removed, see [5.2.1](#). When the high spots have been treated and the chromate has been removed completely by sanding or sweep blasting in accordance with [5.4.1](#), surfaces should be blown down with clean, compressed air. In some atmospheric conditions, such as high humidity or high temperature, or both, the formation of zinc oxide on the blasted surface will begin very quickly so the paint coating should be applied within 30 min after sweep blasting. Zinc oxide formation is not visible to the naked eye; therefore, in any atmosphere, painting should be as soon as possible after surface preparation.

6.2 Before preparing the surface of partially weathered galvanized steel, the surface must be checked for the presence of wet storage stain. Wet storage stain is the whitish zinc corrosion product formed when galvanized parts are exposed to moist air without sufficient air circulation between the parts and is described in the American Galvanizers Association Publication, *Wet Storage Stain*.⁵ Wet storage stain consists primarily of beta zinc hydroxide and small percentages of zinc oxide and zinc carbonate. Since wet storage stain is hygroscopic and has a larger volume than zinc metal, paint adhesion can be affected seriously when painting over wet storage stain.

Section [5.3.3](#) describes one method of removing wet storage stain. Another method is careful brushing with a mild ammonia solution using a soft bristle brush; this will remove mild cases of wet storage stain. Thorough water rinsing must immediately follow the brushing. More severe cases of wet storage stain that have thick white corrosion products on the zinc surface, or even black corrosion products, can be cleaned using vigorous soft bristle brushing with a mild acidic solution with a pH of 3.5 to 4.5, such as acetic acid or citric acid, but not hydrochloric or sulfuric acid solutions. Thorough water rinsing must immediately follow the brushing. After the part has completely dried, the surface shall be prepared in accordance with [5.4](#), and, then the surfaces should be blown down with clean, compressed air. If no protective treatment, such as those described in [5.4.3 – 5.4.5](#) is applied, in some atmospheric conditions, such as high humidity, or high temperature, or both, the formation of zinc oxide on the surface will begin very quickly so the paint coating should be applied within 30 min. If a protective treatment is applied, it is not necessary to paint immediately. Zinc oxide formation is not visible to the naked eye; therefore, in any atmosphere, painting should be started as soon as possible after surface preparation.

6.3 If there is no indication of either chromate conversion coating or wet storage stain, the surface can be prepared as detailed in [Section 5](#).

7. Processes for Weathered Galvanized Steel

7.1 Fully weathered galvanized steel, as described in [3.2](#), has developed a stable and finely etched surface that is very suited for paint coating adhesion. If there are organic contaminants, such as oil, grease, or soot on the surface of the part, surface cleaning in accordance with [5.3](#) should be performed before any other cleaning is done.

7.2 The natural corrosion of the zinc metal produces a roughened surface film consisting primarily of basic zinc carbonate. The surface preparation that is needed is a power wash with warm water to remove loose particles from the surface. The power wash should use water jets with a pressure of less than 10 MPa (1450 psi) so as not to damage the protective film. This film is naturally roughened in its growth process, so no extra surface profiling is needed. Allow the surface to completely dry before application of the paint system.

7.3 Fully-weathered galvanized steel can be painted successfully with the application of appropriate paint systems including primers and top coat paints. The use of pretreatments, such as those described in [5.4](#), can enhance paint adhesion and extend long term performance.

8. Keywords

8.1 galvanized steel; galvanizing; hot-dipped galvanizing; painting; paint preparation; surfacing preparation; zinc coating

APPENDIX**(Nonmandatory Information)****X1. IDENTIFYING THE PRESENCE OF AND REMOVING CHROMATE TREATMENTS USED AS WET STORAGE (ALSO CALLED HUMID-STORAGE) STAIN INHIBITORS**

X1.1 One of the inhibitors used by producers of zinc-coated steel is a hexavalent chromium solution. This treatment prevents adhesion of many paint coatings to zinc coated steel surfaces.

X1.2 If zinc-coated steel to be painted is galvanized to order, the order should prohibit the use of hexavalent chromium humid-storage strain treatments.

X1.3 Hexavalent chromium treatment can be removed from galvanized surfaces by one of the following three methods:

X1.3.1 Weathering the surfaces for six months, or

X1.3.2 Abrading the surfaces by sanding, or

X1.3.3 Sweep blast clean in accordance with 5.4.1.

X1.4 The presence of hexavalent chromium on galvanized surfaces can be determined by spot testing used Practice B201 or D6492.

X1.5 Conduct the spot test on several representative spots on each individual piece of galvanized steel.

X1.6 Test, in accordance with Practice B201 or D6492, every piece of galvanized steel that is to be treated for painting.

SUMMARY OF CHANGES

Committee D01 has identified the location of selected changes to this standard since the last issue (D6386–16) that may impact the use of this standard. (Approved June 15, 2016.)

(1) Revisions were made throughout the standard.

Committee D01 has identified the location of selected changes to this standard since the last issue (D6386–10) that may impact the use of this standard. (Approved May 1, 2016.)

(1) Sections 5.2 and 5.2.1 were revised.

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org). Permission rights to photocopy the standard may also be secured from the Copyright Clearance Center, 222 Rosewood Drive, Danvers, MA 01923, Tel: (978) 646-2600; http://www.copyright.com/