

---

---

**Test conditions for milling machines with  
table of variable height — Testing of the  
accuracy —**

**Part 1:  
Machines with horizontal spindle**

*Conditions d'essai des machines à fraiser à table de hauteur variable —  
Contrôle de la précision —*

*Partie 1: Machines à broche horizontale*



Reference number  
ISO 1701-1:2004(E)

© ISO 2004

**PDF disclaimer**

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

© ISO 2004

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office  
Case postale 56 • CH-1211 Geneva 20  
Tel. + 41 22 749 01 11  
Fax + 41 22 749 09 47  
E-mail [copyright@iso.org](mailto:copyright@iso.org)  
Web [www.iso.org](http://www.iso.org)

Published in Switzerland

# Contents

Page

Foreword.....	iv
<b>1</b> <b>Scope</b> .....	<b>1</b>
<b>2</b> <b>Normative references</b> .....	<b>1</b>
<b>3</b> <b>Terminology, designation of axes and milling operations</b> .....	<b>1</b>
<b>3.1</b> <b>Terminology and designation of axes</b> .....	<b>1</b>
<b>3.2</b> <b>Milling operations</b> .....	<b>4</b>
<b>3.3</b> <b>Description of machines</b> .....	<b>4</b>
<b>4</b> <b>Preliminary remarks</b> .....	<b>5</b>
<b>4.1</b> <b>Measuring units</b> .....	<b>5</b>
<b>4.2</b> <b>Reference to ISO 230-1</b> .....	<b>5</b>
<b>4.3</b> <b>Testing sequence</b> .....	<b>5</b>
<b>4.4</b> <b>Tests to be performed</b> .....	<b>5</b>
<b>4.5</b> <b>Measuring instruments</b> .....	<b>5</b>
<b>4.6</b> <b>Machining tests</b> .....	<b>6</b>
<b>4.7</b> <b>Minimum tolerance</b> .....	<b>6</b>
<b>5</b> <b>Geometric tests</b> .....	<b>7</b>
<b>5.1</b> <b>Axes of motion</b> .....	<b>7</b>
<b>5.2</b> <b>Table</b> .....	<b>10</b>
<b>5.3</b> <b>Spindle</b> .....	<b>15</b>
<b>5.4</b> <b>Arbor support</b> .....	<b>20</b>
<b>6</b> <b>Machining test</b> .....	<b>24</b>
<b>Annex A</b> (informative) <b>Equivalent terms in German, Italian, Dutch, Spanish and Swedish, corresponding to Figure 1</b> .....	<b>25</b>
<b>Annex B</b> (informative) <b>Equivalent terms in German, Italian, Dutch, Spanish and Swedish, corresponding to Figure 2</b> .....	<b>26</b>
<b>Bibliography</b> .....	<b>27</b>

## Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 1701-1 was prepared by Technical Committee ISO/TC 39, *Machines tools*, Subcommittee SC 2, *Test conditions for metal cutting machine tools*.

This first edition of ISO 1701-1 as well as ISO 1701-2:2004 cancels and replaces ISO 1701-0:1984, ISO 1701-2:1997 and ISO 1701-3:1997, which have been revised only editorially. The relevant sections of ISO 1701-0 have been incorporated into this part of ISO 1701.

ISO 1701 consists of the following parts, under the general title *Test conditions for milling machines with table of variable height — Testing of the accuracy*:

- *Part 1: Machines with horizontal spindle*
- *Part 2: Machines with vertical spindle*

# Test conditions for milling machines with table of variable height — Testing of the accuracy —

## Part 1: Machines with horizontal spindle

### 1 Scope

This part of ISO 1701 specifies, with reference to ISO 230-1, both geometric and machining tests on general purpose, normal accuracy, horizontal-spindle milling machines with table of variable height. It also specifies the applicable tolerances corresponding to the above-mentioned tests.

NOTE Milling machines with table of fixed height are covered by ISO 1984.

This part of ISO 1701 deals only with the verification of accuracy of the machine. It does not apply to the testing of the running of the machine (vibration, abnormal noise, stick-slip motion of components, etc.), nor to machine characteristics (such as speeds, feeds, etc.), as such checks are generally carried out before testing the accuracy.

### 2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 230-1:1996, *Test code for machine tools — Part 1: Geometric accuracy of machines operating under no-load or finishing conditions*

ISO 3855, *Milling cutters — Nomenclature*

### 3 Terminology, designation of axes and milling operations

#### 3.1 Terminology and designation of axes

See Figures 1 and 2 and Tables 1 and 2.

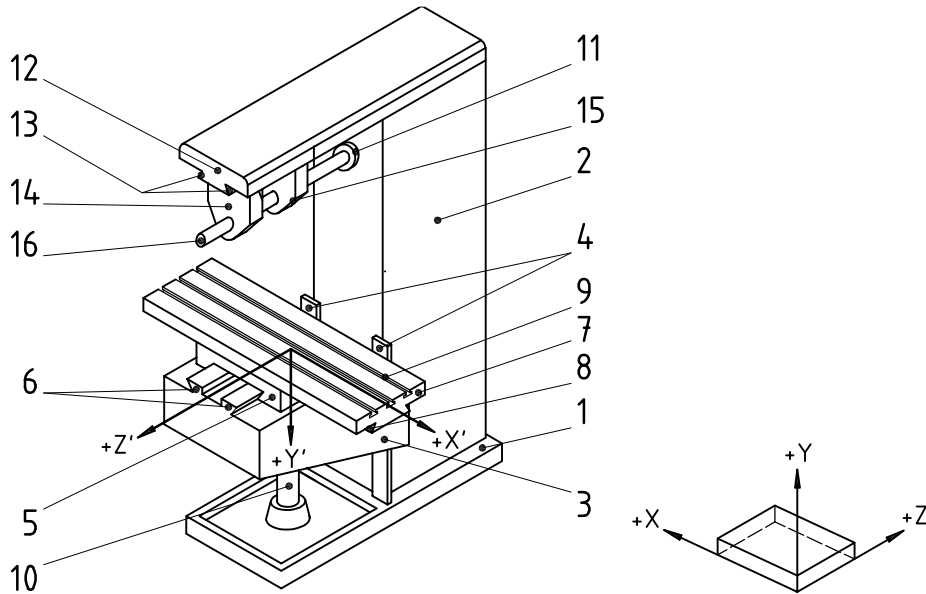


Figure 1 — Milling machine with table of variable height, with fixed horizontal spindle

Table 1 — Terminology

Key	Désignation		
	English	French	Russian
1	Base-plate with tray	Socle	Основание
2	Column	Montant	Стойка
3	Knee	Console	Консоль
4	Knee slideways	Glissières de la console	Направляющие консоли
5	Saddle	Chariot transversal	Салазки
6	Saddle slideways	Glissières du mouvement transversal de la table	Направляющие салазок
7	Table	Table porte-pièce	Стол
8	Table slideways	Glissières du mouvement longitudinal de la table	Направляющие стола
9	Table surface	Surface utile de la table	Рабочая поверхность стола
10	Vertical feed-screw	Vis verticale	Винт вертикального перемещения
11	Spindle nose	Nez de broche	Передний конец шпинделя
12	Overarm	Bras-support	Хобот
13	Overarm slideways	Glissière du bras-support	Направляющая хобота
14	Front arbor support	Lunette avant	Передняя серьга
15	Rear arbor support	Lunette arrière	Задняя серьга
16	Arbor	Arbre porte-fraise	Оправка

NOTE In addition to terms used in the three official ISO languages (English, French and Russian), this part of ISO 1701 gives in Annex A the equivalent terms in German, Spanish, Italian, Dutch and Swedish; these are published under the responsibility of the member committees for Germany (DIN), Spain (AENOR), Italy (UNI), the Netherlands (NEN) and Sweden (SIS). However, only the terms and definitions given in the official languages can be considered as ISO terms and definitions.

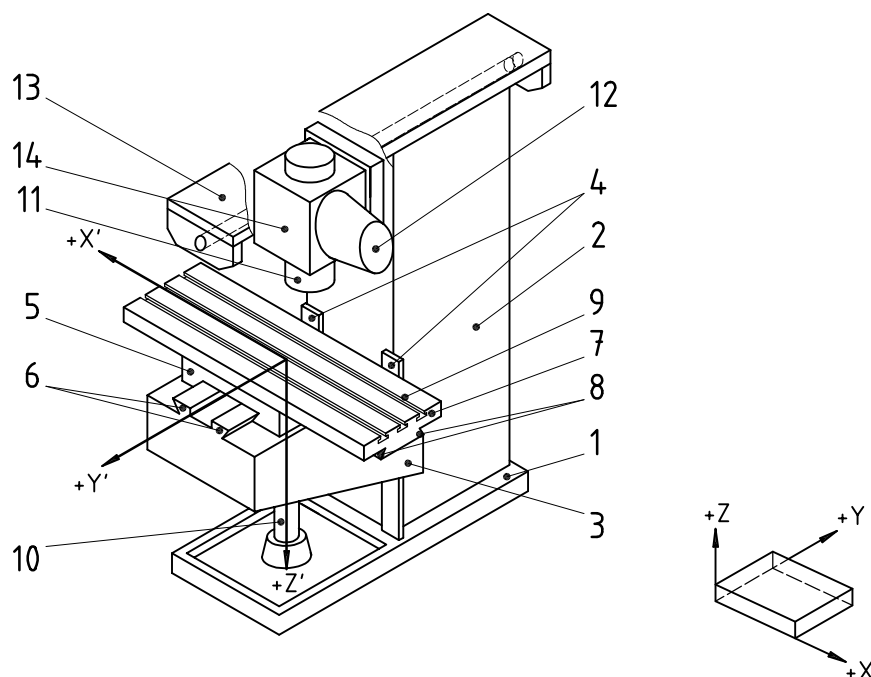


Figure 2 — Milling machine with table of variable height, with a movable head, with horizontal or vertical spindle

Table 2 — Terminology

Key	Designation		
	English	French	Russian
1	Base-plate with tray	Socle	Основание
2	Column	Montant	Стойка
3	Knee	Console	Консоль
4	Knee slideways	Glissières de la console	Направляющие консоли
5	Saddle	Chariot transversal	Салазки
6	Saddle slideways	Glissières du mouvement transversal de la table	Направляющие салазок
7	Table	Table porte-pièce	Стол
8	Table slideways	Glissières du mouvement longitudinal de la table	Направляющие стола
9	Table surface	Surface utile de la table	Рабочая поверхность стола
10	Vertical feed-screw	Vis verticale	Винт вертикального перемещения
11	Vertical spindle nose	Nez de broche verticale	Конец вертикального шпинделя
12	Horizontal spindle nose	Nez de broche horizontale	Конец горизонтального шпинделя
13	Horizontal milling attachment	Dispositif de fraisage horizontal	Ползун
14	Movable head	Tête amovible	Поворотная головка

NOTE In addition to terms used in the three official ISO languages (English, French and Russian), this part of ISO 1701 gives in Annex B the equivalent terms in German, Spanish, Italian, Dutch and Swedish; these are published under the responsibility of the member committees for Germany (DIN), Spain (AENOR), Italy (UNI), the Netherlands (NEN) and Sweden (SIS). However, only the terms and definitions given in the official languages can be considered as ISO terms and definitions.

### 3.2 Milling operations

Milling is a machining operation, which consists of removing material by means of a rotary tool called a “milling cutter” of which there are several different types.

The usual operations of milling can be divided into three categories:

- slab milling operations (see Figure 3);
- face milling operations (see Figure 4);
- end milling operations (see Figure 5).

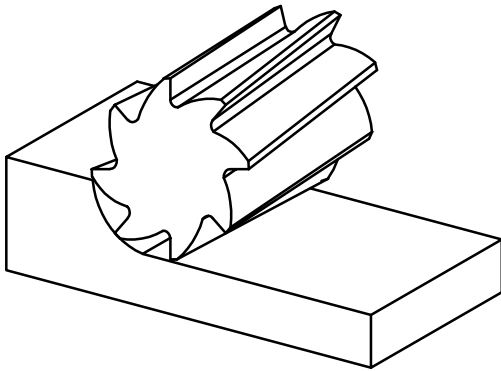


Figure 3 — Slab milling operation

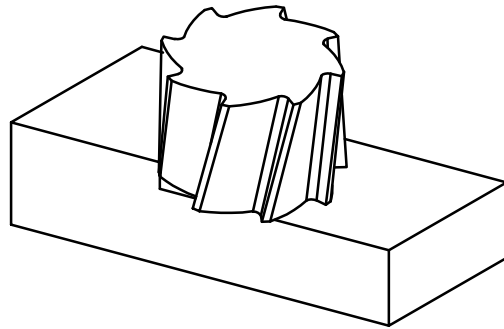


Figure 4 — Face milling operation

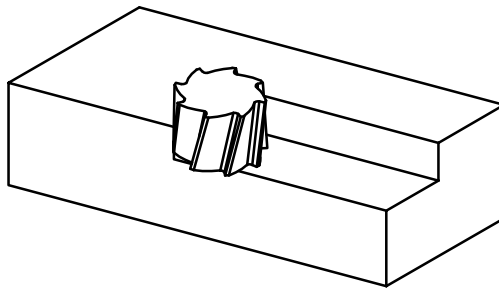


Figure 5 — End milling operation

### 3.3 Description of machines

In milling machines with table of variable height with horizontal spindle, the base-plate is rigidly fixed to the column (see Figures 1 and 2).

In this type of machine, the cutting movement is given by the spindle, the axis of which is horizontal.

The feed movements are as follows:

- a) **Milling machine with horizontal spindle** (see Figure 1)
  - The X axis of motion constitutes the longitudinal movement of the table.



- The Y axis of motion constitutes the vertical movement of the table.
- The Z axis of motion is parallel to the spindle axis and constitutes the transverse movement of the table.

b) **Milling machine with movable head with horizontal or vertical spindle axis** (see Figure 2)

- The X axis of motion constitutes the longitudinal movement of the table.
- The Y axis of motion constitutes the transverse movement of the table.
- The Z axis of motion constitutes the vertical movement of the table.

NOTE All these feed movements may be carried out by a rapid traverse of the element in question.

## 4 Preliminary remarks

### 4.1 Measuring units

In this part of ISO 1701, all linear dimensions, deviations and corresponding tolerances are expressed in millimetres; angular dimensions are expressed in degrees, and angular deviations and the corresponding tolerances are in principle expressed in ratios but in some cases, microradians or arcseconds may be used for clarification purposes. The equivalence of the following expressions should always be kept in mind:

$$0,010/1\ 000 = 10 \times 10^{-6} = 10\ \mu\text{rad} \approx 2''$$

### 4.2 Reference to ISO 230-1

To apply this part of ISO 1701, reference shall be made to ISO 230-1, especially for the installation of the machine before testing, warming up of the spindle and other moving components, description of measuring methods and recommended accuracy of testing equipment.

In the "Observations" block of the tests described in Clauses 5 and 6, the instructions are followed by a reference to the corresponding clause in ISO 230-1 in cases where the test concerned is in compliance with the specifications of that part of ISO 230.

### 4.3 Testing sequence

The sequence in which the tests are presented in this part of ISO 1701 in no way defines the practical order of testing. In order to make the mounting of instruments or gauging easier, tests may be performed in any order.

### 4.4 Tests to be performed

When testing a machine, it is not always necessary or possible to carry out all the tests described in this part of ISO 1701. When the tests are required for acceptance purposes, it is up to the user to choose, in agreement with the supplier/manufacturer, those tests relating to the components and/or the properties of the machine which are of interest. These tests are to be clearly stated when ordering a machine. Mere reference to this part of ISO 1701 for the acceptance tests, without specifying the tests to be carried out, and without agreement on the relevant expenses, cannot be considered as binding for any contracting party.

### 4.5 Measuring instruments

The measuring instruments indicated in the tests described in Clauses 5 and 6 are examples only. Other instruments measuring the same quantities and having at least the same accuracy may be used. Dial gauges shall have a resolution of 0,001 mm or better.

#### **4.6 Machining tests**

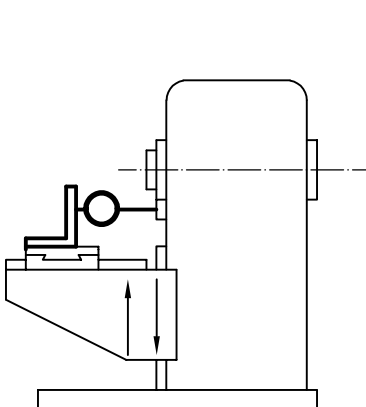
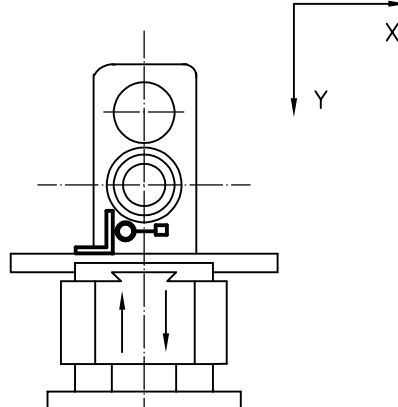
Machining tests shall be made with finishing cuts only, not with roughing cuts which are liable to generate appreciable cutting forces.

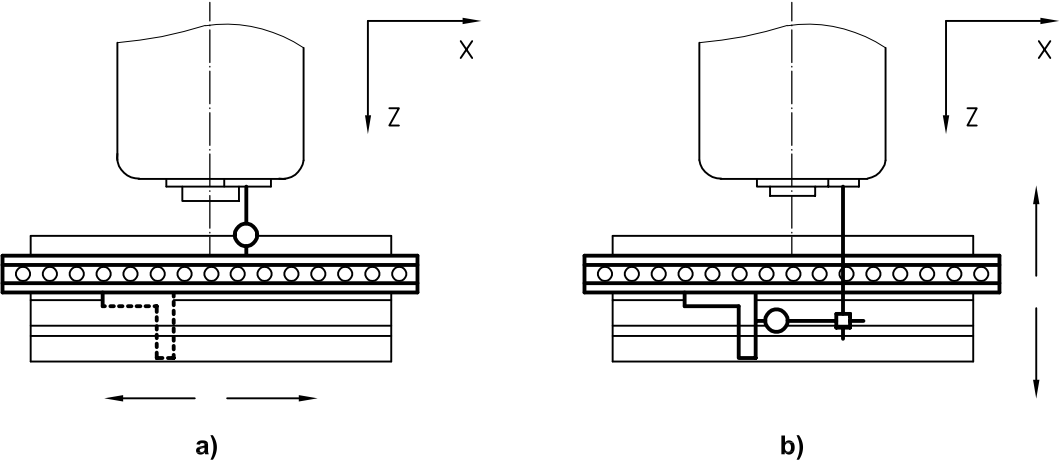
#### **4.7 Minimum tolerance**

When the tolerance for a geometric test is established for a measuring length different from that given in this part of ISO 1701 (see 2.311 of ISO 230-1:1996), it shall be taken into consideration that the minimum value of tolerance is 0,005 mm.

## 5 Geometric tests

### 5.1 Axes of motion

<p><b>Object</b></p> <p>Checking of straightness of the vertical movement of the knee (Y axis):</p> <p>a) in the vertical plane of symmetry of the machine (YZ plane);</p> <p>b) in the plane perpendicular to the vertical plane of symmetry of the machine (XY plane).</p>		<p><b>G1</b></p>
<p><b>Diagram</b></p> <div style="display: flex; justify-content: space-around; align-items: center;"> <div style="text-align: center;">  <p>a)</p> </div> <div style="text-align: center;">  <p>b)</p> </div> </div>		
<p><b>Tolerance</b></p> <p style="text-align: center;">For a) and b) 0,02 for any measuring length of 300</p>	<p><b>Measured deviation</b></p> <p>a)</p> <p>b)</p>	
<p><b>Measuring instruments</b></p> <p>Dial gauge and square</p>		
<p><b>Observations and references to ISO 230-1:1996</b> <span style="float: right;">5.232.11</span></p> <p>Instead of a straightedge, use the vertical arm of the square.</p> <p>Adjust the square to obtain similar readings at both ends of its measuring length so that straightness deviation can be calculated as the maximum difference of dial gauge readings.</p> <p>Table in central position:</p> <p>a) saddle (Z axis) locked;</p> <p>b) table (X axis) locked.</p> <p>If the spindle can be locked, the dial gauge may be mounted on it. If the spindle cannot be locked, the dial gauge shall be placed on a fixed part of the machine.</p>		

<b>Object</b>		<b>G2</b>
Checking of squareness between the transverse cross-slide movement (Z axis) and the longitudinal table movement (X axis).		
<b>Diagram</b>  <p>The diagram consists of two parts, a) and b). Part a) shows a cross-section of a machine table with a straightedge resting on its top surface. A square is placed against the straightedge. A dial gauge is mounted on the spindle of the machine. A horizontal double-headed arrow below the table indicates the X-axis movement. A vertical arrow to the right indicates the Z-axis movement. Part b) shows a similar setup, but the dial gauge is mounted on the spindle instead of the table. A vertical double-headed arrow to the right of the spindle indicates the Z-axis movement. Both parts include coordinate axes X and Z.</p>		
<b>Tolerance</b> 0,02 for a measuring length of 300	<b>Measured deviation</b>	
<b>Measuring instruments</b> Straightedge, dial gauge and square		
<b>Observations and references to ISO 230-1:1996</b>		5.522.4
Knee (Y axis) locked. a) The straightedge shall be set parallel to the longitudinal table movement (X axis); then the square shall be placed against the straightedge. The table shall then be locked in the central position. This test can be performed as well without the straightedge, aligning the long arm of the square parallel to the X axis. b) The saddle movement (Z axis) shall then be checked. If the spindle can be locked, then the dial gauge may be mounted on it. If the spindle cannot be locked, the dial gauge shall be placed on a fixed part of the machine.		

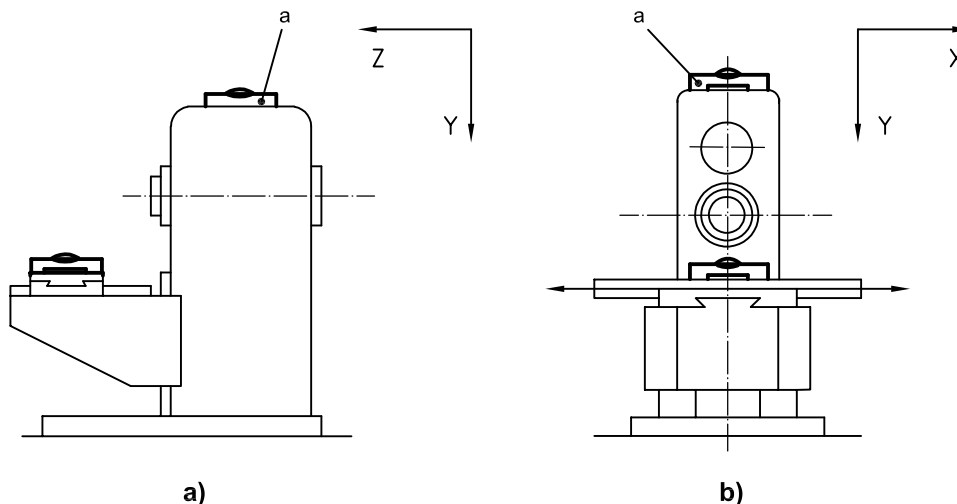
**Object**

**G3**

Checking of angular deviation of the table in its longitudinal movement (X axis):

- a) in the vertical YZ plane perpendicular to the table movement (roll EAX);
- b) in the vertical XY plane parallel to the table movement (pitch ECX).

**Diagram**



a Reference level.

**Tolerance**

- a) 0,04/1 000 (or 40 μrad or 8")
- b)  $X \leq 1\ 000$  0,08/1 000 (or 80 μrad or 16")
- $X > 1\ 000$  0,12/1 000 (or 120 μrad or 24")

**Measured deviation**

- a)
- b)

**Measuring instruments**

Precision level

**Observations and references to ISO 230-1:1996**

5.232.2

These tests should only be performed when the knee (Y axis) is clamped on the column.

The level shall be placed in the centre of the table:

- a) transversely;
- b) longitudinally.

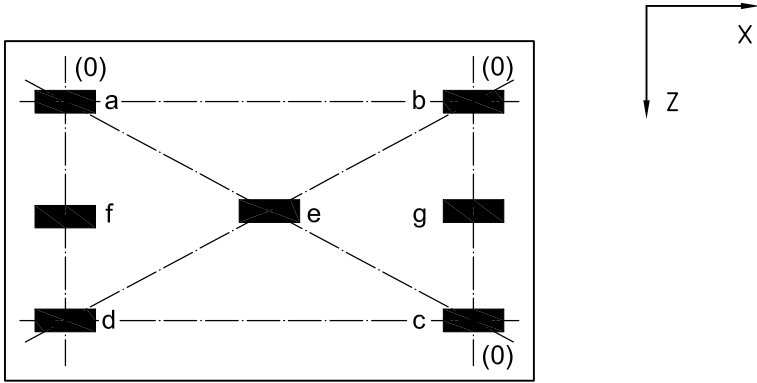
Measurements are taken at several positions, moving the table by 200 mm or 250 mm steps.

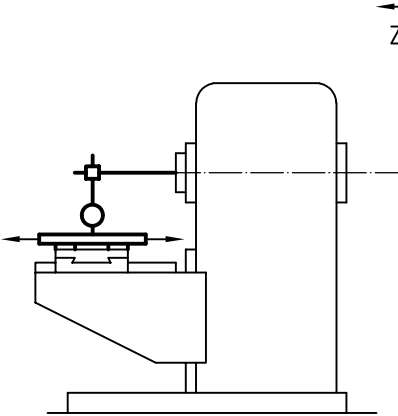
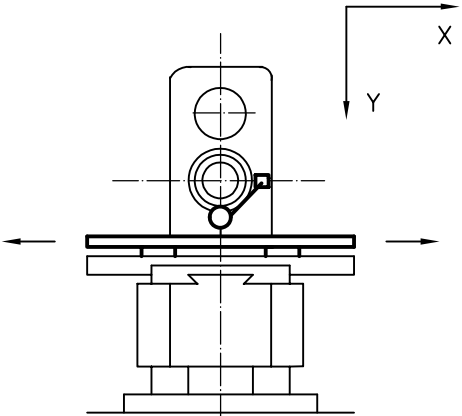
When X axis motion causes an angular movement of both the spindle head and the work-holding table, differential measurements of the two angular movements shall be made and this shall be stated.

The reference level shall be located on the column.

The difference between the maximum and minimum readings (excluding the above angular contribution) of both directions of movement shall not exceed the tolerance.

5.2 Table

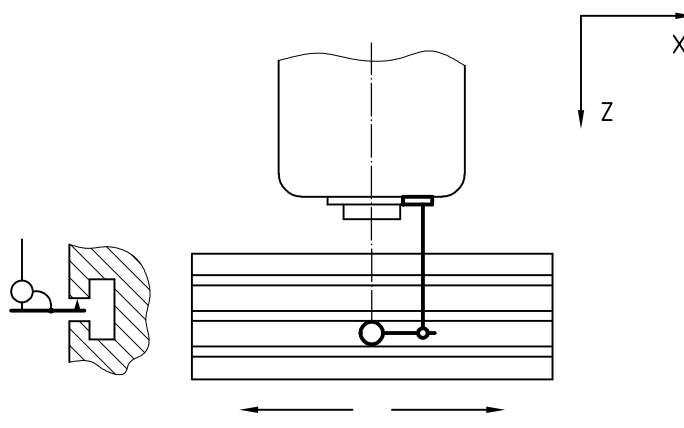
<p><b>Object</b></p> <p>Checking of flatness of the table surface.</p>		<p><b>G4</b></p>
<p><b>Diagram</b></p> 		
<p><b>Tolerance</b></p> <p>0,04 for a measuring length up to 1 000, concave only</p> <p>For each 1 000 mm increase in table length, add 0,005</p> <p>Maximum tolerance: 0,05</p> <p>Local tolerance: 0,02 for any measuring length of 300</p>	<p><b>Measured deviation</b></p>	
<p><b>Measuring instruments</b></p> <p>Precision level or straightedge and gauge blocks</p>		
<p><b>Observations and references to ISO 230-1:1996</b> 5.322 and 5.323</p> <p>Table (X axis) and saddle (Z axis) in central position, table not locked, knee and saddle locked.</p> <p>NOTE The alphabetical references on the diagram correspond to those used in Figure 41 of ISO 230-1:1996.</p>		

<p><b>Object</b></p>	<p><b>G5</b></p>
<p>Checking of parallelism between the table surface and</p> <p>a) the saddle movement (Z axis), in the vertical YZ plane;</p> <p>b) its longitudinal movement (X axis), in the vertical XY plane.</p>	
<p><b>Diagram</b></p> <div style="display: flex; justify-content: space-around; align-items: center;"> <div style="text-align: center;">  <p>a)</p> </div> <div style="text-align: center;">  <p>b)</p> </div> </div>	
<p><b>Tolerance</b></p> <p style="text-align: center;">For a) and b) 0,025 for any measuring length of 300 Maximum tolerance: 0,05</p>	<p><b>Measured deviation</b></p> <p>a) b)</p>
<p><b>Measuring instruments</b></p> <p>Straightedge and dial gauge</p>	
<p><b>Observations and references to ISO 230-1:1996</b> <span style="float: right;">5.422.21</span></p> <p>The stylus of the dial gauge shall be placed at approximately the working position of the tool.</p> <p>The measurement may be made on a straightedge laid parallel to the table surface.</p> <p>If the table length is greater than 1 600 mm, carry out the inspection by successive movements of the straightedge.</p> <p>Knee (Y axis) locked:</p> <p>a) table (X axis) locked;</p> <p>b) saddle (Z axis) locked.</p> <p>If the spindle can be locked, the dial gauge may be mounted on it. If the spindle cannot be locked, the dial gauge shall be placed on a fixed part of the machine.</p>	

<p><b>Object</b></p>		<p><b>G6</b></p>
<p>Checking of squareness between the table surface and the vertical movement of the knee (Y axis) (in three positions: in the middle and near the extremities of the travel):</p> <p>a) in the vertical plane of symmetry of the machine (YZ plane);</p> <p>b) in the plane perpendicular to the vertical plane of symmetry of the machine (XY plane).</p>		
<p><b>Diagram</b></p>		
<p><b>Tolerance</b></p> <p>a) 0,025 for a measuring length of 300 with <math>\alpha \leq 90^\circ</math></p> <p>b) 0,025 for a measuring length of 300</p>	<p><b>Measured deviation</b></p> <p>a)</p> <p>b)</p>	
<p><b>Measuring instruments</b></p> <p>Dial gauge and square</p>		
<p><b>Observations and references to ISO 230-1:1996</b> <span style="float: right;">5.522.2</span></p> <p>Table in central position, knee (Y axis) locked when taking measurements:</p> <p>a) saddle (Z axis) locked;</p> <p>b) table (X axis) locked.</p> <p>If the spindle can be locked, the dial gauge may be mounted on it. If the spindle cannot be locked, the dial gauge shall be placed on a fixed part of the machine.</p>		



<p><b>Object</b></p> <p>Checking of straightness of the median or reference T-slot of the table.</p>		<p><b>G7</b></p>
<p><b>Diagram</b></p>		
<p><b>Tolerance</b></p> <p>0,01 for any measuring length of 300 Maximum tolerance: 0,03</p>		<p><b>Measured deviation</b></p>
<p><b>Measuring instruments</b></p> <p>Straightedge and dial gauge or gauge blocks, or taut wire and microscope, or autocollimator</p>		
<p><b>Observations and references to ISO 230-1:1996</b></p> <p>The straightedge may be placed directly on the table.</p>		<p>5.212, 5.212.1 and 5.212.23</p>

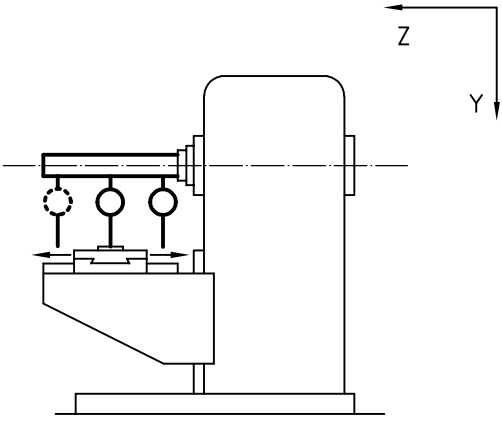
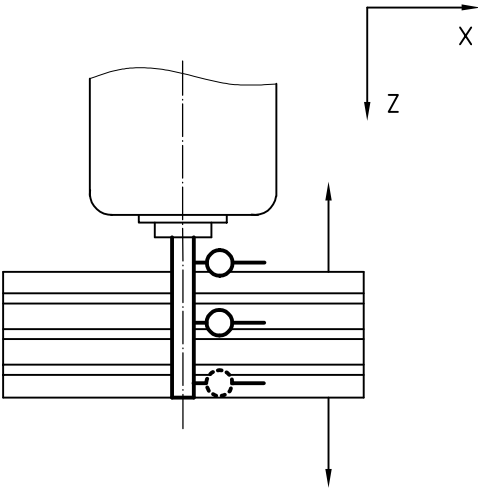
<b>Object</b>		<b>G8</b>
Checking of parallelism between the median or reference T-slot and the longitudinal movement of the table.		
<b>Diagram</b> 		
<b>Tolerance</b>  0,015 for a measuring length of 300 Maximum tolerance: 0,04	<b>Measured deviation</b>	
<b>Measuring instruments</b> Dial gauge		
<b>Observations and references to ISO 230-1:1996</b> <div style="float: right;">5.422.1 and 5.422.21</div> <p>Saddle (Z axis) and knee (Y axis) locked.</p> <p>If the spindle can be locked, the dial gauge may be mounted on it. If the spindle cannot be locked, the dial gauge shall be placed on a fixed part of the machine.</p>		

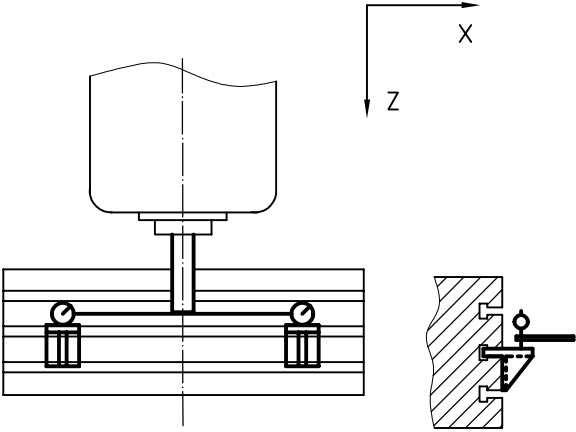
### 5.3 Spindle

<b>Object</b>		<b>G9</b>
<p>a) Checking of run-out of the external centering surface on the spindle nose (for machines having this feature).</p> <p>b) Checking of periodic axial slip.</p> <p>c) Checking of camming of the face of the spindle nose (including periodic axial slip).</p>		
<b>Diagram</b>		
<b>Tolerance</b>		<b>Measured deviation</b>
a) 0,01	b) 0,01	c) 0,02
		a)
		b)
		c)
<b>Measuring instruments</b>		
Dial gauge		
<b>Observations and references to ISO 230-1:1996</b>		
a) 5.612.2		
b) 5.622.1 and 5.622.2		
A force $F$ , specified by the supplier/manufacturer of the machine, can be exerted by pressing toward the housing for tests b) and c).		
c) 5.632		
The distance $A$ of the dial gauge c) from the spindle axis shall be as large as possible.		



<b>Object</b>		<b>G11</b>
Checking of parallelism between the spindle axis and the table surface.		
<b>Diagram</b>		
<b>Tolerance</b>		<b>Measured deviation</b>
	0,025 for a measuring length of 300 (free end of the test mandrel inclined downwards)	
<b>Measuring instruments</b>		
Dial gauge and test mandrel		
<b>Observations and references to ISO 230-1:1996</b>		5.412.4
Table (X axis) and saddle (Z axis) not locked, knee (Y axis) locked.		
The measurement shall be at the mean position of rotation; i.e., measure at a position of spindle rotation and then repeat the measurement after rotating the spindle with mandrel 180° and take the mean value of the two measurements.		

<b>Object</b>		<b>G12</b>
<p>Checking of parallelism between the spindle axis and the transverse movement of the table (saddle movement) (Z axis):</p> <p>a) in the vertical YZ plane;</p> <p>b) in the horizontal ZX plane.</p>		
<b>Diagram</b> <div style="display: flex; justify-content: space-around; align-items: center;"> <div style="text-align: center;">  <p>a)</p> </div> <div style="text-align: center;">  <p>b)</p> </div> </div>		
<b>Tolerance</b> a) 0,025 for a measuring length of 300 (free end of the test mandrel inclined downwards) b) 0,025 for a measuring length of 300	<b>Measured deviation</b> a) b)	
<b>Measuring instruments</b> Dial gauge and test mandrel		
<p><b>Observations and references to ISO 230-1:1996</b> <span style="float: right;">5.422.3</span></p> <p>Table (X axis) in central position.</p> <p>Knee (Y axis) locked.</p> <p>The measurement shall be at the mean position of rotation; i.e., measure at a position of spindle rotation and then repeat the measurement after rotating the spindle with mandrel 180° and take the mean value of the two measurements.</p>		

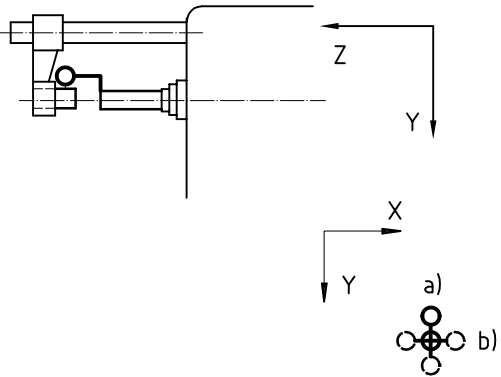
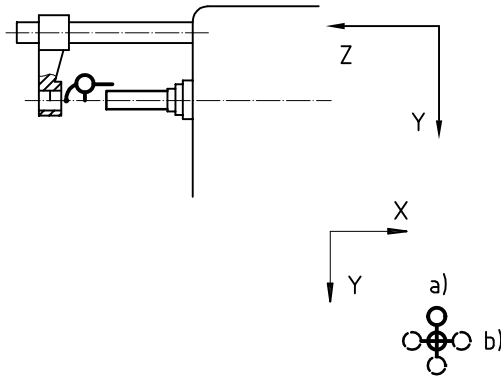
<p><b>Object</b></p>	<p><b>G13</b></p>
<p>Checking of squareness between the spindle axis and the median or reference T-slot of the table.</p>	
<p><b>Diagram</b></p> 	
<p><b>Tolerance</b></p> <p style="text-align: center;"><math>0,02/300^a</math></p> <p><sup>a</sup> 300 is the distance between the two measuring points touched.</p>	<p><b>Measured deviation</b></p>
<p><b>Measuring instruments</b></p> <p>Dial gauge</p>	
<p><b>Observations and references to ISO 230-1:1996</b> 5.512.1 and 5.512.42</p> <p>Table (X axis) in central position.</p> <p>Table (X axis), saddle (Z axis) and knee (Y axis) locked.</p>	

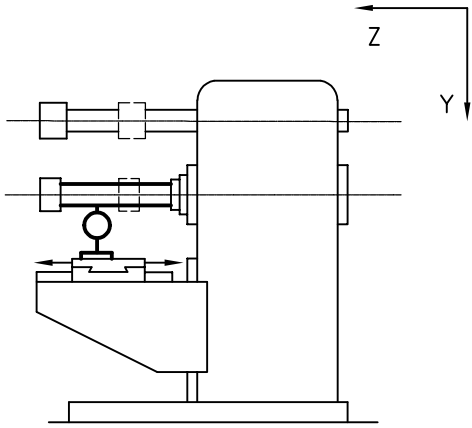
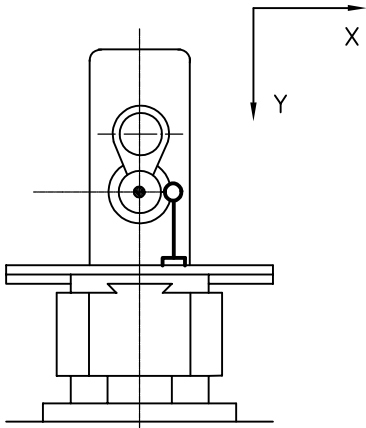
5.4 Arbor support

<p><b>Object</b></p>		<p><b>G14</b></p>
<p>Checking of parallelism between the arbor support guide on the overarm(s) and the spindle axis:  a) in the vertical YZ plane;  b) in the horizontal ZX plane.</p>		
<p><b>Diagram</b></p> <p style="text-align: center;">a) <span style="margin-left: 200px;">b)</span></p>		
<p><b>Tolerance</b></p> <p>a) 0,02 for a measuring length of 300 (overarm inclined downwards)  b) 0,02 for a measuring length of 300</p>	<p><b>Measured deviation</b></p> <p>a)  b)</p>	
<p><b>Measuring instruments</b></p> <p>Dial gauge and possibly precision level with special fixture</p>		
<p><b>Observations and references to ISO 230-1:1996</b> <span style="float: right;">5.412.5 or 5.412.3 and 5.412.1</span></p> <p>Overarm(s) locked.</p>		

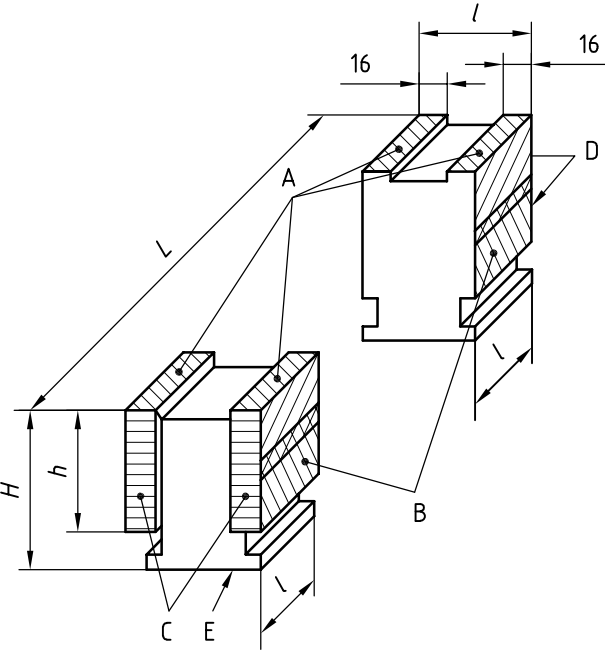




<p><b>Object</b></p>		<p><b>G15</b></p>
<p>Checking of coincidence of the axis of the bore of the arbor support with the spindle axis:</p> <p>a) in the vertical YZ plane;</p> <p>b) in the horizontal ZX plane.</p>		
<p><b>Diagram</b></p> <div style="display: flex; justify-content: space-around;"> <div style="text-align: center;"> <p>1) First method</p>  </div> <div style="text-align: center;"> <p>2) Alternative</p>  </div> </div>		
<p><b>Tolerance</b></p> <p>a) 0,03 (axis of the bore of the arbor support lower than the spindle axis)</p> <p>b) 0,03</p>	<p><b>Measured deviation</b></p> <p>a)</p> <p>b)</p>	
<p><b>Measuring instruments</b></p> <p>Dial gauge and test mandrel</p>		
<p><b>Observations and references to ISO 230-1:1996</b> <span style="float: right;">5.442</span></p> <p>Arbor support located 300 mm away from the spindle nose.</p> <p>Overarm locked and arbor support not connected to the knee.</p> <p>The measurement shall be made</p> <ol style="list-style-type: none"> <li>1) in the case of the first method, as close as possible to the arbor support;</li> <li>2) in the case of the alternative, close to the middle of the arbor support bore.</li> </ol> <p>The reading on the dial gauge shall be divided by 2 to be compared with the tolerance.</p>		

<p><b>Object</b></p>		<p><b>G15 (alternative)</b></p>
<p>Checking of coincidence of the axis of the bore of the arbor support with the spindle axis [parallelism between the supported arbor and the transverse movement of the table (saddle movement) — (Z axis)]:</p> <p>a) in the vertical YZ plane;</p> <p>b) in the horizontal ZX plane.</p>		
<p><b>Diagram</b></p> <div style="display: flex; justify-content: space-around; align-items: center;">   </div> <p style="text-align: center;">a) <span style="margin-left: 200px;">b)</span></p>		
<p><b>Tolerance</b></p> <p>a) 0,04 for a measuring length of 300 (mandrel inclined downwards on the bore end of the arbor support)</p> <p>b) 0,03 for a measuring length of 300</p>	<p><b>Measured deviation</b></p> <p>a)</p> <p>b)</p>	
<p><b>Measuring instruments</b></p> <p>Dial gauge and test mandrel</p>		
<p><b>Observations and references to ISO 230-1:1996</b> <span style="float: right;">5.442</span></p> <p>a) The end of the mandrel or cutter arbor is held by the arbor support.</p> <p>b) The arbor support is positioned midway along the mandrel or cutter arbor.</p> <p>The reading on the dial gauge shall not be divided by 2.</p>		

6 Machining test

<p><b>Object</b></p> <p>a) Milling of surface B by automatic longitudinal movement of the table and manual vertical movement of the knee, in two cuts overlapping by about 5 mm to 10 mm.</p> <p>b) Milling of surfaces A, C and D by automatic longitudinal movement of the table, automatic vertical movement of the knee and manual transverse movement of the saddle.</p>		<p><b>M1</b></p>			
<p><b>Diagram</b></p> 		<p style="text-align: right;">Dimensions in millimetres</p> <p><math>L</math> is the length of the test piece or distance between the opposite faces of two test pieces, and is equal to <math>1/2</math> the longitudinal travel.</p> <p><math>l</math> is equal to <math>h</math>, and corresponds to <math>1/8</math> of the longitudinal travel.</p> <p><math>l_{max.}</math> is 100 mm: for <math>L \leq 500</math> mm  is 150 mm: for <math>500 \text{ mm} &lt; L \leq 1\,000</math> mm  is 200 mm: for <math>L &gt; 1\,000</math> mm</p> <p><math>l_{min.}</math> is 50 mm</p> <p>NOTE 1 Longitudinal travels of <math>\geq 400</math> mm; one or two test pieces, machined in the longitudinal direction over a length <math>l</math> at each end, can be used.</p> <p>NOTE 2 Longitudinal travels of <math>&lt; 400</math> mm; one test piece, machined over its entire length, shall be used.</p> <p>NOTE 3 Material: cast iron.</p>			
<p><b>Tolerance</b></p> <p>a) Surface B on each block shall be flat to the nearest 0,02.</p> <p>b<sub>1</sub>) The planes containing the surfaces A, C and D shall be perpendicular to each other and each one perpendicular to the surface B to the nearest 0,02/100.</p> <p>b<sub>2</sub>) The height <math>H</math> of the block(s) shall be constant to the nearest 0,03.</p>	<p><b>Measured deviation</b></p> <p>a)</p> <p>b<sub>1</sub>)</p> <p>b<sub>2</sub>)</p>				
<p><b>Measuring instruments</b></p> <table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <td style="width: 33%;">a) Straightedge and gauge blocks or amplifier</td> <td style="width: 33%;">b<sub>1</sub>) Square and gauge blocks</td> <td style="width: 33%;">b<sub>2</sub>) Micrometer callipers</td> </tr> </table>			a) Straightedge and gauge blocks or amplifier	b <sub>1</sub> ) Square and gauge blocks	b <sub>2</sub> ) Micrometer callipers
a) Straightedge and gauge blocks or amplifier	b <sub>1</sub> ) Square and gauge blocks	b <sub>2</sub> ) Micrometer callipers			
<p><b>Observations and references to ISO 230-1:1996</b> <span style="float: right;">4.1 and 4.2</span></p> <p>Cutting conditions:</p> <p>a) with a shell-end mill;</p> <p>b) slab milling with the same cutter.</p> <p>Before beginning the test, surface E shall be flat.</p> <p>Test pieces shall be placed along the longitudinal axis of the table so that the length <math>L</math> is equally distributed on either side of the table centre.</p> <p>NOTE Subject to agreement between the user and the supplier/manufacturer, the form of the test piece shown in the diagram may be replaced by a simpler form of test piece having sides of full width, in which case tests carried out using this form will be at least as severe as those carried out using the form in the diagram.</p> <p>The cutter should be sharpened on its arbor and, when mounted, should conform to the following tolerances:</p> <p>1) run-out:  <math>\leq 0,02</math></p> <p>2) camming:  <math>\leq 0,03</math></p> <p>All non-operating slides shall be locked during cutting.</p>					

## Annex A (informative)

### Equivalent terms in German, Italian, Dutch, Spanish and Swedish, corresponding to Figure 1

Key	Designation				
	German	Spanish	Italian	Dutch	Swedish
1	Grundplatte mit Wanne	Base	Basamento	Grondplaat met bak	Fot med tråg
2	Ständer	Columna	Montante	Staander	Pelare
3	Konsole	Consola	Mensola	Hoektafel	Knä
4	Konsolenführung	Guías de la consola	Guide della mensola	Leibanen van de hoektafel	Knägejder
5	Querschlitten (Z-Achse)	Carro transversal	Slitta trasversale	Dwarsslede (Z-as)	Tvärslid
6	Querschlittenführung	Guías del movimiento transversal de la mesa	Guide della slitta trasversale	Leibanen van de dwarsslede	Tvärslidsgejder
7	Längsschlitten (X-Achse)	Mesa porta-pieza	Tavola	Tafel (of langsslede) (X-as)	Bord
8	Längsschlittenführung	Guías del movimiento longitudinal de la mesa	Guide della tavola	Leibanen van de langsslede	Bordgejder
9	Aufspannfläche	Superficie útil de la mesa	Piano della tavola	Opspanoppervlak van de tafel	Bordyta
10	Verstellspindel (Y-Achse)	Tornillo del movimiento vertical de la consola	Vite della mensola	Verticale voedingsspil (Y-as)	Vertikalskruv
11	Spindelnase	Extremo del husillo	Naso del mandrino	Spilneus	Spindelnos
12	Gegenhalter	Brazo-soporte	Slittone	Steunarm	Bom
13	Gegenhalterführung	Guías del brazo-soporte	Guide dello slittone	Geleiding van de steunarm	Borngejder
14	Vorderes Gegenhalterlager	Luneta delantera	Sopperto principale	Voorste freesspilsteun	Främre dornstöd
15	Hinteres Gegenhalterlager	Luneta trasera	Sopperto intermedio	Achterste freesspilsteun	Bakre dornstöd
16	Fräserdorn	Eje porta-fresas	Albero portafrese	Freesdoorn	Fräsdorn

## Annex B (informative)

### Equivalent terms in German, Italian, Dutch, Spanish and Swedish, corresponding to Figure 2

Key	Designation				
	German	Spanish	Italian	Dutch	Swedish
1	Grundplatte mit Wanne	Base	Basamento	Grondplaat met bak	Fot med tråg
2	Ständer	Columna	Montante	Staander	Pelare
3	Konsole	Consola	Mensola	Hoektafel	Knä
4	Konsolenführung	Guías de la consola	Guide della mensola	Leibanen van de hoektafel	Knägejder
5	Querschlitzen (Y-Achse)	Carro transversal	Slitta trasversale	Dwarsslede (Y-as)	Tvärslid
6	Querschlitzenführung	Guías del movimiento transversal de la mesa	Guide della slitta trasversale	Leibanen van de dwarsslede	Tvärslidsgejder
7	Längsschlitzen (X-Achse)	Mesa porta-pieza	Tavola	Tafel (of langsslede) (X-as)	Bord
8	Längsschlitzenführung	Guías del movimiento longitudinal de la mesa	Guide della tavola	Leibanen van de langsslede	Bordgejder
9	Aufspannfläche	Superficie útil de la mesa	Piano della tavola	Opspanoppervlak van de tafel	Bordyta
10	Verstellspindel (Y-Achse)	Tornillo del movimiento vertical de la consola	Vite della mensola	Verticale voedingsspil (Y-as)	Vertikalskruv
11	Spindelnase, senkrecht	Extremo del husillo vertical	Naso del mandrino verticale	Verticale spilneus	Vertical spindelnos
12	Spindelnase, waagrecht	Extremo del husillo horizontal	Naso del mandrino orizzontale	Horizontale spilneus	Horisontal spindelnos
13	Gegenhalter	Brazo-soporte para el fresado horizontal	Slittone	Steunarm voor horizontal frezen	Horisontal fräsanordning
14	Schwenkbarer Fräskopf	Cabezal	Testa universale accessoria	Beweegbare spilkop	Rörlig spindeldocka

## Bibliography

- [1] ISO 841:2001, *Industrial automation systems and integration — Numerical control of machines — Coordinate system and motion nomenclature*
- [2] ISO 1701-2, *Test conditions for milling machines with table of variable height — Testing of the accuracy — Part 2: Machines with vertical spindle*
- [3] ISO 1984-1, *Test conditions for manually controlled milling machines with table of fixed height — Testing of the accuracy — Part 1: Machines with horizontal spindle*
- [4] ISO 1984-2, *Test conditions for manually controlled milling machines with table of fixed height — Testing of the accuracy — Part 2: Machines with vertical spindle*

