

---

---

**Welding and allied processes — Health  
and safety — Wordless precautionary  
labels for equipment and consumables  
used in arc welding and cutting**

*Soudage et techniques connexes — Hygiène et sécurité — Étiquettes  
de prévention muettes pour les produits de soudage à l'arc et de  
coupage*



**PDF disclaimer**

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

© ISO 2004

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office  
Case postale 56 • CH-1211 Geneva 20  
Tel. + 41 22 749 01 11  
Fax + 41 22 749 09 47  
E-mail [copyright@iso.org](mailto:copyright@iso.org)  
Web [www.iso.org](http://www.iso.org)

Published in Switzerland

# Contents

Page

Foreword .....	iv
Introduction .....	v
1 Scope .....	1
2 Normative references .....	1
3 Terms and definitions .....	1
4 Requirements for wordless precautionary labels .....	2
4.1 Use of precautionary labels on products .....	2
4.2 Label elements .....	2
4.3 Design of precautionary labels .....	2
4.4 Use of symbols .....	2
4.5 Uniformity of symbols .....	2
4.6 Label legibility, placement, visibility, and durability .....	3
4.7 The basic precautionary label .....	3
4.8 The wordless label for plasma arc cutting equipment .....	3
4.9 The precautionary label for engine-driven welding and cutting equipment .....	3
4.10 The precautionary label for wire feeding equipment .....	3
4.11 Precautionary labels for other hazards .....	3
Annex A (informative) Precautionary label symbols .....	4
Annex B (informative) Examples of wordless precautionary labels .....	10
Bibliography .....	18

.....

## Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 17846 was prepared by Technical Committee ISO/TC 44, *Welding and allied processes*, Subcommittee SC 9, *Health and safety*.

## Introduction

This International Standard is intended to provide a basis of common understanding within the welding and cutting industry regarding precautionary labels for arc welding and plasma arc cutting products. To this end, this publication provides requirements and guidelines for precautionary labels in order to promote uniformity of manufacturers' labelling practices so that the intended message is more easily recognised and understood by the user. In welding and cutting, as in most industrial occupations, exposure to certain hazards occurs. Users must be alert to these hazards using their experience, training, education, and common sense. Precautionary labels are not intended for the training of users, but rather as a means to quickly remind them of the basic product hazards each time the product is used.

This International Standard covers the use of wordless (symbols-only) precautionary labels as a labelling method for arc welding and plasma arc cutting products. Precautionary labels, based on recognised hazard and safety symbols, have been developed in recognition of an increasingly diverse international audience of users. It cannot be assumed that this audience can read the language used on a label. Symbols are becoming more commonplace in everyday life, from computers to road signs to children's toys. Precautionary labels avoid the need to be able to read the words on the label. Language and literacy thus become non-factors in communication.

To validate the wordless precautionary labels shown in Annex A, a questionnaire was distributed worldwide to approximately 10 000 experienced and inexperienced welders, as well as to other individuals and organizations with an interest in arc welding and cutting products. Nearly all symbols achieved comprehension rates in the 95 % to 100 % range. Where comprehension rates were lower, the symbols were appropriately modified and the revised symbols were resurveyed and validated. More information on the methodology can be found in the EW 6 standard published by the (U.S.-based) National Electrical Manufacturers Association ([www.nema.org](http://www.nema.org)).

NOTE The term "precautionary label" is equivalent to "product safety label" in ISO 3864-2. Other equivalences are so noted elsewhere in this International Standard.

© 2011 IHS

# Welding and allied processes — Health and safety — Wordless precautionary labels for equipment and consumables used in arc welding and cutting

## 1 Scope

This International Standard specifies the format and symbols for wordless precautionary labels placed by manufacturers on their equipment and consumables used in arc welding and plasma arc cutting processes.

This International Standard addresses neither workplace safety signs (as specified by ISO 3864-1) nor operator training. In addition, the wordless precautionary labels specified in this International Standard are not intended to replace other mandatory labels or signs (e.g. material safety data sheets) required by certain countries or regions.

## 2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 3864-2, *Graphical symbols — Safety colours and safety signs — Part 2: Design principles for product safety labels*<sup>1)</sup>

IEC 60974-1, *Arc welding equipment — Part 1: Welding power sources*

IEC 80416-3, *Basic principles for graphical symbols for use on equipment — Part 3: Guidelines for the application of graphical symbols*

## 3 Terms and definitions

For the purposes of this document, the following terms and definitions apply.

### 3.1

#### **competent person**

person qualified to perform a task based on adequate and relevant training and experience

### 3.2

#### **precautionary label**

informative marking placed by the manufacturer on a product that calls attention to significant hazards and their consequences to persons or property, indicates how such hazards can be avoided, and may list any other sources of information

NOTE Equivalent to “product safety label” in ISO 3864-2.

---

1) Under preparation.

## 4 Requirements for wordless precautionary labels

### 4.1 Use of precautionary labels on products

A precautionary label shall be applied to equipment and consumables used in welding and cutting if, during the course of their intended use, they generate a significant hazard to health or property. A precautionary label shall be placed on power sources, wire feeders, consumables packaging, and other products identified by the manufacturer's designated competent person.

The use of precautionary labels covered in this International Standard is not intended to replace user training.

### 4.2 Label elements

As a minimum, a precautionary label shall contain the following elements:

- a) alert symbols, i.e. the general safety alert symbol or specific hazard type symbol(s) (see Table A.1 for examples);

NOTE The term "alert symbol" is equivalent to the ISO 3864-2 expression "warning sign".

- b) hazard source symbol(s) (see Table A.2 for examples);
- c) any relevant hazard avoidance symbols (see Table A.3 for examples).

### 4.3 Design of precautionary labels

A precautionary label shall be designed by a competent person based on an analysis of the product, process, and hazards. The significant hazards associated with the use of the equipment or consumable dictate the selection of alert symbol(s), hazard source symbol(s), and hazard avoidance symbol(s), a selection of which is shown in Annex A. The competent person shall balance the benefit of depicting more hazards against the risk of cluttering the appearance of the label and obscuring its message. The order in which the hazards are presented on a precautionary label shall be defined by a ranking based upon the potential severity of the injury caused by the hazard and by the risk of it occurring.

The use of safety colours (e.g. yellow for caution, red for danger) and contrast colours (e.g. blue for mandatory action) in a precautionary label is optional. If colours are used, they shall conform with the relevant requirements of ISO 3864-2.

NOTE For symbols requiring a dot pattern, such as fumes, the use of a 45 % grey shade is recommended.

The use of shape (e.g. triangle to indicate warning, circle to indicate either prohibition or mandatory action, square to indicate information) for precautionary label symbols is optional. If shapes are used, they shall conform with the relevant requirements of ISO 3864-2.

### 4.4 Use of symbols

A precautionary label shall be composed of symbols, i.e. it shall contain no text. In this regard it is recommended that precautionary labels be equivalent to the examples shown in Annex B.

### 4.5 Uniformity of symbols

In order to improve user understanding, and therefore the effectiveness, of a precautionary label, the symbols shown in Annex A shall be used when appropriate. When symbols not included in Annex A are needed, the competent person is encouraged to refer to other relevant International Standards.



#### 4.6 Label legibility, placement, visibility, and durability

Precautionary labels shall be applied to a conspicuous place on the equipment or consumable and, if practical, shall be visible to the operator during normal use. Precautionary labels shall be dimensioned for legibility according to IEC 80416-3. If insufficient space is available on the product to accommodate the minimum dimensions for a legible label, an abridged label referring the user to the location of the precautionary label shall be applied to a conspicuous place on the product.

Where possible, precautionary labels shall meet the durability requirements of IEC 60974-1.

#### 4.7 The basic precautionary label

Figures B.1 and B.2 show examples of a precautionary label (in two possible formats: horizontal and vertical) that could be used on electrically powered welding and cutting equipment or on consumable containers. These labels are suitable for equipment and consumables used in many welding and cutting operations and it is recommended that the labels on such equipment or consumable containers carry the symbols shown in Figures B.1 and B.2.

#### 4.8 The wordless label for plasma arc cutting equipment

Figure B.3 shows an example of a precautionary label for use specifically on plasma arc cutting equipment. It is recommended that all such equipment carry the symbols shown in Figure B.3, or equivalent symbols, as well as the applicable symbols of Figure B.4 if the equipment is engine-driven.

#### 4.9 The precautionary label for engine-driven welding and cutting equipment

Figure B.4 shows an example of a precautionary label for use specifically on engine-driven welding and cutting equipment. It is recommended that all such equipment carry the applicable symbols in Figures B.1 (or B.2), B.3 and B.4, or equivalent symbols.

#### 4.10 The precautionary label for wire feeding equipment

Figure B.5 shows an example of a precautionary label for use specifically on wire feeding equipment. It is recommended that all such equipment carry the symbols shown in Figure B.5, or equivalent symbols.

#### 4.11 Precautionary labels for other hazards

When other hazards are present in the welding or cutting environment, it is recommended that the examples shown in Figures B.6 to B.9 be followed. The precautionary label shall be placed near the hazard.

## Annex A (informative)








### Precautionary label symbols

#### A.1 Alert symbols

See Table A.1.

NOTE The term “alert symbol” is equivalent to the ISO 3864-2 expression “warning sign”.

**Table A.1 — Common alert symbols in welding and cutting**

No.	Type of hazard	Symbol
1	General safety alert symbol <sup>a</sup> (may be used in place of specific hazard alert symbols shown below)	
2	Electrical	
3	Explosion	
4	Fire	
5	Radiation (non-ionizing)	
6	Thermal	
7	Tipping gas cylinder	
<sup>a</sup> Equivalent in meaning and use to “general warning sign” in ISO 3864-2.		

## A.2 Hazard source symbols

See Table A.2.

**Table A.2 — Common hazard source symbols in welding and cutting**












No.	Source of hazard	Symbol
1	Welding electrode causing electric shock	
2	Wiring causing electric shock	
3	Welding electrode and wiring causing electric shock	
4	Plasma cutting torch causing electric shock	
5	Fumes and gases coming from any source	
6	Fumes and gases coming from welding process	
7	Fumes and gases coming from plasma cutting arc	
8	Fumes and gases coming from engine exhaust	
9	Fumes and gases coming from engine exhaust and welding process	
10	Gases coming from a shielding gas cylinder	
11	Fire from sources found in the welding and cutting environment (e.g. welding and cutting sparks, fuel)	

Table A.2 (continued)



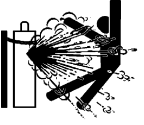
















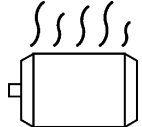

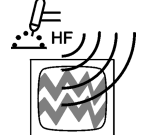
No.	Source of hazard	Symbol
12	Explosion from welding sparks	
13	Explosion from plasma cutting sparks	
14	Explosion from pressurized gas cylinders	
15	Explosion from battery gases	
16	Explosion from electrical components	
17	Moving parts such as fans and rotors	
18	Pinch points on moving parts (such as gears and drive rolls)	
19	Hot work pieces from welding and cutting; hot mufflers; hot exhaust pipes	
20	Welding gun and wire	
21	Loud noise from engine, machinery, and arc	
22	Batteries containing acid	

Table A.2 (continued)

No.	Source of hazard	Symbol
23	Coolant spray from hot engine radiators	
24	Fuel spray from pressurized fuel in tank	
25	Flying particles from chipping and grinding	
26	Plasma arc from cutting torch	
27	Welding arc rays	
28	Plasma cutting arc rays	
29	Electromagnetic fields and high frequency energy from plasma cutting causing pacemaker malfunction	
30	Electromagnetic fields and high frequency energy from welding causing pacemaker malfunction	
31	Hot component	
32	Printed circuit board static electricity	
33	High frequency radiation from welding and welding equipment causing interference and equipment malfunction	

### A.3 Hazard avoidance symbols

See Table A.3.

**Table A.3 — Common hazard avoidance symbols in welding and cutting**

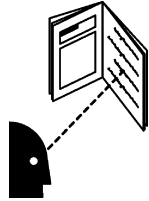



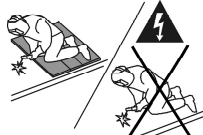
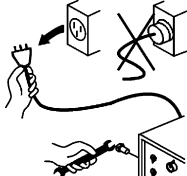
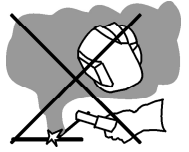









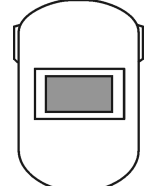

No.	Precautionary measure	Symbol
1	Read instruction manual	
2	Become trained	
3	Do not remove or paint over the precautionary label	
4	Wear dry, insulated gloves	
5	Insulate yourself from work and ground	
6	Disconnect input power before working on equipment	
7	Keep head out of fumes	
8	Use forced ventilation or local exhaust to remove fumes	
9	Keep flammable materials away from welding	


Table A.3 (continued)

No.	Precautionary measure	Symbol
10	Have a watchperson with a fire extinguisher at the ready	
11	Do not weld on closed containers with unknown substances	
12	Wear hat and safety glasses	
13	Use ear protection and button shirt collar	
14	Wear complete body protection	
15	Do not touch hot parts	
16	Do not smoke	
17	Use welding helmet with correct shade of filter	
18	Use ventilating fan to remove fumes	

## Annex B (informative)
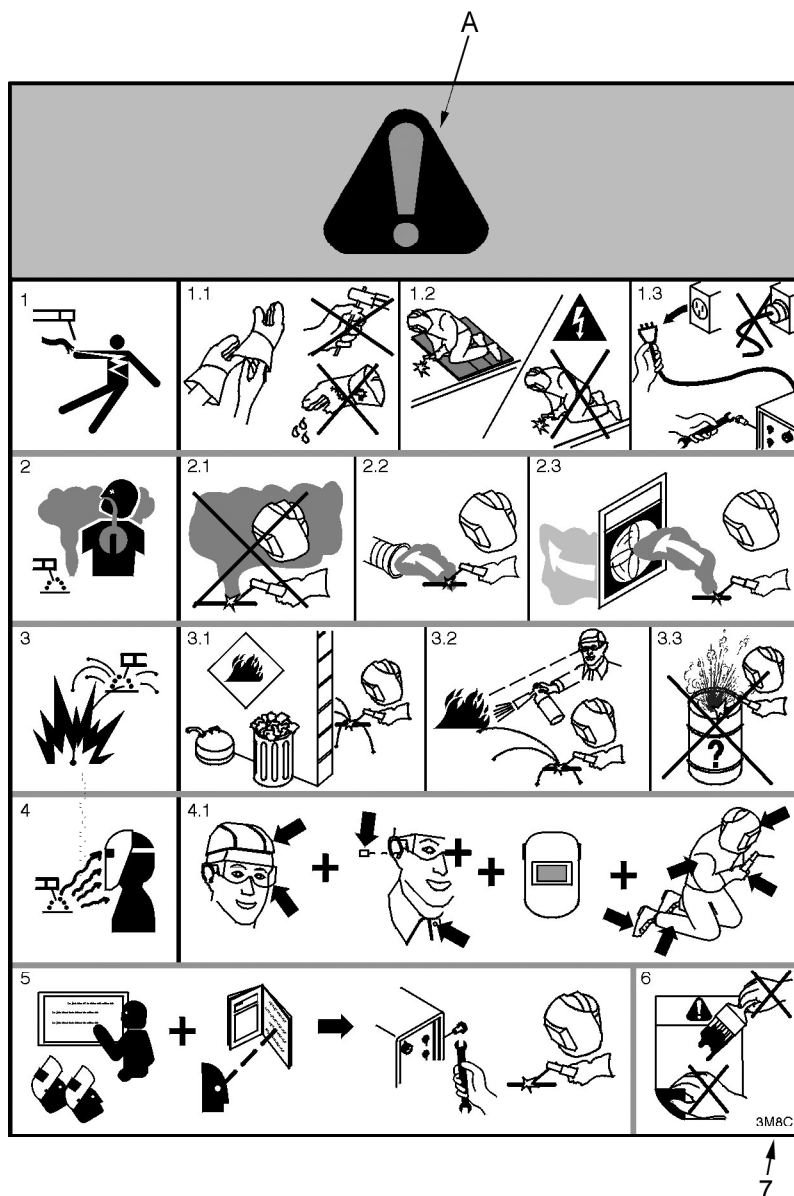
### Examples of wordless precautionary labels

Figures B.1 to B.9 provide examples of wordless precautionary labels for general use on welding and plasma cutting products, for use on specific types of welding and cutting products, and for use when specific hazards exist in conjunction with the operation of welding and cutting products. As an aid to the reader of this International Standard, these figures also contain a text description of what each symbol represents.



**Key**

- A Warning! Watch out! There are possible hazards as shown by the symbols.
- 1 Electric shock from welding electrode or wiring can kill.
  - 1.1 Wear dry insulating gloves. Do not touch electrode with bare hand. Do not wear wet or damaged gloves.
  - 1.2 Protect yourself from electric shock by insulating yourself from work and ground.
  - 1.3 Disconnect input plug or power before working on machine.
- 2 Breathing welding fumes can be hazardous to your health.
  - 2.1 Keep head out of fumes.
  - 2.2 Use forced ventilation or local exhaust to remove fumes.
  - 2.3 Use ventilating fan to remove fumes.
- 3 Welding sparks can cause explosion or fire.
  - 3.1 Keep flammable materials away from welding.
  - 3.2 Welding sparks can cause fires. Have a fire extinguisher nearby and have a watchperson ready to use it.
  - 3.3 Do not weld on drums or any closed containers.
- 4 Arc rays can burn eyes and injure skin.
  - 4.1 Wear hat and safety glasses. Use ear protection and button shirt collar. Use welding helmet with correct shade of filter. Wear complete body protection.
- 5 Become trained and read the instructions before working on the machine or welding.
- 6 Do not remove or paint over (cover) label.
- 7 Identifying number to order label from manufacturer.

**Figure B.1 — Basic precautionary label (vertical format)**



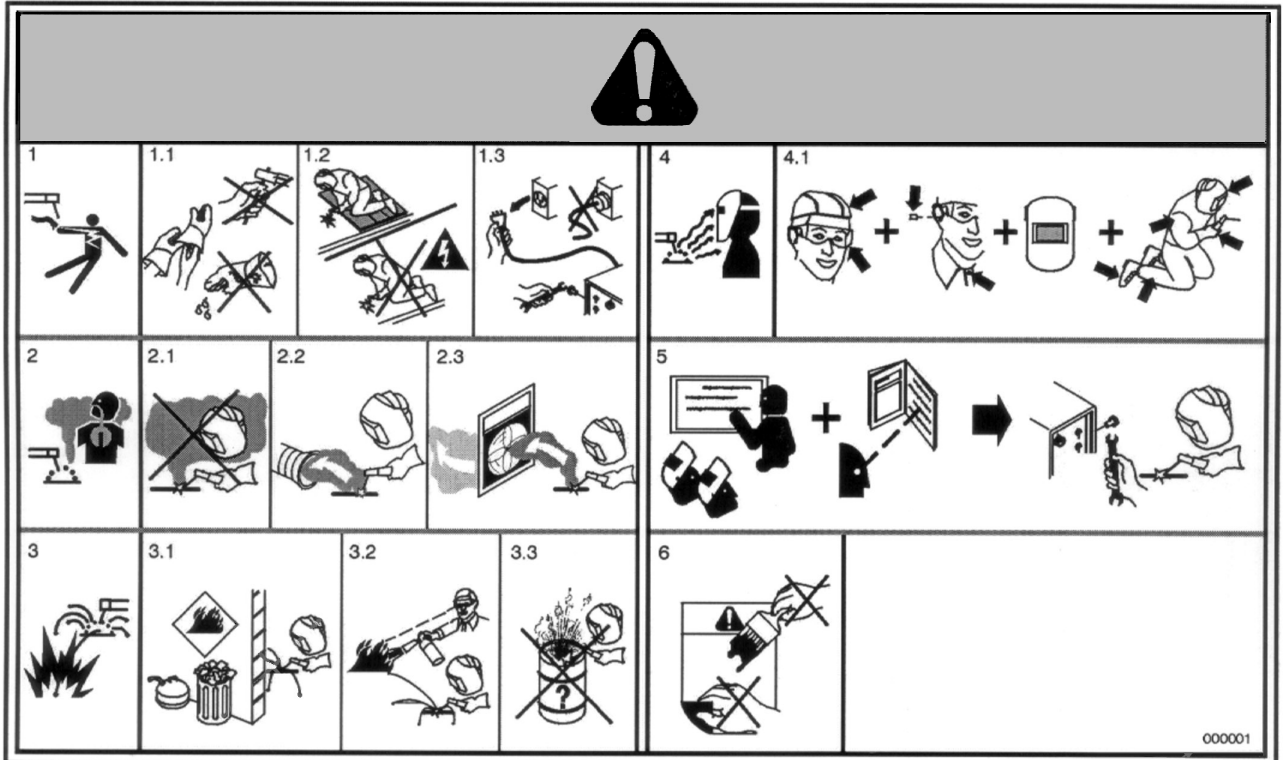


Figure B.2 — Basic precautionary label (horizontal format)  
(For Key see Figure B.1)



**Key**

- A Warning! Watch out! There are possible hazards as shown by the symbols.
- 1 Cutting sparks can cause explosion or fire.
  - 1.1 Keep flammable materials away from cutting.
  - 1.2 Cutting sparks can cause fires. Have a fire extinguisher nearby, and have a watchperson ready to use it.
  - 1.3 Do not cut on drums or any closed container.
- 2 The plasma arc can cause injury and burns.
  - 2.1 Turn off power before disassembling torch.
  - 2.2 Do not grip material near cutting path.
  - 2.3 Wear complete body protection.
- 3 Electric shock from torch or wiring can kill.
  - 3.1 Wear dry insulating gloves. Do not wear wet or damaged gloves.
  - 3.2 Protect yourself from electric shock by insulating yourself from work and ground.
  - 3.3 Disconnect input plug or power before working on machine.
- 4 Breathing cutting fumes can be hazardous to your health.
  - 4.1 Keep your head out of fumes.
  - 4.2 Use forced ventilation or local exhaust to remove fumes.
  - 4.3 Use ventilating fan to remove fumes.
- 5 Arc rays can burn eyes and injure skin.
  - 5.1 Wear hat and safety glasses. Use ear protection and button shirt collar. Use welding helmet with correct shade of filter. Wear complete body protection.
- 6 Become trained and read the instructions before working on the machine or cutting.
- 7 Do not remove or paint over (cover) the label.
- 8 Identifying number to order label from manufacturer


**Figure B.3 — Plasma arc cutting equipment**



**Key**

- A Warning! Watch out! There are possible hazards as shown by the symbols.
- B Become trained and read the instructions before working on the machine or welding.
- 1 Electric shock from welding electrode or wiring can kill.
  - 1.1 Wear dry insulating gloves. Do not touch electrode with bare hand. Do not wear wet or damaged gloves.
  - 1.2 Protect yourself from electric shock by insulating yourself from work and ground.
  - 1.3 Do not work on unit if engine is running. Stop engine first.
- 2 Breathing welding fumes can be hazardous to your health.
  - 2.1 Keep your head out of fumes.
  - 2.2 Use forced ventilation or local exhaust to remove fumes.
  - 2.3 Use ventilating fan to remove fumes.
- 3 Welding sparks can cause explosion or fire.
  - 3.1 Keep flammable materials away from welding.
  - 3.2 Welding sparks can cause fires. Have a fire extinguisher nearby and have a watchperson ready to use it.
  - 3.3 Do not weld on drums or any closed containers.
- 4 Arc rays can burn eyes and injure skin.
  - 4.1 Wear hat and safety glasses. Use ear protection and button shirt collar. Use welding helmet with correct shade of filter. Wear complete body protection.
- 5 Do not remove or paint over (cover) the label.
- 6 Engine fuel plus flames or sparks can cause fire.
  - 6.1 Do not smoke while fuelling or if near fuel.
  - 6.2 Stop engine before fuelling.
  - 6.3 Do not fuel a hot engine.
- 7 Engine exhaust gases can kill.
  - 7.1 Vent exhaust outside.
  - 7.2 Use unit outside.
- 8 Identifying number to order label from manufacturer.

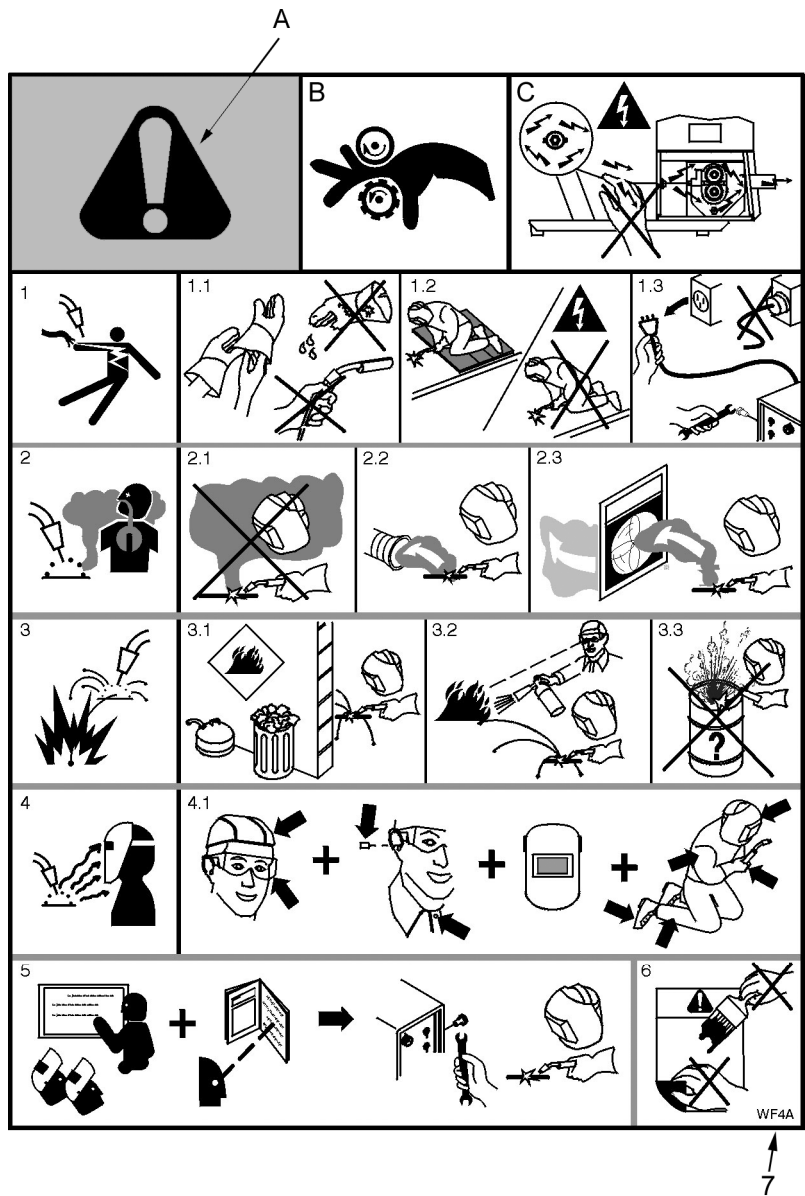**Figure B.4 — Engine-driven welding and cutting equipment**




**Key**

- A Warning! Watch out! There are possible hazards as shown by the symbols.
- B Drive rolls can injure fingers.
- C Welding wire and drive parts are at welding voltage during operation — keep hands and metal objects away.
- 1 Electric shock from welding electrode or wiring can kill.
  - 1.1 Wear dry insulating gloves. Do not touch electrode with bare hand. Do not wear wet or damaged gloves.
  - 1.2 Protect yourself from electric shock by insulating yourself from work and ground.
  - 1.3 Disconnect input plug or power before working on machine.
- 2 Breathing welding fumes can be hazardous to your health.
  - 2.1 Keep your head out of fumes.
  - 2.2 Use forced ventilation or local exhaust to remove fumes.
  - 2.3 Use ventilating fan to remove fumes.
- 3 Welding sparks can cause explosion or fire.
  - 3.1 Keep flammable materials away from welding.
  - 3.2 Welding sparks can cause fires. Have a fire extinguisher nearby and have a watchperson ready to use it.
  - 3.3 Do not weld on drums or any closed containers.
- 4 Arc rays can burn eyes and injure skin.
  - 4.1 Wear hat and safety glasses. Use ear protection and button shirt collar. Use welding helmet with correct shade of filter. Wear complete body protection.
- 5 Become trained and read the instructions before working on the machine or welding.
- 6 Do not remove or paint over (cover) label.
- 7 Identifying number to order label from manufacturer.

**Figure B.5 — Wire feeding equipment**

**Key**


- 1 Warning! Watch out! There are possible hazards as shown by the symbols.
- 2 Moving parts, such as fans, rotors and belts, can cut fingers and hands and cause injury. Keep away from moving parts.
- 3 Identifying number to order label from manufacturer.

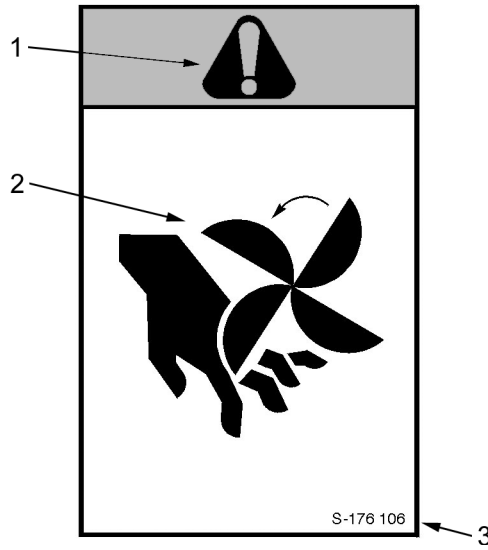

**Figure B.6 — Specific hazard: fan and moving parts**

**Key**


- 1 Warning! Watch out! There are possible hazards as shown by the symbols.
- 2 Hot muffler and exhaust pipes can cause severe burns. Do not touch hot muffler or pipes.
- 3 Identifying number to order label from manufacturer.

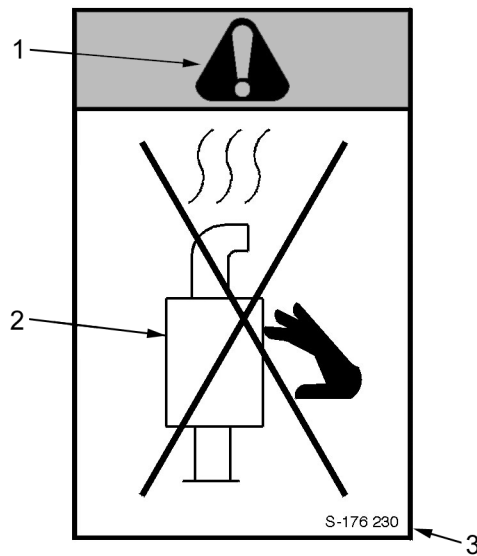


**Figure B.7 — Specific hazard: hot muffler**

**Key**

- 1 Warning! Watch out! There are possible hazards as shown by the symbols.
- 2 Engine fuel plus flames or sparks can cause fire.
- 3 Stop engine before fuelling.
- 4 Do not smoke while fuelling or if near fuel.
- 5 Do not fuel a hot engine.
- 6 Use diesel fuel only.
- 7 Identifying number to order label from manufacturer.

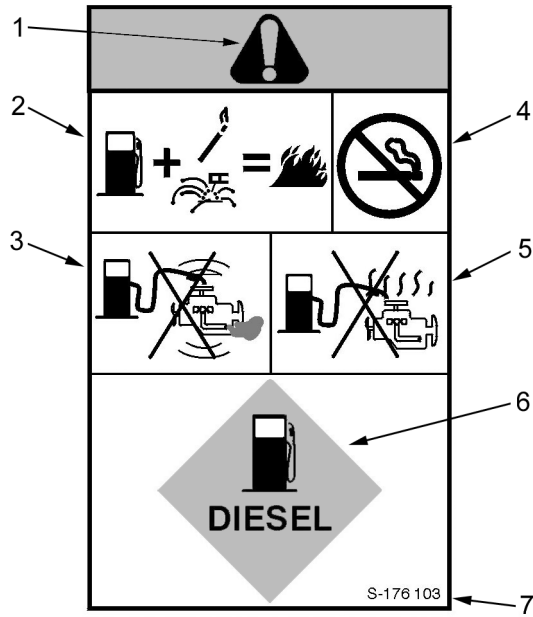

**Figure B.8 — Specific hazard: diesel fuel**

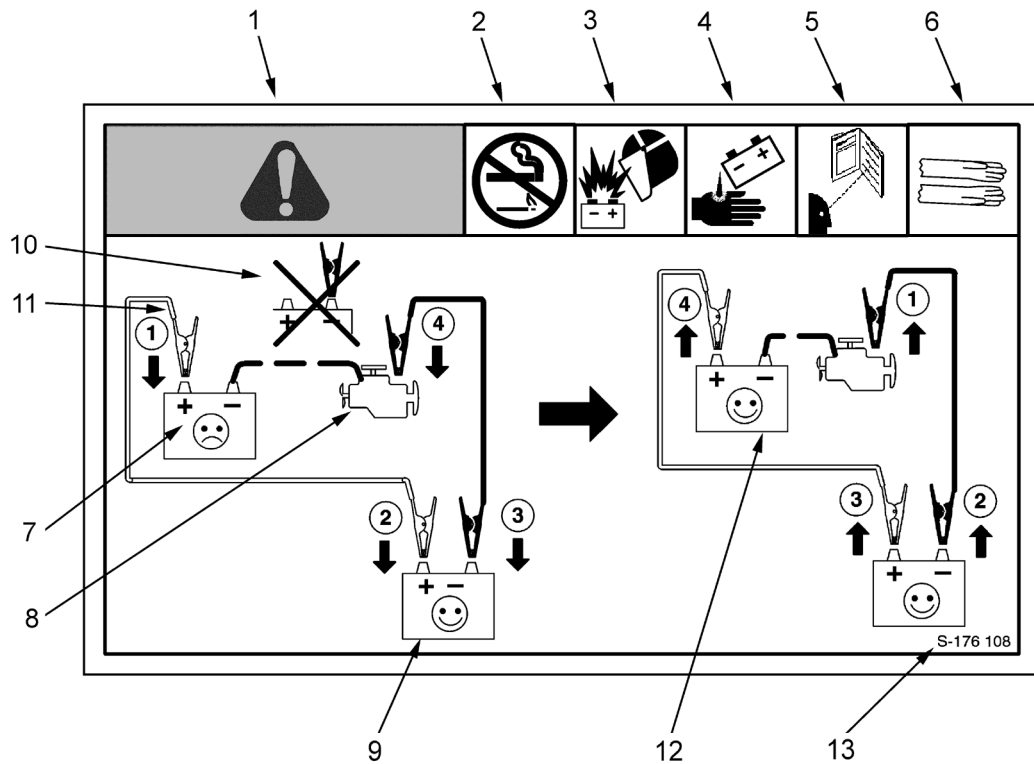

### Key

- 1 Warning! Watch out! There are possible hazards as shown by the symbols.
- 2 Do not smoke and keep matches and flames away from battery.
- 3 Sparks can cause battery gases to explode. Battery explosion can blind and injure. Wear a face shield.
- 4 Battery acid can burn skin. Do not spill acid.
- 5 Read owner's manual.
- 6 Wear rubber gloves.
- 7 Dead battery.
- 8 Engine block.
- 9 Fully charged battery.
- 10 Do not connect last negative cable to dead battery — connect instead to engine block.
- 11 Jumper cables — observe polarity and make connections in numbered sequence shown.
- 12 Once dead battery is charged, disconnect cables in sequence shown.
- 13 Identifying number to order label from manufacturer.

**Figure B.9 — Specific hazard: battery charging**

## Bibliography

- [1] ISO 7000, *Graphical symbols for use on equipment — Index and synopsis*
- [2] IEC 60417, *Graphical symbols for use on equipment*
- [3] IEC 80416-1, *Basic principles for graphical symbols for use on equipment — Part 1: Creation of symbol originals*
- [4] ANSI Z49.1, *Safety in Welding, Cutting and Allied Processes*
- [5] ANSI Z535.3, *Criteria for Safety Symbols*
- [6] ANSI Z535.4, *Product Safety Signs and Labels*
- [7] CSA C22.2 No. 60, *Arc Welding Equipment*
- [8] DIN 30 600, *Graphische Symbole, Bildzeichen-Übersicht*

© ISO 2004





---

---

**ICS 25.160.01**

Price based on 18 pages