



Standard Test Method for Creep of Soft Rock Core Specimens in Uniaxial Compression at Ambient or Elevated Temperature¹

This standard is issued under the fixed designation D 4405; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

1. Scope*

1.1 This test method covers the creep behavior of intact cylindrical soft rock core specimens in uniaxial compression. It specifies the apparatus, instrumentation, and procedures for determining the strain as a function of time under sustained load. Soft rocks include such materials as salt and potash, which often exhibit very large strain at failure.

1.2 All observed and calculated values shall conform to the guidelines for significant digits and rounding established in Practice D 6026.

1.2.1 The method used to specify how data are collected, calculated, or recorded in this standard is not directly related to the accuracy to which the data can be applied in design or other uses, or both. How one applies the results obtained using this standard is beyond its scope.

1.3 The values stated SI units are to be regarded as the standard.

1.4 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

2. Referenced Documents

2.1 ASTM Standards:²

- D 653 Terminology Relating to Soil, Rock, and Contained Fluids
- D 2113 Practice for Diamond Core Drilling for Site Investigation
- D 2216 Test Method for Laboratory Determination of Water (Moisture) Content of Soil and Rock
- D 3740 Practice for Minimum Requirements for Agencies Engaged in the Testing and/or Inspection of Soil and Rock

- as Used in Engineering Design and Construction
- D 4543 Practice for Preparing Rock Core Specimens and Determining Dimensional and Shape Tolerances
- D 5079 Practices for Preserving and Transporting Rock Core Samples
- D 6026 Practice for Using Significant Digits in Geotechnical Data
- E 4 Practices for Load Verification of Testing Machines
- E 122 Practice for Choice of Sample Size to Estimate a Measure of Quality for a Lot or Process

3. Terminology

- 3.1 Refer to Terminology D 653 for specific definitions.

4. Summary of Test Method

4.1 A section of rock core is cut to length and the ends are machined flat to produce a cylindrical test specimen. The specimen is placed in a loading frame and, if required, heated to the desired test temperature. Axial load is rapidly applied to the specimen and sustained. Deformation is monitored as a function of elapsed time.

5. Significance and Use

5.1 There are many underground structures that are created for permanent or long-term use. Often these structures are subjected to an approximately constant load. Creep tests provide quantitative parameters for the stability analysis of these structures.

5.2 The deformation and strength properties of rock cores measured in the laboratory usually do not accurately reflect large-scale in situ properties, because the latter are strongly influenced by joints, faults, inhomogeneities, weakness planes, and other factors. Therefore, laboratory values for intact specimens must be employed with proper judgment in engineering applications.

NOTE 1—Notwithstanding the statements on precision and bias contained in this test method; the precision of this test method is dependent on the competence of the personnel performing it, and the suitability of the equipment and facilities used. Agencies that meet the criteria of Practice D 3740 are generally considered capable of competent and objective testing. Users of this test method are cautioned that compliance with

¹ This test method is under the jurisdiction of ASTM Committee D18 on Soil and Rock and is the direct responsibility of Subcommittee D18.12 on Rock Mechanics. Current edition approved Jan. 1, 2004. Published January 2004. Originally approved in 1993. Last previous edition approved in 1998 as D 4405 – 93 (1998).

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

*A Summary of Changes section appears at the end of this standard.

Practice D 3740 does not in itself assure reliable testing. Reliable testing depends on many factors; Practice D 3740 provides a means of evaluating some of these factors.

6. Apparatus

6.1 Loading Device—The loading device shall be of sufficient capacity to apply load at a rate conforming to the requirements specified in 10.5 and shall be able to maintain the specified load within 2 %. It shall be verified at suitable time intervals in accordance with the procedures given in Practices E 4 and comply with the requirements prescribed in this test method.

NOTE 2—By definition, creep is the time-dependent deformation under constant stress. The loading device is specified to maintain constant axial load, and therefore, constant engineering stress. The true stress, however, decreases as the specimen deforms and the cross-sectional area increases. Because of the associated experimental ease, constant load testing is recommended. However, the procedure permits constant true-stress testing, provided that the applied load is increased with specimen deformation so that true stress is constant within 2 %.

6.2 Elevated-Temperature Enclosure—The elevated temperature enclosure may be either an enclosure that fits in the loading apparatus or an external system encompassing the complete test apparatus. The enclosure may be equipped with humidity control for testing specimens in which the moisture content is to be controlled. For high temperatures a system of heaters, insulation, and temperature measuring devices are normally required to maintain the specified temperature. Temperature shall be measured at three locations, with one sensor near the top, one at midheight, and one near the bottom of the specimen. The average specimen temperature based on the midheight sensor shall be maintained to within $\pm 1^\circ\text{C}$ of the required test temperature. The maximum temperature difference between the midheight sensor and either end sensor shall not exceed 3°C .

NOTE 3—An alternative to measuring the temperature at three locations along the specimen during the test is to determine the temperature distribution in a dummy specimen that has temperature sensors located in drill holes at a minimum of six positions: along both the centerline and specimen periphery at midheight and each end of the specimen. The temperature controller set point shall be adjusted to obtain steady-state temperatures in the dummy specimen that meet the temperature requirements at each test temperature (the centerline temperature at midheight shall be within $\pm 1^\circ\text{C}$ of the required test temperature, and all other specimen temperatures shall not deviate from this temperature by more than 3°C). The relationship between controller set point and dummy specimen temperature can be used to determine the specimen temperature during testing, provided that the output of the temperature feedback sensor (or other fixed-location temperature sensor in the triaxial apparatus) is maintained constant within $\pm 1^\circ\text{C}$ of the required test temperature. The relationship between temperature controller set point and steady-state specimen temperature shall be verified periodically. The dummy specimen is used solely to determine the temperature distribution in a specimen in the elevated temperature enclosure; it is not to be used to determine creep behavior.

6.3 Temperature Measuring Device—Special limits-of-error thermocouples or platinum resistance thermometers (RTDs) having accuracies of at least $\pm 1.0^\circ\text{C}$ with a resolution of 0.1°C .

6.4 Platens—Two steel platens are used to transmit the axial load to the ends of the specimen. They shall have a hardness of

not less than 58 HRC. One of the platens should be spherically seated and the other a plain rigid platen. The bearing faces shall not depart from a plane by more than 0.015 mm when the platens are new and shall be maintained within a permissible variation of 0.025 mm. The diameter of the spherical seat shall be at least as large as that of the test specimen but shall not exceed twice the diameter of the test specimen. The center of the sphere in the spherical seat shall coincide with that of the bearing face of the specimen. The spherical seat shall be properly lubricated to assure free movement. The movable portion of the platen shall be held closely in the spherical seat, but the design shall be such that the bearing face can be rotated and tilted through small angles in any direction. If a spherical seat is not used, the bearing faces of the platens shall be parallel to 0.0005 mm/mm of platen diameter. The platen diameter shall be at least as great as the specimen but shall not exceed the specimen diameter by more than 10 % of the specimen diameter.

NOTE 4—Because soft rocks can deform significantly in creep tests it is important to reduce friction in the platen-specimen interfaces to facilitate relative slip between the specimen ends and the platens. Effective friction-reducing precautions include polishing the platen surfaces to a mirror finish and attaching a thin, 0.15-mm thick teflon sheet to the platen surfaces.

6.5 Strain/Deformation Measuring Devices—The strain/deformation measuring system shall measure the strain with a resolution of at least 25×10^{-6} strain and an accuracy within 2 % of the value of readings above 250×10^{-6} strain and an accuracy and resolution within 5×10^{-6} for readings lower than 250×10^{-6} strain, including errors introduced by excitation and readout equipment. The system shall be free from noncharacterizable long-term instability (drift) that results in an apparent strain of 10^{-8} per second.

6.5.1 Axial Strain Determination—The axial deformations or strains may be determined from data obtained by electrical strain gages, compressometers, linear variable differential transformers (LVDTs), or other suitable means. The design of the measuring device shall be such that the average of at least two axial strain measurements can be determined. Measuring positions shall be equally spaced around the circumference of the specimen close to midheight. The gage length over which the axial strains are determined shall be at least ten grain diameters in magnitude.

6.5.2 Lateral Strain Determination—The lateral deformations or strains may be measured by any of the methods mentioned in 6.5.1. Either circumferential or diametrical deformations (or strains) may be measured. A single transducer that wraps around the specimen can be used to measure the change in circumference. At least two diametric deformation sensors shall be used if diametric deformations are measured. These sensors shall be equally spaced around the circumference of the specimen close to midheight. The average deformation (or strain) from the diametric sensors shall be recorded.

NOTE 5—The use of strain gage adhesives requiring cure temperatures above 65°C is not allowed unless it is known that microfractures do not develop at the cure temperature.

7. Safety Precautions

7.1 Many rock types fail in a violent manner when loaded to failure in compression. A protective shield should be placed around the test specimen to prevent injury from flying rock fragments.

7.2 Elevated temperatures increase the risks of electrical shorts, fire, and burns.

8. Sampling

8.1 Samples can be either drill cores obtain directly from the in situ rock or obtained from block samples cored in the field or in the laboratory.

8.2 Moisture condition can have a significant effect upon the deformation of the rock. Test samples must meet any requirements determined in section 9.2. Therefore, it follows that the field moisture condition of the samples may need protection during and after sampling. This may require special collection and handling techniques such as those outlined in Practices D 2113 and D 5079.

8.3 The location of the specimens for each test sample shall be selected from the cores to represent a valid average of the type of rock under consideration. This can be achieved by visual observations of mineral constituents, grain sizes and shape, partings and defects such as pores and fissures, or by other methods such as ultrasonic velocity measurements.

8.4 The number of specimens required to obtain a specific level of statistically valid results may be determined using Practice E 122. However, it may not be economically possible to achieve a specific confidence levels and professional judgment may be required too.

9. Test Specimens

9.1 *Preparation*—Prepare test specimens from the drill core samples in accordance with Practice D 4543 and sections 8.3 and 9.2.

9.2 Moisture condition of the specimen at the time of test can have a significant effect upon the deformation of the rock. Good practice generally dictates that laboratory tests be made upon specimens representative of field conditions. Thus, it follows that the field moisture condition of the specimen should be preserved until the time of test. On the other hand, there may be reasons for testing specimens at other moisture contents, including zero. In any case, the moisture content of the test specimen should be tailored to the problem at hand and reported in accordance with 12.1.3. If the moisture content of the specimen is to be determined, follow the procedures given in Test Method D 2216.

9.3 If moisture content is to be maintained, and the elevated temperature enclosure is not equipped with humidity control, seal the specimen using a flexible membrane or apply a plastic or silicone rubber coating to the specimen sides.

10. Procedure

10.1 Check the ability of the spherical seat to rotate freely in its socket before each test.

10.2 Place the lower platen on the base or actuator rod of the loading device. Wipe clean the bearing faces of the upper and lower platens and of the test specimen, and place the test

specimen on the lower platen. Place the upper platen on the specimen and align properly. A small axial load, approximately 100 N, may be applied to the specimen by means of the loading device to properly seat the bearing parts of the apparatus.

10.3 When appropriate, install elevated-temperature enclosure and deformation transducers for the apparatus and sensors used.

10.4 If testing at elevated temperature, raise the temperature at a rate not exceeding 2°C/min until the required temperature is reached (see Note 6). The test specimen shall be considered to have reached temperature equilibrium when all deformation transducer outputs are stable for at least three readings taken at equal intervals over a period of no less than 30 min (3 min for tests performed at room temperature). Stability is defined as a constant reading showing only the effects of normal instrument and heater unit fluctuations. Record the initial deformation readings. Consider this to be the zero for the test.

NOTE 6—It has been observed that for some rock types microcracking will occur for heating rates above 1°C/min. The operator is cautioned to select a heating rate such that microcracking is not significant.

10.5 Apply the axial load continuously and without shock to the required test load within 20 s. Thereafter, the test load shall be held constant for the remainder of the test for constant load testing or increased with specimen deformation for constant true stress testing.

10.6 Record the strain or deformation immediately after the required test load has been applied. Thereafter, record the strain or deformation at suitable time intervals. During the early rapid transient straining, readings shall be taken every few minutes to few hours until the deformation rate slows and becomes relatively constant. Readings shall be taken at least twice daily until the test is terminated. If the strain rate accelerates as failure is approached, increase the frequency of readings appropriately.

10.7 Record the load and specimen temperature either continuously or each time the strain or deformation is read.

11. Calculation

11.1 The axial strain, ϵ_a , and lateral strain, ϵ_l , may be obtained directly from strain-indicating equipment, or may be calculated from deformation readings, depending on the type of apparatus or instrumentation employed.

11.1.1 Calculate the axial strain, ϵ_a , as follows:

$$\epsilon_a = \frac{\Delta L}{L} \quad (1)$$

where:

L = original undeformed axial gage length, and

ΔL = change in measured axial length (negative for decrease in length).

NOTE 7—Tensile stresses and strains are used as being positive herein. A consistent application of a compression-positive sign convention may be employed if desired. The sign convention adopted needs to be stated explicitly in the report. The formulas given are for engineering stresses and strains. True stresses and strains may be used if desired.

NOTE 8—If the deformation recorded during the test includes deformation of the apparatus, suitable calibration for apparatus deformation must be made. This may be accomplished by inserting into the apparatus a steel cylinder having known elastic properties and observing differences in

deformation between the assembly and steel cylinder throughout the loading range. The apparatus deformation is then subtracted from the total deformation at each increment of load to arrive at specimen deformation from which the axial strain of the specimen is computed. The accuracy of this correction should be verified by measuring the elastic deformation of a cylinder of material having known elastic properties (other than steel) and comparing the measured and computed deformations.

11.1.2 Calculate the lateral strain, ϵ_l , as follows:

$$\epsilon_l = \frac{\Delta D}{D} \quad (2)$$

where:

- D = original undeformed diameter, and
- ΔD = change in diameter (positive for increase in diameter).

NOTE 9—Many circumferential transducers measure change in chord length and not change in arc length (circumference). The geometrically nonlinear relationship between change in chord length and change in diameter must be used to obtain accurate values of lateral strain.

11.2 Calculate the compressive stress in the test specimen from the compressive load on the specimen and the initial computed cross-sectional area as follows:

$$\sigma = \frac{P}{A} \quad (3)$$

where:

- σ = stress,
- P = load, and
- A = area.

11.3 Plot the strain-versus-time curves for the axial and lateral directions (Fig. 1).

12. Report

12.1 Report the following:

- 12.1.1 Source of sample, including project name and location (often the location is specified in terms of the drill hole number and depth of specimen from the collar of the hole),
- 12.1.2 Lithologic description of the rock, formation name, and load direction with respect to lithology,
- 12.1.3 Moisture condition of specimen before test,
- 12.1.4 Specimen diameter and height, conformance with dimensional requirements,
- 12.1.5 Stress level at which test was performed. Indicate whether engineering or true stress was held constant,
- 12.1.6 Temperature at which test was performed,
- 12.1.7 Plot of the strain versus time curve (Fig. 1),
- 12.1.8 Tabulation of selected strain and time data,

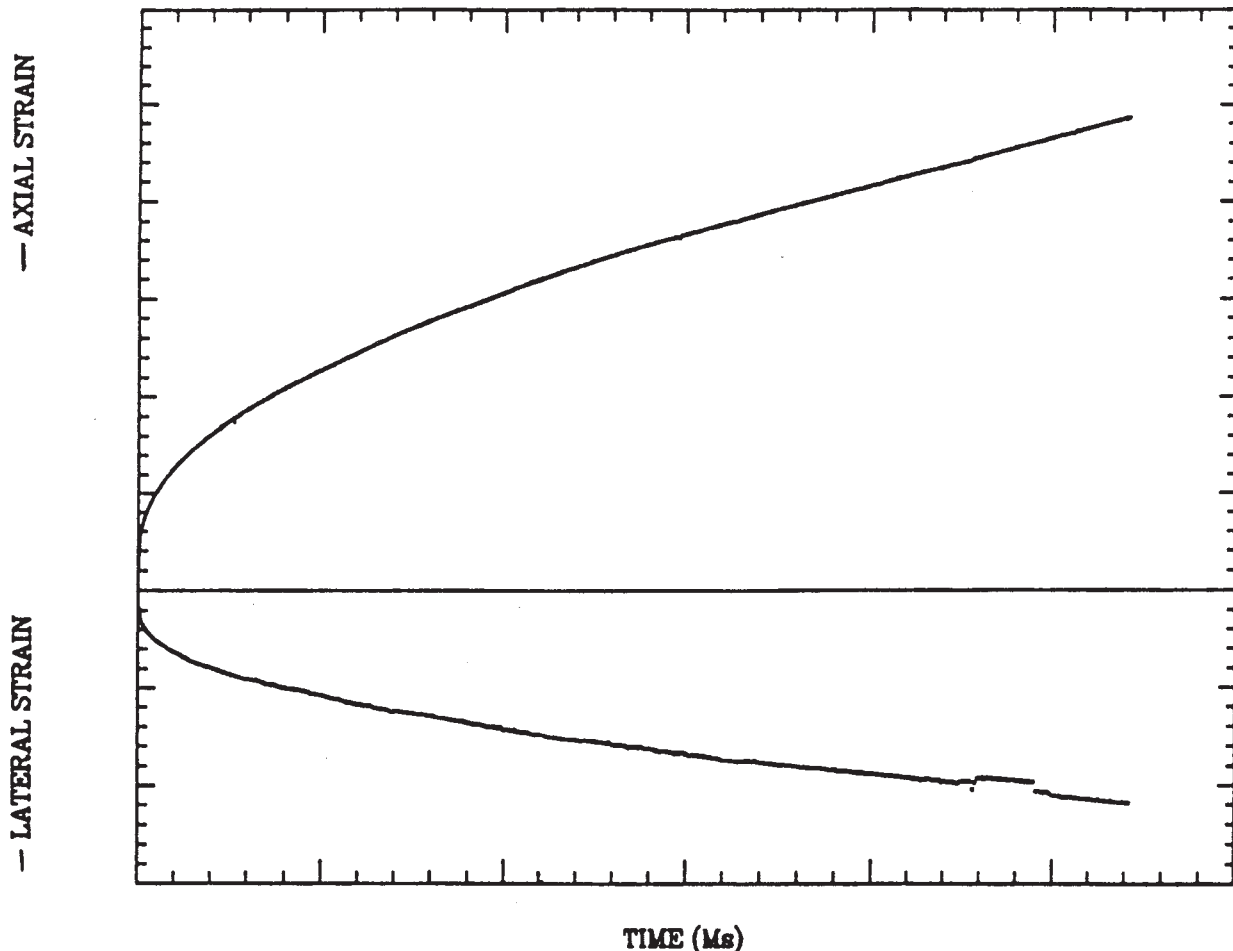


FIG. 1 Typical Strain-Versus-Time Curves

12.1.9 A description of physical appearance of specimen after test, including visible end effects such as cracking, spalling, or shearing at the platen-specimen interfaces, and

12.1.10 If the actual equipment or procedure has varied from the requirements contained in this test method, each variation and the reasons for it shall be discussed.

13. Precision and Bias

13.1 *Precision*—Due to the nature of rock materials tested by this test method, it is either not feasible or too costly at this time to produce multiple specimens that have uniform mechanical properties. Any variation observed in the data is just

as likely to result from specimen variation as from operator or laboratory testing variation. Subcommittee D18.12 welcomes proposals that would allow for development of a valid precision statement.

13.2 *Bias*—Bias cannot be determined since there is no standard creep deformation that can be used to compare with values determined using this test method.

14. Keywords

14.1 compression testing; creep; deformation; loading tests; rock

SUMMARY OF CHANGES

In accordance with Committee D18 policy, this section identifies the location of the changes to this standard since the last edition 1998 that may impact the use of this standard.

- (1) Revised title of standard to include elevated temperature, deleted “cylindrical”, and made “compressions” singular.
- (2) Inserted missing caveat in Section 1 on significant figures.
- (3) Corrected section 1.3 from inch-pound to SI units.
- (4) Inserted missing and new references to standards D 653, D 2113, D 3740, D 5079, and D 6026, and E 122 under item 2.
- (5) Section 4.1 Changed “sample” to “specimen.”
- (6) Inserted Item 4 Terminology and renumbered all subsequent items.
- (7) Inserted Note 1 D 3740 caveat and renumbered all subsequent Notes.
- (8) Section 7.1, added safety precaution for burns.

- (9) Changed section 8.1 to 8.3 and changed emphasis from specimen to test sample.
- (10) Section 8.1 and 8.2 to include the importance of collection and curatorial care of the samples from the point of origin to the laboratory.
- (11) Added section 8.4 to reference E 122 and to the number of specimens required.
- (12) Section 9.1 added that the specimens are prepared from the drill core sample and to be prepared in accordance with the requirements in sections 8.3 and 9.2 which covers the moisture content of test specimens.
- (13) Inserted Summary of Changes section.

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org).