



Standard Test Method for Consolidated Drained Triaxial Compression Test for Soils¹

This standard is issued under the fixed designation D7181; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reappraisal. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reappraisal.

1. Scope

1.1 This test method covers the determination of strength and stress-strain relationships of a cylindrical specimen of either intact or reconstituted soil. Specimens are consolidated and sheared in compression with drainage at a constant rate of axial deformation (strain controlled).

1.2 This test method provides for the calculation of principal stresses and axial compression by measurement of axial load, axial deformation, and volumetric changes.

1.3 This test method provides data useful in determining strength and deformation properties such as Mohr strength envelopes. Generally, three specimens are tested at different effective consolidation stresses to define a strength envelope.

1.4 If this test method is used on cohesive soil, a test may take weeks to complete.

1.5 The determination of strength envelopes and the development of relationships to aid in interpreting and evaluating test results are beyond the scope of this test method and must be performed by a qualified, experienced professional.

1.6 All observed and calculated values shall conform to the guidelines for significant digits and rounding established in Practice [D6026](#).

1.6.1 The methods used to specify how data are collected, calculated, or recorded in this standard are regarded as the industry standard. In addition, they are representative of the significant digits that generally should be retained. The procedures used do not consider material variations, purpose for obtaining the data, special purpose studies or any consideration of the end use. It is beyond the scope of this test method to consider significant digits used in analysis methods for engineering design.

1.7 *Units*—The values stated in SI units are to be regarded as standard. The inch-pound units given in parentheses are mathematical conversions, which are provided for information purposes only and are not considered standard. Reporting of

test results in units other than SI shall not be regarded as non-conformance with this test method.

1.7.1 The gravitational system of inch-pound units is used when dealing with inch-pound units. In this system, the pound (lbf) represents a unit of force (weight), while the unit for mass is slugs. The slug unit is not given, unless dynamic ($F = ma$) calculations are involved.

1.7.2 It is common practice in the engineering/construction profession to concurrently use pounds to represent both a unit of mass (lbm) and of force (lbf). This implicitly combines two separate systems of units: that is, the absolute system and the gravitational system. It is scientifically undesirable to combine the use of two separate sets of inch-pound units within a single standard. As stated, this standard includes the gravitational system of inch-pound units and does not use/present the slug unit for mass. However, the use of balances or scales recording pounds of mass (lbm) or recording density in lbm/ft^3 shall not be regarded as non-conformance with this standard.

1.7.3 The terms density and unit weight are often used interchangeably. Density is mass per unit volume whereas unit weight is force per unit volume. In this standard density is given only in SI units. After the density has been determined, the unit weight is calculated in SI or inch-pound units, or both.

1.8 *This standard may involve hazardous materials, operations, and equipment. This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

2. Referenced Documents

2.1 *ASTM Standards*:²

- [D422 Test Method for Particle-Size Analysis of Soils](#)
- [D653 Terminology Relating to Soil, Rock, and Contained Fluids](#)
- [D854 Test Methods for Specific Gravity of Soil Solids by Water Pycnometer](#)
- [D1587 Practice for Thin-Walled Tube Sampling of Soils for Geotechnical Purposes](#)

¹ This test method is under the jurisdiction of ASTM Committee [D18](#) on Soil and Rock and is the direct responsibility of Subcommittee [D18.05](#) on Strength and Compressibility of Soils.

Current edition approved July 1, 2011. Published August 2011. DOI: 10.1520/D7181-11.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

- D2166 Test Method for Unconfined Compressive Strength of Cohesive Soil
- D2216 Test Methods for Laboratory Determination of Water (Moisture) Content of Soil and Rock by Mass
- D2435 Test Methods for One-Dimensional Consolidation Properties of Soils Using Incremental Loading
- D2487 Practice for Classification of Soils for Engineering Purposes (Unified Soil Classification System)
- D2850 Test Method for Unconsolidated-Undrained Triaxial Compression Test on Cohesive Soils
- D3740 Practice for Minimum Requirements for Agencies Engaged in Testing and/or Inspection of Soil and Rock as Used in Engineering Design and Construction
- D4220 Practices for Preserving and Transporting Soil Samples
- D4318 Test Methods for Liquid Limit, Plastic Limit, and Plasticity Index of Soils
- D4753 Guide for Evaluating, Selecting, and Specifying Balances and Standard Masses for Use in Soil, Rock, and Construction Materials Testing
- D4767 Test Method for Consolidated Undrained Triaxial Compression Test for Cohesive Soils
- D6026 Practice for Using Significant Digits in Geotechnical Data
- D7263 Test Methods for Laboratory Determination of Density (Unit Weight) of Soil Specimens

3. Terminology

3.1 *Definitions*—Refer to Terminology D653 for standard definitions of common technical terms.

3.2 *Definitions of Terms Specific to This Standard:*

3.2.1 *back pressure, n*—a pressure applied to the specimen pore-water to cause air in the pore space to compress and to pass into solution in the pore-water thereby increasing the percent saturation of the specimen.

3.2.2 *effective consolidation stress, n*—the difference between the cell pressure and the pore-water pressure prior to shearing the specimen.

3.2.3 *failure, n*—a maximum-stress condition or stress at a defined strain for a test specimen. Failure is often taken to correspond to the maximum principal stress difference (maximum deviator stress) attained or the principal stress difference (deviator stress) at 15 % axial strain, whichever is obtained first during the performance of a test. Depending on soil behavior and field application, other suitable failure criteria may be defined, such as maximum effective stress obliquity, $\sigma_1/\sigma_{3\max}$, or the principal stress difference (deviator stress) at a selected axial strain other than 15 %.

4. Significance and Use

4.1 The shear strength of a saturated soil in triaxial compression depends on the stresses applied, time of consolidation, strain rate, and the stress history experienced by the soil.

4.2 In this test method, the shear characteristics are measured under drained conditions and are applicable to field conditions where soils have been fully consolidated under the

existing normal stresses and the normal stress changes under drained conditions similar to those in the test method.

4.3 The shear strength determined from this test method can be expressed in terms of effective stress because a strain rate or load application rate slow enough to allow pore pressure dissipation during shear is used to minimize excess pore pressure conditions. The shear strength may be applied to field conditions where full drainage can occur (drained conditions), and the field stress conditions are similar to those in the test method.

4.4 The shear strength determined from the test is commonly used in embankment stability analyses, earth pressure calculations, and foundation design.

NOTE 1—Notwithstanding the statements on precision and bias contained in this test method, the precision of this test method is dependent on the competence of the personnel performing it and the suitability of the equipment and facilities used. Agencies that meet the criteria of Practice D3740 are generally considered capable of competent testing. Users of this test method are cautioned that compliance with Practice D3740 does not ensure reliable testing. Reliable testing depends on several factors; Practice D3740 provides a means of evaluating some of those factors.

5. Apparatus

5.1 The requirements for equipment needed to perform satisfactory tests are given in the following sections. See Fig. 1

5.2 *Axial Loading Device*—The axial loading device may be a screw jack driven by an electric motor through a geared transmission, a hydraulic loading device, or any other compression device with sufficient capacity and control to provide the rate of axial strain (loading) prescribed in 8.4.2. The rate of advance of the loading device should not deviate by more than ± 1 % from the selected value. Vibration due to the operation of the loading device shall be sufficiently small to not cause dimensional changes in the specimen.

NOTE 2—A loading device may be judged to produce sufficiently small vibrations if there are no visible ripples in a glass of water placed on the loading platform when the device is operating at the speed at which the test is performed.

5.3 *Axial Load-Measuring Device*—The axial load-measuring device shall be an electronic load cell, hydraulic load cell, or any other load-measuring device capable of the accuracy prescribed in this paragraph and may be a part of the axial loading device. The axial load-measuring device shall be capable of measuring the axial load to an accuracy of within 1 % of the axial load at failure. If the load-measuring device is located inside the triaxial compression chamber, it shall be insensitive to horizontal forces and to the magnitude of the chamber pressure.

5.4 *Triaxial Compression Chamber*—The triaxial chamber shall have a working chamber pressure capable of sustaining the sum of the effective consolidation stress and the back pressure. It shall consist of a top plate and a base plate separated by a cylinder. The cylinder may be constructed of any material capable of withstanding the applied pressures. It is desirable to use a transparent material or have a cylinder provided with viewing ports so the behavior of the specimen may be observed. The top plate shall have a vent valve such that air can be forced out of the chamber as it is filled. The base

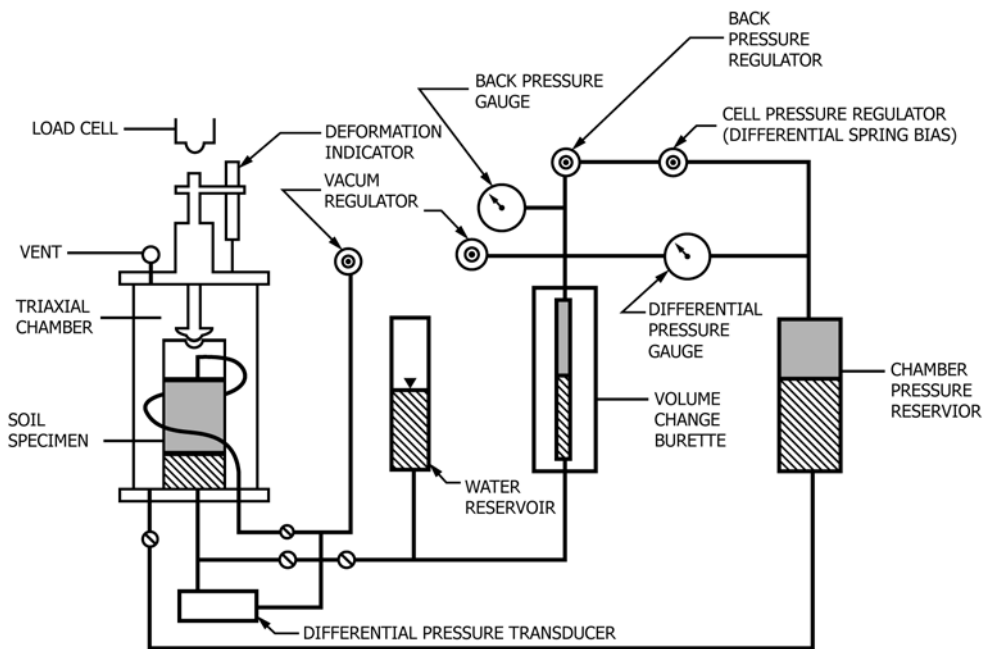


FIG. 1 Schematic Diagram of a Typical Consolidated Undrained Triaxial Apparatus

plate shall have an inlet through which the pressure liquid is supplied to the chamber and inlets leading to the specimen base and provide for connection to the cap to allow saturation and drainage of the specimen when required.

5.5 Axial Load Piston—The piston passing through the top of the chamber and its seal must be designed so the axial load due to friction does not exceed 0.1 % of the axial load at failure and so there is negligible lateral bending of the piston during loading.

NOTE 3—The use of two linear ball bushings to guide the piston is recommended to minimize friction and maintain alignment.

NOTE 4—A minimum piston diameter of $\frac{1}{2}$ the specimen diameter has been used successfully in many laboratories to minimize lateral bending.

5.6 Pressure and Vacuum-Control Devices—The chamber pressure and back pressure control devices shall be (a) capable of applying and controlling pressures to within ± 2 kPa (0.25 lbf/in.²) for effective consolidation pressures less than 200 kPa (28 lbf/in.²) and to within ± 1 % for effective consolidation pressures greater than 200 kPa, and (b) able to maintain the effective consolidation stress within 2 % of the desired value (Note 5). The vacuum-control device shall be capable of applying and controlling partial vacuums to within ± 2 kPa. The devices may consist of pneumatic-pressure regulators, combination pneumatic pressure and vacuum regulators, or any other device capable of applying and controlling pressures or partial vacuums to the required tolerances. These tests can require a duration of several days, therefore, an external air/water interface is recommended for both the chamber-pressure or back-pressure systems.

NOTE 5—Many laboratories use differential pressure regulators and transducers to achieve the requirements for small differences between chamber and back pressure.

5.7 Pressure- and Vacuum-Measurement Devices—The chamber pressure-, back pressure-, and vacuum-measuring devices shall be capable of measuring the ranges of pressures

or partial vacuums to the tolerances given in 5.6. They may consist of electronic pressure transducers, or any other device capable of measuring pressures, or partial vacuums to the stated tolerances. If separate devices are used to measure the chamber pressure and back pressure, the devices must be normalized simultaneously and against the same pressure source. Since the chamber and back pressure are the pressures taken at the midheight of the specimen, it may be necessary to adjust the zero-offset of the devices to reflect the hydraulic head of fluids in the chamber and back pressure control systems.

5.8 Volume Change Measurement Device—The volume of water entering or leaving the specimen shall be measured with an accuracy of within ± 0.05 % of the total volume of the specimen. The volume-measuring device is usually a burette connected to the back pressure but may be any other device meeting the accuracy requirement. The device must be able to withstand the maximum back pressure and of sufficient capacity for the performance of the test. Volume changes during shear are often on the order of ± 20 % or more of the specimen volume. Either allowing for resetting of the system during shear or having a total capacity capable of measuring the entire change may meet the required capacity.

5.9 Deformation Indicator—The vertical deformation of the specimen is usually determined from the travel of the piston acting on the top of the specimen. The piston travel shall be measured with an accuracy of at least 0.25 % of the initial specimen height. The deformation indicator shall have a range of at least 20 % of the initial height of the specimen and may be a dial indicator, linear variable differential transformer (LVDT), extensometer, or other measuring device meeting the requirements for accuracy and range.

5.10 Specimen Cap and Base—The specimen cap and base shall be designed to provide drainage from both ends of the

specimen. They shall be constructed of a rigid, noncorrosive, impermeable material, and each shall, except for the drainage provision, have a circular plane surface of contact with the porous disks and a circular cross section. It is desirable for the mass of the specimen cap and top porous disk to be as minimal as possible. However, the mass may be as much as 10 % of the axial load at failure. If the mass is greater than 0.5 % of the applied axial load at failure and greater than 50 g (0.1 lb), the axial load must be corrected for the mass of the specimen cap and top porous disk. The diameter of the cap and base shall be equal to the initial diameter of the specimen. The specimen base shall be connected to the triaxial compression chamber to prevent lateral motion or tilting, and the specimen cap shall be designed such that eccentricity of the piston-to-cap contact relative to the vertical axis of the specimen does not exceed 1.3 mm (0.05 in.). The end of the piston and specimen cap contact area shall be designed so that tilting of the specimen cap during the test is minimal. The cylindrical surface of the specimen base and cap that contacts the membrane to form a seal shall be smooth and free of scratches.

5.11 Porous Disks—A rigid porous disk shall be used to provide drainage at each end of the specimen. The coefficient of permeability of the disks shall be at most equal to that of fine sand (1×10^{-4} cm/s (4×10^{-5} in./s)). The disks shall be regularly cleaned by ultrasonic or boiling and brushing and checked to determine whether they have become clogged.

5.12 Filter-Paper Strips and Disk—Filter-paper strips are used by many laboratories to decrease the time required for testing. Filter-paper disks of a diameter equal to that of the specimen may be placed between the porous disks and specimen to avoid clogging of the porous disks. If filter strips or disks are used, they shall be of a type that does not dissolve in water. The coefficient of permeability of the filter paper shall not be less than 1×10^{-5} cm/s (4×10^{-6} in./s) for a normal pressure of 550 kPa (80 lbf/in.²). To avoid hoop tension, filter strips should cover no more than 50 % of the specimen periphery. Many laboratories have successfully used filter strip cages. An equation for correcting the principal stress difference (deviator stress) for the effect of the strength of vertical filter strips is given in **10.3.3.1**.

NOTE 6—Grade No. 54 Filter Paper has been found to meet the permeability and durability requirements.

5.13 Rubber Membrane—The rubber membrane used to encase the specimen shall provide reliable protection against leakage. Membranes shall be carefully inspected prior to use and if any flaws or pinholes are evident, the membrane shall be discarded. To offer minimum restraint to the specimen, the unstretched membrane diameter shall be between 90 and 95 % of that of the specimen. The membrane thickness shall not exceed 1 % of the diameter of the specimen. The membrane shall be sealed to the specimen cap and base with rubber O-rings for which the unstressed inside diameter is between 75 and 85 % of the diameter of the cap and base, or by other means that will provide a positive seal. An equation for correcting the principal stress difference (deviator stress) for the effect of the stiffness of the membrane is given in **10.3.3.2**.

5.14 Valves—Changes in volume due to opening and closing valves may result in inaccurate volume change and pore-water

pressure measurements. For this reason, valves in the specimen drainage system shall be of the type that produces minimum volume changes due to their operation. A valve may be assumed to produce minimum volume change if opening or closing the valve in a closed, saturated pore-water pressure system does not induce a pressure change of greater than 0.7 kPa (± 0.1 lbf/in.²). All valves must be capable of withstanding applied pressures without leakage.

NOTE 7—Ball valves have been found to provide minimum volume-change characteristics; however, any other type of valve having suitable volume-change characteristics may be used.

5.15 Specimen-Size Measurement Devices—Devices used to determine the height and diameter of the specimen shall measure the respective dimensions to four significant digits and shall be constructed such that their use will not disturb/deform the specimen.

NOTE 8—Circumferential measuring tapes are recommended over calipers for measuring the diameter.

5.16 Data Acquisition—Specimen behavior may be recorded manually or by electronic digital or analog recorders. If electronic data acquisition is used, it shall be necessary to calibrate the measuring devices through the recording device using known input standards.

5.17 Timer—A timing device indicating the elapsed testing time to the nearest 1 s shall be used to obtain consolidation data (**8.3.3**).

5.18 Balance—A balance or scale conforming to the requirements of Specification **D4753** readable to four significant digits.

5.19 Water Deaeration Device—The amount of dissolved gas (air) in the water used to saturate the specimen shall be decreased by boiling, by heating and spraying into a vacuum, or by any other method that will satisfy the requirement for saturating the specimen within the limits imposed by the available maximum back pressure and time to perform the test.

5.20 Testing Environment—The consolidation and shear portion of the test shall be performed in an environment where temperature fluctuations are less than ± 4 °C (± 7.2 °F) and there is no direct exposure with sunlight.

5.21 Miscellaneous Apparatus—Specimen trimming and carving tools including a wire saw, steel straightedge, miter box, vertical trimming lathe, apparatus for preparing reconstituted specimens, membrane and O-ring expander, water content cans, and data sheets shall be provided as required.

6. Test Specimen Preparation

6.1 Specimen Size—Specimens shall be cylindrical and have a minimum diameter of 33 mm (1.3 in.). The average-height-to-average-diameter ratio shall be between 2 and 2.5. An individual measurement of height or diameter shall not vary from average by more than 2 %. The largest particle size shall be smaller than $\frac{1}{6}$ the specimen diameter. If, after completion of a test, it is found based on visual observation that oversize particles are present, indicate this information in the report of test data (**11.1.4**).

NOTE 9—If oversize particles are found in the specimen after testing, a particle-size analysis may be performed on the tested specimen in

accordance with Test Method **D422** to confirm the visual observation and the results provided with the test report (11.1.4).

6.2 Intact Specimens—Prepare intact specimens from large intact samples or from samples secured in accordance with Practice **D1587** or other acceptable intact tube sampling procedures. Samples shall be preserved and transported in accordance with the practices for Group C samples in Practices **D4220**. Specimens obtained by tube sampling may be tested without trimming except for cutting the end surfaces plane and perpendicular to the longitudinal axis of the specimen, provided soil characteristics are such that no significant disturbance results from sampling. Handle specimens carefully to minimize disturbance, changes in cross section, or change in water content. If compression or any type of noticeable disturbance would be caused by the extrusion device, split the sample tube lengthwise or cut the tube in suitable sections to facilitate removal of the specimen with minimum disturbance. Prepare trimmed specimens, in an environment such as a controlled high-humidity room where soil water content change is minimized. Where removal of pebbles or crumbling resulting from trimming causes voids on the surface of the specimen, carefully fill the voids with remolded soil obtained from the trimmings. If the sample can be trimmed with minimal disturbance, a vertical trimming lathe may be used to reduce the specimen to the required diameter. After obtaining the required diameter, place the specimen in a miter box, and cut the specimen to the final height with a wire saw or other suitable device. Trim the surfaces with the steel straightedge. Perform one or more water content determinations on material trimmed from the specimen in accordance with Test Method **D2216**. Determine the mass and dimensions of the specimen using the devices described in **5.16** and **5.20**. A minimum of three height measurements (120° apart) and at least three diameter measurements at the quarter points of the height shall be made to determine the average height and diameter of the specimen.

6.3 Reconstituted Specimens—Reconstituted specimens shall be prepared at the conditions specified for the test. Soil required for Reconstituted specimens shall be thoroughly mixed with sufficient water to produce the desired water content. If water is added to the soil, store the material in a covered container for at least 16 h prior to compaction. Reconstituted specimens may be prepared by compacting material in at least six layers using a split mold of circular cross section having dimensions meeting the requirements enumerated in **6.1**. Specimens may be compacted to the desired density by either: (1) kneading or tamping each layer until the accumulative mass of the soil placed in the mold is compacted to a known volume; or (2) by adjusting the number of layers, the number of tamps per layer, and the force per tamp. The top of each layer shall be scarified prior to the addition of material for the next layer. The tamper used to compact the material shall have a diameter equal to or less than $\frac{1}{2}$ the diameter of the mold. After a specimen is formed, with the ends perpendicular to the longitudinal axis, remove the mold and determine the mass and dimensions of the specimen using the devices described in **5.14** and **5.17**. A minimum of three height measurements (120° apart) and at least three diameter mea-

surements at the quarter points of the height shall be made to determine the average height and diameter of the specimen. Perform one or more water content determinations on excess material used to prepare the specimen in accordance with Test Method **D2216**.

NOTE 10—It is common for the density or unit weight of the specimen after removal from the mold to be less than the value based on the volume of the mold. This occurs as a result of the specimen swelling after removal of the lateral confinement due to the mold.

6.4 Reconstituted Specimens—Prepare reconstituted specimens in the manner specified by the requesting agency. Common methods include:

6.4.1 Pluviation Through Water Method—For this specimen preparation method, a granular soil is saturated initially in a container, poured through water into a water-filled membrane placed on a forming mold, and then densified to the required density by vibration; refer to reference by Chaney and Mullis.³

NOTE 11—A specimen may be vibrated either on the side of the mold or the base of the cell using a variety of apparatus. These include the following: tapping with an implement of some type such as a spoon or metal rod, pneumatic vibrator, or electric engraving tool.

6.4.2 Dry Screening Method—For this method a tube with a screen attached to one end is placed inside a membrane stretched over a forming mold. A dry uniform sand is then poured into the tube. The tube is then slowly withdrawn from this membrane/mold allowing the sand to pass through the screen forming a specimen. If a greater density of the sand is desired the mold may be vibrated.

6.4.3 Dry or Moist Vibration Method—In this procedure compact oven-dried, or moist granular material in layers (typically six to seven layers) in a membrane-lined split mold attached to the bottom platen of the triaxial cell. Compact the weighed material for each lift by vibration to the dry unit weight required to obtain the prescribed density. Scarify the soil surface between lifts. It should be noted that to obtain uniform density, the bottom layers have to be slightly under compacted, since compaction of each succeeding layer increases the density of sand in layers below it. After the final layer is partially compacted, put the top cap in place and continue vibration until the desired dry unit weight is obtained.

6.4.4 Tamping Method—For this procedure tamp air dry or moist granular or cohesive soil in layers into a mold. The only difference between the tamping method and the vibration method is that each layer is compacted by hand tamping with a compaction foot instead of with a vibrator, refer to reference by Ladd, R.S.⁴

6.4.5 After the specimen has been formed, place the specimen cap in place and seal the specimen with O-rings or rubber bands after placing the membrane ends over the cap and base. Then apply a partial vacuum of 35 kPa (5 lbf/in.²) to the specimen and remove the forming jacket. If the test confining-pressure is greater than 103 kPa (14.7 lbf/in.²), a full vacuum may be applied to the specimen in stages prior to removing the jacket.

³ Chaney, R., and Mullis, J., "Wet Sample Preparation Techniques," *Geotechnical Testing Journal*, ASTM, 1978, pp. 107-108.

⁴ Ladd, R.S., "Preparing Test Specimens Using Under-Compaction," *Geotechnical Testing Journal*, ASTM, Vol. 1, No. 1, March, 1978, pp. 16-23.

7. Mounting Specimen

7.1 *Preparations*—Before mounting the specimen in the triaxial chamber, make the following preparations:

7.1.1 Inspect the rubber membrane for flaws, pinholes, and leaks.

7.1.2 Place the membrane on the membrane expander or, if it is to be rolled onto the specimen, roll the membrane on the cap or base.

7.1.3 Check that the porous disks and specimen drainage tubes are not obstructed by passing air or water through the appropriate lines.

7.1.4 Attach the pressure-control and volume-measurement system and a pore-pressure measurement device to the chamber base.

7.2 Depending on whether the saturation portion of the test will be initiated with either a wet or dry drainage system, mount the specimen using the appropriate method, as follows in either 7.2.1 or 7.2.2. The dry mounting method is strongly recommended for specimens with initial saturation less than 90 %. The dry mounting method removes air prior to adding backpressure and lowers the backpressure needed to attain an adequate percent saturation.

NOTE 12—It is recommended that the dry mounting method be used for specimens of soils that swell appreciably when in contact with water. If the wet mounting method is used for such soils, it will be necessary to obtain the specimen dimensions after the specimen has been mounted. In such cases, it will be necessary to determine the double thickness of the membrane, the double thickness of the wet filter paper strips (if used), and the combined height of the cap, base, and porous disks (including the thickness of filter disks if they are used) so that the appropriate values may be subtracted from the measurements.

7.2.1 *Wet Mounting Method:*

7.2.1.1 Fill the specimen drainage lines and the pore-water pressure measurement device with deaired water.

7.2.1.2 Saturate the porous disks by boiling them in water for at least 10 min and allow to cool to room temperature.

7.2.1.3 Place a saturated porous disk on the specimen base and after wiping away all free water on the disk, place the specimen on the disk. Next, place another porous disk and the specimen cap on top of the specimen. Check that the specimen cap, specimen, and porous disks are centered on the specimen base.

NOTE 13—If filter-paper disks are to be placed between the porous disks and specimen, they should be dipped in water prior to placement.

7.2.1.4 If filter-paper strips or a filter-paper cage are to be used, saturate the paper with water prior to placing it on the specimen. To avoid hoop tension, do not cover more than 50 % of the specimen periphery with vertical strips of filter paper. The filter paper should extend to porous disks on top and bottom of sample.

7.2.1.5 Proceed with 7.3.

7.2.2 *Dry Mounting Method:*

7.2.2.1 Dry the specimen drainage system. This may be accomplished by allowing dry air to flow through the system prior to mounting the specimen.

7.2.2.2 Dry the porous disks in an oven and then place the disks in a desiccator to cool to room temperature prior to mounting the specimen.

7.2.2.3 Place a dry porous disk on the specimen base and place the specimen on the disk. Next, place a dry porous disk and the specimen cap on the specimen. Check that the specimen cap, porous disks, and specimen are centered on the specimen base.

NOTE 14—If desired, dry filter-paper disks may be placed between the porous disks and specimen.

7.2.2.4 If filter-paper strips or a filter paper cage are to be used, the cage or strips may be held in place by small pieces of tape at the top and bottom.

7.3 Place the rubber membrane around the specimen and seal it at the cap and base with two rubber O-rings or other positive seal at each end. A thin coating of silicon grease on the vertical surfaces of the cap and base will aid in sealing the membrane. If filter-paper strips or a filter-paper cage are used, do not apply grease to surfaces in contact with the filter paper.

7.4 Attach the top drainage line and check the alignment of the specimen and the specimen cap. If the dry mounting method has been used, apply a partial vacuum of approximately 35 kPa (5 lbf/in.²) (not to exceed the consolidation stress) to the specimen through the top drainage line prior to checking the alignment. If there is any eccentricity, release the partial vacuum, realign the specimen and cap, and then reapply the partial vacuum. If the wet mounting method has been used, the alignment of the specimen and the specimen cap may be checked and adjusted without the use of a partial vacuum.

8. Procedure

8.1 *Prior to Saturation*—After assembling the triaxial chamber, perform the following operations:

8.1.1 Bring the axial load piston into contact with the specimen cap several times to permit proper seating and alignment of the piston with the cap. During this procedure, take care not to apply an axial load to the specimen exceeding 0.5 % of the estimated axial load at failure. When the piston is brought into contact, record the reading of the deformation indicator.

8.1.2 Fill the chamber with the chamber liquid, being careful to avoid trapping air or leaving an air space in the chamber.

8.2 *Saturation*—The objective of the saturation phase of the test is to fill all voids in the specimen with water without undesirable prestressing of the specimen, allowing the specimen to swell, or causing migration of fines. Saturation is usually accomplished by applying back pressure to the specimen pore water to drive air into solution after saturating the system by either: (1) applying vacuum to the specimen and dry drainage system (lines, porous disks, pore-pressure device, filter-strips or cage, and disks) and then allowing deaired water to flow through the system and specimen while maintaining the vacuum; or (2) saturating the drainage system by boiling the porous disks in water and allowing water to flow through the system prior to mounting the specimen. It should be noted that placing the air into solution is a function of both time and pressure. Accordingly, removing as much air as possible prior to applying back pressure will decrease the amount of air that will have to be placed into solution and will also decrease the

back pressure required for saturation. In addition, air remaining in the specimen and drainage system just prior to applying back pressure will go into solution much more readily if deaired water is used for saturation. The use of deaired water will also decrease the time and backpressure required for saturation. Many procedures have been developed to accomplish saturation. The following are suggested procedures:

8.2.1 Starting with Initially Dry Drainage System—Increase from partial vacuum acting on top of the specimen to the maximum available vacuum. If the final effective consolidation stress is less than the maximum partial vacuum, apply a lower vacuum to the chamber. The difference between the partial vacuum applied to the specimen and the chamber should never exceed the effective consolidation stress for the test and should not be less than 35 kPa (5 lbf/in.²) to allow for flow through the sample. After approximately 10 min, allow deaired water to slowly percolate from the bottom to the top of the specimen (Note 15).

8.2.1.1 There should always be a positive effective stress of at least 13 kPa (2 lbf/in.²) at the bottom of the specimen during this part of the procedure. When water appears in the burette connected to the top of the specimen, close the valve to the bottom of the specimen and fill the burette with deaired water. Next, reduce the vacuum acting on top of the specimen through the burette to atmospheric pressure while simultaneously increasing the chamber pressure by an equal amount. This process should be performed slowly such that the difference between the pore pressure measured at the bottom of the specimen and the pressure at the top of the specimen should be allowed to equalize. When the pore pressure at the bottom of the specimen stabilizes, proceed with back pressuring of the specimen pore-water as described in 8.2.3. To check for equalization, close the drainage valves to the specimen and measure the pore pressure change until stable for at least 2 min. If the change is less than 5 % of the effective stress, the pore pressure can be assumed to be stabilized.

NOTE 15—For saturated clays, percolation may not be necessary and water can be added simultaneously at both top and bottom.

8.2.2 Starting with Initially Saturated Drainage System—After filling the burette connected to the top of the specimen with deaired water, apply a chamber pressure of 35 kPa (5 lbf/in.²) or less and open the specimen drainage valves. When the pore pressure at the bottom of the specimen stabilizes, according to the method described in 8.2.1.1, or when the burette reading stabilizes, back pressuring of the specimen pore-water may be initiated.

8.2.3 Applying Back Pressure—Simultaneously increase the chamber and back pressure in steps with specimen drainage valves opened so that deaired water from the burette connected to the top and bottom of the specimen may flow into the specimen. To avoid undesirable prestressing of the specimen while applying back pressure, the pressures must be applied incrementally with adequate time between increments to permit equalization of pore-water pressure throughout the specimen. The size of each increment may range from 35 kPa (5 lbf/in.²). A minimum of three height measurements (120° apart) and at least three diameter measurements at the quarter points of the height shall be made to determine the average

height and diameter of the specimen up to 140 kPa (20 lbf/in.²), depending on the magnitude of the desired effective consolidation stress, and the percent saturation of the specimen just prior to the addition of the increment. The difference between the chamber pressure and the backpressure during back pressuring should not exceed 35 kPa (5 lbf/in.²) unless it is deemed necessary to control swelling of the specimen during the procedure. The difference between the chamber and back pressure must also remain within ±5 % when the pressures are raised and within ±2 % when the pressures are constant. To check for equalization after application of a backpressure increment or after the full value of backpressure has been applied, close the specimen drainage valves and measure the change in pore-pressure over a 1-min interval. If the change in pore pressure is less than 5 % of the difference between the chamber pressure and the back pressure, another back pressure increment may be added or a measurement may be taken of the pore pressure Parameter *B* (see 8.2.4) to determine if saturation is completed. Specimens shall be considered to be saturated if the value of *B* is equal to or greater than 0.95, or if *B* remains unchanged with addition of backpressure increments. The *B* Parameter could also be check following consolidation stage.

NOTE 16—Although the pore pressure Parameter *B* is used to determine adequate saturation, the *B*-value is also a function of soil stiffness. If the saturation of the sample is 100 %, the *B*-value measurement will decrease with increasing soil stiffness. Therefore, when testing soft soil samples, a *B*-value of 95 % may indicate a saturation approaching 100 %.

NOTE 17—The back pressure required to saturate a specimen may be higher for the wet mounting method than for the dry mounting method because of the added difficulty of flushing out the air before back-pressure saturation and may be as high as 1400 kPa (200 lbf/in.²).

8.2.4 Measurement of the Pore Pressure Parameter *B*—Determine the value of the pore pressure Parameter *B* in accordance with 8.2.4.1 – 8.2.4.4. The pore pressure Parameter *B* is defined by the following equation:

$$B = \frac{\Delta u}{\Delta \sigma_3} \quad (1)$$

where:

Δu = change in the specimen pore pressure that occurs as a result of a change in the chamber pressure when the specimen drainage valves are closed, and

$\Delta \sigma_3$ = isotropic change in the chamber pressure.

8.2.4.1 Close the specimen drainage valves, record the pore pressure, and increase the chamber pressure. Commonly, an increase of 70 kPa (10 lbf/in.²) is used.

8.2.4.2 After approximately 2 min, determine and record the maximum value of the induced pore pressure. For many specimens, the pore pressure may decrease after the immediate response and then increase slightly with time. If this occurs, values of Δu should be plotted with time and the asymptotic pore pressure used as the change in pore pressure. A large increase in Δu with time or values of Δu greater than $\Delta \sigma_3$ indicate a leak of chamber fluid into the specimen. Decreasing values of Δu with time may indicate a leak in that part of the pore pressure measurement system located outside of the chamber.

8.2.4.3 Calculate the *B*-value using Eq 1.

8.2.4.4 Reapply the same effective consolidation stress as existed prior to the B -value by reducing the chamber pressure or by, alternatively, increasing the back pressure by the amount of the chamber pressure increase. If B is continuing to increase with increasing back pressure, continue with back pressure saturation. If B is equal to or greater than 0.95 or if a plot of B versus back pressure indicates no further increase in B with increasing back pressure, initiate consolidation.

8.3 *Consolidation*—The objective of the consolidation phase of the test is to allow the specimen to reach equilibrium in a drained state at the effective consolidation stress for which a strength determination is required. During consolidation, data is obtained for use in determining when consolidation is complete and for computing a rate of strain to be used for the shear portion of the test. The consolidation procedure is as follows:

8.3.1 When the saturation phase of the test is completed, bring the axial load piston into contact with the specimen cap, and record the reading on the deformation indicator. During this procedure, take care not to apply an axial load to the specimen exceeding 0.5 % of the estimated axial load at failure. If continuous deformation monitoring is not being used, after recording the reading, raise the piston a small distance above the specimen cap, and lock the piston in place.

8.3.2 With the specimen drainage valves closed, hold the maximum back pressure constant and increase the chamber pressure until the difference between the chamber pressure and the back pressure equals the desired effective consolidation pressure. Consolidation to the final stress conditions may be performed. If continuous deformation monitoring is being used, loads must be applied to the piston to keep it in contact with the specimen cap.

8.3.3 Obtain an initial reading on the volume change device, and then open appropriate drainage valves so that the specimen may drain from both ends into the volume change device. At increasing intervals of elapsed time (0.1, 0.2, 0.5, 1, 2, 4, 8, 15, and 30 min and at 1, 2, 4, and 8 h, and so forth) observe and record the volume change readings, and, if not already doing so, after the 15-min reading, record the accompanying deformation indicator readings obtained by carefully bringing the piston in contact with the specimen cap. If volume change and deformation indicator readings are to be plotted against the square root of time, the time intervals at which readings are taken may be adjusted to those that have easily obtained square roots, for example, 0.09, 0.25, 0.49, 1, 4, and 9 min, and so forth. Depending on soil type, time intervals may be changed to convenient time intervals that allow for adequate definition of volume change versus time.

NOTE 18—In cases where significant amounts of fines may be washed from the specimen because of high initial hydraulic gradients, it is permissible to gradually increase the chamber pressure to the total desired pressure over a period with the drainage valves open. If this is done, recording of data should begin immediately after the total pressure is reached.

8.3.4 Plot the volume change and deformation indicator readings versus either the logarithm or square root of elapsed time. Allow consolidation to continue for at least one log cycle of time or one overnight period after 100 % primary consoli-

dation has been achieved as determined in accordance with one of the procedures outlined in Test Method **D2435**. A marked deviation between the slopes of the volume change and deformation indicator curves toward the end of consolidation based on deformation indicator readings indicates leakage of fluid from the chamber into the specimen, and the test should be terminated. The plot can be used to also determine t_{50} or t_{90} .

8.4 *Shear*—During shear, the chamber pressure shall be kept constant while advancing the axial load piston downward against the specimen cap using controlled axial deformation as the loading criterion. Specimen drainage is permitted during shear, and volume changes will be read from the burette. Failure is reached slowly so that excess pore pressure is dissipated under drained conditions.

8.4.1 *Prior to Axial Loading*—Before initiating shear, perform the following:

8.4.1.1 Place the chamber in position in the axial loading device. Be careful to align the axial loading device, the axial load measuring device, and the triaxial chamber to prevent the application of a lateral force to the piston during shear.

8.4.1.2 Bring the axial load piston into contact with the specimen cap to permit proper seating and realignment of the piston with the cap. During this procedure, care should be taken not to apply an axial load to the specimen exceeding 0.5 % of the estimated axial load at failure. If the axial load-measuring device is located outside of the triaxial chamber, the chamber pressure will produce an upward force on the piston that will react against the axial loading device. In this case, start shear with the piston slightly above the specimen cap, and before the piston comes into contact with the specimen cap, either (1) measure and record the initial piston friction and upward thrust of the piston produced by the chamber pressure and later correct the measured axial load, or (2) adjust the axial load-measuring device to compensate for the friction and thrust. The value of the axial-load measuring device reading should not exceed 0.1 % of the estimated failure load when the piston is moving downward prior to contacting the specimen cap. If the axial load-measuring device is located inside the chamber, it will not be necessary to correct or compensate for the uplift force acting on the axial loading device or for piston friction. However, if an internal load-measuring device of significant flexibility is used in combination with an external deformation indicator, correction of the deformation readings may be necessary. In both cases, record the initial reading on the pore-water pressure measurement device immediately prior to when the piston contacts the specimen cap and the reading on the deformation indicator when the piston contacts the specimen cap.

8.4.1.3 Check for pore pressure stabilization. Record the pore pressure. Close the drainage valves to the specimen, and measure the pore pressure change until stable. If the change is less than 5 % of the effective stress, the pore pressure is assumed to be stabilized. Reopen the drainage lines.

8.4.2 *Axial Loading*—Open the drainage valves before applying axial load to dissipate excess pore pressures throughout the specimen at failure. To determine loading rate which will allow pore pressure to dissipate. Assuming failure will occur

after 4 % axial strain, a suitable rate of strain, $\dot{\epsilon}$, may be determined from the following equations:

with side drain:

$$\dot{\epsilon} = \frac{4\%}{16t_{90}} \quad (2)$$

without side drain:

$$\dot{\epsilon} = \frac{4\%}{10t_{90}} \quad (3)$$

where:

t_{90} = time value obtained in 8.3.4.

If, however, it is estimated that failure will occur at a strain value other than 4 %, a suitable strain rate may be determined using Eq 3 by replacing 4 % with the estimated failure strain. This rate of strain will provide for the sample to build up minimal pore pressure during shear.

8.4.2.1 At a minimum, record load, deformation, and volume change values at increments of 0.1 % strain up to 1 % strain and, thereafter, at every 1 %. Take sufficient readings to define the stress-strain curve; hence, more frequent readings may be required in the early stages of the test and as failure is approached. Continue the loading to 15 % strain, except loading may be stopped when the principal stress difference (deviator stress) has dropped 20 % or when 5 % additional axial strain occurs after a peak in principal stress difference (deviator stress).

9. Removing Specimen

9.1 When shear is completed, perform the following:

9.1.1 Close the specimen drainage valves.

9.1.2 Remove the axial load and reduce the chamber and back pressures to zero.

9.1.3 With the specimen drainage valves remaining closed, quickly remove the specimen from the apparatus so that the specimen will not have time to absorb water from the porous disks.

9.1.4 Remove the rubber membrane (and the filter-paper strips or cage from the specimen if they were used), and determine the water content of the total specimen in accordance with the procedure in Test Method D2216. (Free water remaining on the specimen after removal of the membrane should be blotted away before obtaining the water content.) In cases where there is insufficient material from trimmings for index property tests, that is, where specimens have the same diameter as the sampling tube, the specimen should be weighed prior to removing material for index property tests and a representative portion of the specimen used to determine its final water content. Prior to placing the specimen (or portion thereof) in the oven to dry, sketch or photograph the specimen showing the mode of failure (shear plane, bulging, and so forth).

10. Calculation

10.1 *Initial Specimen Properties*—Using the dry mass of the total specimen, calculate and record the initial water content,

volume of solids, initial void ratio, initial percent saturation, and initial dry unit weight. Calculate the specimen volume from values measured in 6.2 or 6.3. Calculate the volume of solids by dividing the dry mass of the specimen by the specific gravity of the solids (Note 19) and dividing by the density of water. Calculate the void ratio by dividing the volume of voids by the volume of solids where the volume of voids is assumed to be the difference between the specimen volume and the volume of the solids. Calculate dry density by dividing the dry mass of the specimen by the specimen volume.

NOTE 19—The specific gravity of solids can be determined in accordance with Test Method D854 or it may be assumed based on previous test results.

10.2 *Specimen Properties After Consolidation*—Calculate the specimen height and area after consolidation as follows:

10.2.1 Height of specimen after consolidation, H_c , is determined from the following equation:

$$H_c = H_o - \Delta H_o \quad (4)$$

where:

H_o = initial height of specimen, and

ΔH_o = change in height of specimen at end of consolidation.

10.2.2 The cross-sectional area of the specimen after consolidation, A_c , shall be computed using one of the following methods. The choice of the method to be used depends on whether shear data are to be computed as the test is performed (in which case Method A would be used) or on which of the two methods, in the opinion of a qualified person, yield specimen conditions considered to be most representative of those after consolidation. Alternatively, the average of the two calculated areas may be appropriate.

10.2.2.1 *Method A:*

$$A_c = \frac{V_o - \Delta V_{sat} - \Delta V_c}{H_c} \quad (5)$$

where:

V_o = initial volume of specimen,

ΔV_c = change in volume of specimen during consolidation as indicated by burette readings, and

ΔV_{sat} = change in volume of specimen during saturation as follows: $3V_o [\Delta H_s/H_o]$.

where:

ΔH_s = change in height of the specimen during saturation.

10.2.2.2 *Method B:*

$$A_c = \frac{V_{wf} + V_s}{H_c} \quad (6)$$

where:

V_{wf} = final volume of water (based on final water content), and

V_s = volume of solids as follows: $w_s/(G_s \rho_w)$

where:

w_s = specimen dry mass,

G_s = specific gravity of solids, and

p_w = density of water.

10.2.3 Using the calculated dimensions of the specimen after consolidation and either an assumed or measured specific gravity of solids, calculate the consolidated void ratio and percent saturation.

NOTE 20—The specimen will absorb water from the porous disks and drainage lines during the time it is being removed from the apparatus. When this effect is significant, Method A will yield more reasonable values.

NOTE 21—In this test method, the equations are written such that compression and consolidation are considered positive.

10.3 Shear Data:

10.3.1 Calculate the axial strain, ϵ_1 , for a given applied axial load as follows:

$$\epsilon_1 = \frac{\Delta H}{H_c} \quad (7)$$

where:

ΔH = change in height of specimen during loading as determined from deformation indicator readings, and

H_c = height of specimen after consolidation.

10.3.2 Calculate the cross-sectional area, A , for a given applied axial load as follows:

$$A = \frac{V_c - \Delta V_\epsilon}{H_c - \Delta H_\epsilon} \quad (8)$$

where:

V_c = volume after consolidation,

ΔV_ϵ = change in volume from beginning of shear to any strain, and

ΔH_ϵ = change in height from beginning of shear to any strain.

NOTE 22—The cross-sectional area computed in this manner is based on the assumption that the specimen deforms as a right circular cylinder during shear. In cases where there is localized bulging, it may be possible to determine more accurate values for the area based on specimen dimension measurements obtained after shear.

10.3.3 Calculate the principal stress difference (deviator stress), $\sigma_1 - \sigma_3$, for a given applied axial load as follows:

$$\sigma_1 - \sigma_3 = \frac{P}{A} \quad (9)$$

where:

P = given applied axial load (corrected for uplift and piston friction if required as obtained in 8.4.1.3), and

A = corresponding cross-sectional area.

10.3.3.1 *Correction for Filter-Paper Strips*—For vertical filter-paper strips that extend over the total length of the specimen, apply a filter-paper strip correction to the computed values of the principal stress difference (deviator stress), if the error in principal stress difference (deviator stress) due to the strength of the filter-paper strips exceeds 5 %.

(I) For values of axial strain above 2 %, use the following equation to compute the correction:

$$\Delta(\sigma_1 - \sigma_3) = \frac{K_{fp} P_{fp}}{A_c} \quad (10)$$

where:

$\Delta(\sigma_1 - \sigma_3)$ = correction to be subtracted from the measured principal stress difference (deviator stress),

K_{fp} = load carried by filter-paper strips per unit length of perimeter covered by filter-paper,

P_{fp} = perimeter covered by filter-paper, and

A_c = cross-sectional area of specimen after consolidation.

For values of axial strain of 2 % or less, use the following equation to compute the correction:

$$\Delta(\sigma_1 - \sigma_3) = \frac{50\epsilon_1 K_{fp} P_{fp}}{A_c} \quad (11)$$

where:

ϵ_1 = axial strain (decimal form) and other terms are the same as those defined in subparagraph (1) of 10.3.3.1.

NOTE 23—For filter-paper generally used in triaxial testing, K_{fp} is approximately 0.19 kN/m (1.1 lbf/in.).

10.3.3.2 *Correction for Rubber Membrane*—Use the following equation to correct the principal stress difference (deviator stress) for the effect of the rubber membrane if the error in principal stress difference (deviator stress) due to the strength of the membrane exceeds 5 %:

$$\Delta(\sigma_1 - \sigma_3) = \frac{4E_m t_m \epsilon_1}{D_c} \quad (12)$$

where:

$\Delta(\sigma_1 - \sigma_3)$ = correction to be subtracted from the measured principal stress difference (deviator stress),

D_c = $\sqrt{4A_c/\pi}$ diameter of specimen after consolidation,

E_m = Young's modulus for the membrane material,

t_m = thickness of the membrane, and

ϵ_1 = axial strain (decimal form).

(I) The Young's modulus of the membrane material may be determined by hanging a 15-mm (0.5-in.) circumferential strip of membrane using a thin rod, placing another rod through the bottom of the hanging membrane, and measuring the force per unit strain obtained by stretching the membrane. The modulus value may be computed using the following equation:

$$E_m = \frac{\left(\frac{F}{A_m}\right)}{\left(\frac{\Delta L}{L}\right)} \quad (13)$$

where:

E_m = Young's modulus of the membrane material,

F = force applied to stretch the membrane,

L = unstretched length of the membrane,

ΔL = change in length of the membrane due to the force, F , and

A_m = area of the membrane = $2t_m W_s$

where:

t_m = thickness of the membrane, and

W_s = width of circumferential strip, 0.5 in. (15 mm).

NOTE 24—A typical value of E_m for latex membranes is 1400 kPa (200 lbf/in.).

NOTE 25—The corrections for filter-paper strips and membranes are

based on simplified assumptions concerning their behavior during shear. Their actual behavior is complex, and there is not a consensus on more exact corrections.

10.4 *Principal Stress Difference (Deviator Stress) and Change in Volume (ΔV) Versus Strain Curves*—Prepare graphs showing relationships between principal stress difference (deviator stress) and change in volume (ΔV) with axial strain, plotting deviator stress and ΔV as ordinates and axial strain as abscissa. Select the principal stress difference (deviator stress) and axial strain at failure in accordance with 3.2.3.

10.5 Determine the major and minor principal stresses at failure based on stresses, σ_{1f} and σ_{3f} respectively as follows:

$$\sigma_{3f} = \text{effective consolidation stress} \quad (14)$$

$$\sigma_{1f} = (\sigma_1 - \sigma_3) \text{ at failure} + \sigma_{3f} \quad (15)$$

10.6 *Mohr Stress Circles*—If desired, construct Mohr stress circles at failure based on axial and radial stresses on an arithmetic plot with shear stress as ordinate and normal stress as abscissa using the same scales. The circle based on total stresses is drawn with a radius of one half the principal stress difference (deviator stress) at failure with its center at a value equal to one half the sum of the major and minor principal stresses.

11. Report

11.1 Report the following information:

11.1.1 Identification data and visual description of specimen, including soil classification and whether the specimen is intact, compacted, or otherwise prepared,

11.1.2 Values of plastic limit and liquid limit, if determined in accordance with Test Method D4318,

11.1.3 Value of specific gravity of solids and notation if the value was determined in accordance with Test Method D854 or assumed,

11.1.4 Particle-size analysis, if determined in accordance with Test Method D422,

11.1.5 Initial specimen dry unit weight, void ratio, water content, and percent saturation, (specify if the water content specimen was obtained from cuttings or the entire specimen),

NOTE 26—The specific gravity determined in accordance with Test Method D854 is required for calculation of the saturation. An assumed specific gravity may be used provided it is noted in the test report that an assumed value was used.

11.1.6 Initial height and diameter of specimen,

11.1.7 Method followed for specimen saturation (that is, dry or wet method),

11.1.8 Total back pressure,

11.1.9 Effective consolidation stress,

11.1.10 Time to 100 % primary consolidation,

11.1.11 Specimen dry unit weight, void ratio, water content, and percent saturation after consolidation,

11.1.12 Specimen cross-sectional area after consolidation and method used for determination,

11.1.13 Failure criterion used,

11.1.14 The value of the principal stress difference (deviator stress) at failure and the values of the minor and major principal stresses at failure, (indicate when values have been corrected for effects due to membrane or filter strips, or both),

11.1.15 Axial strain at failure, percent,

11.1.16 Rate of strain, percent per minute,

11.1.17 Principal stress difference (deviator stress) and change in volume versus axial strain curves as described in 10.4,

11.1.18 Mohr stress circles based on axial and radial stresses, (optional),

11.1.19 Slope of angle of the failure surface (optional),

11.1.20 Failure sketch or photograph of the specimen, and

11.1.21 Remarks and notations regarding any unusual conditions such as slickensides, stratification, shells, pebbles, roots, and so forth, or other information necessary to properly interpret the results obtained, including any departures from the procedure outlined.

12. Precision and Bias

12.1 *Precision*—Test data on precision is not presented due to the nature of the soil materials tested by this procedure. It is either not feasible or too costly at this time to have ten or more laboratories participate in a round-robin testing program. Subcommittee D18.05 is seeking any data from users of this test method that might be used to make a limited statement on precision.

12.2 *Bias*—There is no accepted reference value for this test method, therefore, bias cannot be determined.

13. Keywords

13.1 back pressure saturation; consolidated drained strength; effective stresses; non-cohesive soil; strain-controlled loading; stress-strain relationships

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org). Permission rights to photocopy the standard may also be secured from the Copyright Clearance Center, 222 Rosewood Drive, Danvers, MA 01923, Tel: (978) 646-2600; http://www.copyright.com/