



Designation: E2261/E2261M – 17

Standard Practice for Examination of Welds Using the Alternating Current Field Measurement Technique¹

This standard is issued under the fixed designation E2261/E2261M; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

1. Scope*

1.1 This practice describes procedures to be followed during alternating current field measurement examination of welds for baseline and service-induced surface breaking discontinuities.

1.2 This practice is intended for use on welds in any metallic material.

1.3 This practice does not establish weld acceptance criteria.

1.4 *Units*—The values stated in either inch-pound units or SI units are to be regarded separately as standard. The values stated in each system might not be exact equivalents; therefore, each system shall be used independently of the other. Combining values from the two systems may result in nonconformance with the standard.

1.5 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

1.6 *This international standard was developed in accordance with internationally recognized principles on standardization established in the Decision on Principles for the Development of International Standards, Guides and Recommendations issued by the World Trade Organization Technical Barriers to Trade (TBT) Committee.*

2. Referenced Documents

2.1 *ASTM Standards:*²

[E543 Specification for Agencies Performing Nondestructive Testing](#)

[E1316 Terminology for Nondestructive Examinations](#)

2.2 *ASNT Standard:*³

[SNT-TC-1A Personnel Qualification and Certification in Nondestructive Testing](#)

[ANSI/ASNT-CP-189 Standard for Qualification and Certification of Nondestructive Testing Personnel](#)

2.3 *ISO Standard:*⁴

[ISO 9712 Nondestructive Testing—Qualification and Certification of Nondestructive Testing Personnel](#)

3. Terminology

3.1 *Definitions*—For definitions of terms relating to this practice refer to Terminology [E1316](#), Section A, Common NDT terms, and Section C, Electromagnetic testing. The following definitions are specific to the alternating current field measurement technique:

3.2 *Definitions:*

3.2.1 *exciter*—a device that generates a time varying electromagnetic field, usually a coil energized with alternating current (AC); also known as a transmitter.

3.2.2 *detector*—one or more coils or elements used to sense or measure a magnetic field; also known as a receiver.

3.2.3 *uniform field*—as applied to nondestructive testing with magnetic fields, the area of uniform magnetic field over the surface of the material under examination produced by a parallel induced alternating current, which has been passed through the weld and is observable beyond the direct coupling of the exciting coil.

3.2.4 *graduated field*—as applied to nondestructive testing with magnetic fields, a magnetic field having a controlled gradient in its intensity.

3.3 *Definitions of Terms Specific to This Standard:*

3.3.1 *alternating current field measurement system*—the electronic instrumentation, software, probes, and all associated components and cables required for performing weld examination using the alternating current field measurement technique.

³ Available from American National Standards Institute (ANSI), 25 W. 43rd St., 4th Floor, New York, NY 10036, <http://www.ansi.org>.

⁴ Available from International Organization for Standardization (ISO), ISO Central Secretariat, BIBC II, Chemin de Blandonnet 8, CP 401, 1214 Vernier, Geneva, Switzerland, <http://www.iso.org>.

¹ This practice is under the jurisdiction of ASTM Committee E07 on Nondestructive Testing and is the direct responsibility of Subcommittee E07.07 on Electromagnetic Method.

Current edition approved June 1, 2017. Published June 2017. Originally approved in 2003. Last previous edition approved in 2012 as E2261 - 12. DOI: 10.1520/E2261_E2261M-17.

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

*A Summary of Changes section appears at the end of this standard

3.3.2 *operational reference standard*—a reference standard with specified artificial slots, used to confirm the operation of the system.

3.3.3 *B_x*—the x component of the magnetic field, parallel to the weld toe, the magnitude of which is proportional to the current density set up by the electric field.

3.3.4 *B_z*—the z component of the magnetic field normal to the inspected base metal/heat affected zone surface, the magnitude of which is proportional to the lateral deflection of the induced currents in the plane of that surface.

3.3.5 *X-Y Plot*—an X-Y graph with two orthogonal components of magnetic field plotted against each other.

3.3.6 *time base plots*—these plot the relationship between B_x or B_z values with time.

3.3.7 *surface plot*—for use with array probes. This type of plot has one component of the magnetic field plotted over an area, typically as a color contour plot or 3-D wire frame plot.

3.3.8 *data sample rate*—the rate at which data is digitized for display and recording, in data points per second.

3.3.9 *configuration data*—standardization data and instrumentation settings for a particular probe stored in a computer file.

3.3.10 *twin fields*—magnetic fields generated in two orthogonal directions by use of two exciters

NOTE 1—Different equipment manufacturers may use slightly different terminology. Reference should be made to the equipment manufacturer's documentation for clarification.

4. Summary of Practice

4.1 In a basic alternating current field measurement system, a small probe is moved along the toe of a weld. The probe contains an exciter coil, which induces an AC magnetic field in the material surface aligned to the direction of the weld. This, in turn, causes alternating current to flow across the weld. The depth of penetration of this current varies with material type and frequency but is typically 0.004 in. [0.1 mm] deep in magnetic materials and 0.08 to 0.3 in. [2 to 7 mm] deep in non-ferrous materials. Any surface breaking discontinuities within a short distance of either side of the scan line at this location will interrupt or disturb the flow of the alternating current. The maximum distance from the scan line to a target discontinuity, potentially detectable at a specified probability of detection, is determined by the probe assembly size, but is typically 0.4 in [10 mm]. Measurement of the absolute quantities of the two major components of the surface magnetic fields (B_x and B_z) determines the severity of the disturbance (see Fig. 1) and thus the severity of the discontinuity. Discontinuity sizes, such as crack length and depth, can be estimated from key points selected from the B_x and B_z traces along with the standardization data and instrument settings from each individual probe. This discontinuity sizing can be performed automatically using system software. Discontinuities essentially perpendicular to the weld may be detected (in ferritic metals only) by the flux leakage effect. However confirmation of such transverse discontinuities (and detection of the same in

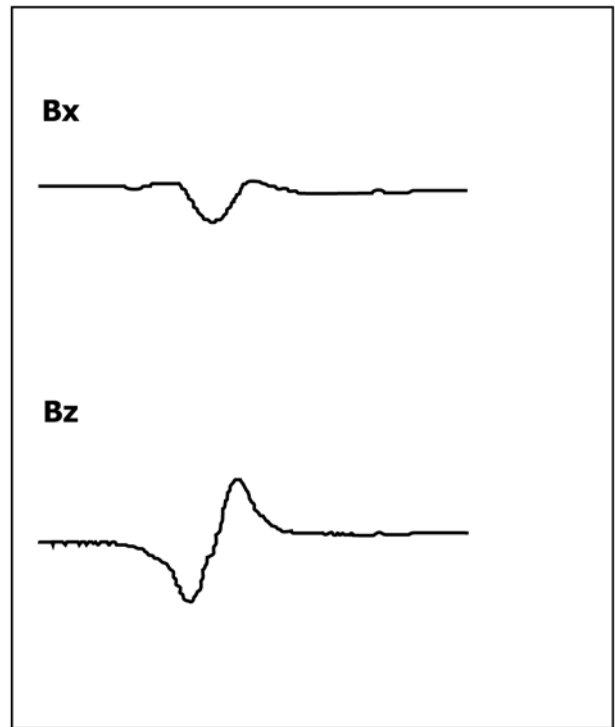


FIG. 1 Example B_x and B_z Traces as a Probe Passes Over a Crack
(The orientation of the traces may differ depending upon the instrumentation.)

non-ferritic metals) requires scans with the induced magnetic field perpendicular to the direction of the weld.

4.2 Configuration data is loaded at the start of the examination. System sensitivity and operation is verified using an operation reference standard. System operation is checked and recorded prior to and at regular intervals during the examination. Note that when a unidirectional input current is used, any decay in strength of the input field with probe lift-off or thin coating is relatively small so that variations of output signal (as may be associated with a discontinuity) are reduced. If a thick coating is present, then the discontinuity size estimation must compensate for the coating thickness. The coating thickness requiring compensation is probe dependent. This can be accomplished using discontinuity-sizing tables in the system software and an operator-entered coating thickness or automatically if the equipment measures the coating thickness or stand-off distance during the scanning process. Using the wrong coating thickness would have a negative effect on depth sizing accuracy if the coating thickness discrepancy is too large. Data is recorded in a manner that allows archiving and subsequent recall for each weld location. Evaluation of examination results may be conducted at the time of examination or at a later date. The examiner generates an examination report detailing complete results of the examination.

5. Significance and Use

5.1 The purpose of the alternating current field measurement method is to evaluate welds for surface breaking discontinuities such as fabrication and fatigue cracks. The examination results may then be used by qualified organizations to

assess weld service life or other engineering characteristics (beyond the scope of this practice). This practice is not intended for the examination of welds for non-surface breaking discontinuities.

6. Basis of Application

6.1 *Personnel Qualification:*

6.1.1 If specified in the contractual agreement, personnel performing examinations to this practice shall be qualified in accordance with a nationally or internationally recognized NDT personnel qualification practice or standard such as ANSI/ASNT-CP-189, SNT-TC-1A, ISO 9712, or a similar document and certified by the employer or certifying agent, as applicable. The practice or standard used and its applicable revision shall be identified in the contractual agreement between the using parties.

6.2 *Qualification of Nondestructive Evaluation Agencies*—if specified in the contractual agreement, NDT agencies shall be qualified and evaluated as described in Practice E543, with reference to sections on electromagnetic examination. The applicable edition of Practice E543 shall be specified in the contractual agreement.

7. Job Scope and Requirements

7.1 The following items may require agreement by the examining party and their client and should be specified in the purchase document or elsewhere:

7.1.1 Location and type of welded component to be examined, design specifications, degradation history, previous nondestructive examination results, maintenance history, process conditions, and specific types of discontinuities that are required to be detected, if known.

7.1.2 The maximum window of opportunity for work. (Detection of small discontinuities may require a slower probe scan speed, or cleaning of surface, or both, which will affect productivity.)

7.1.3 Size, material grade and type, and configuration of welds to be examined. If required by type of equipment chosen, thickness of coating and variation of coating thickness.

7.1.4 A weld numbering or identification system.

7.1.5 Extent of examination, for example: complete or partial coverage, which welds and to what length, whether straight sections only and the minimum surface curvature.

7.1.6 Means of access to welds, and areas where access may be restricted.

7.1.7 Type of alternating current field measurement instrument and probe; and description of operations reference standard used, including such details as dimensions and material.

7.1.8 Required operator qualifications and certification.

7.1.9 Required weld cleanliness.

7.1.10 Environmental conditions, equipment and preparations that are the responsibility of the client; common sources of noise that may interfere with the examination.

7.1.11 Complementary methods or techniques may be used to obtain additional information.

7.1.12 Acceptance criteria to be used in evaluating discontinuities.

7.1.13 Disposition of examination records and reference standards.

7.1.14 Format and outline contents of the examination report.

8. Interferences

8.1 This section describes items and conditions, which may compromise the alternating current field measurement technique.

8.2 *Material Properties:*

8.2.1 Although there are permeability differences in a ferromagnetic material between weld metal, heat affected zone and parent plate, the probe is normally scanned along a weld toe and so passes along a line of relatively constant permeability. If a probe is scanned across a weld then the permeability changes may produce indications, which could be similar to those from a discontinuity. Differentiation between a transverse discontinuity signal and the weld signal can be achieved by taking further scans parallel to the indication, or using an array probe. The signal from a discontinuity will die away quickly. If there is no significant change in indication amplitude at 0.8 in. [20 mm] distance from the weld then the indication is likely due to the permeability changes in the weld.

8.3 *Magnetic State:*

8.3.1 *Demagnetization*—It must be ensured that the surface being examined is in the non-magnetized state. Therefore the procedure followed with any previous magnetic technique deployed must include demagnetization of the surface. This is because areas of remnant magnetization, particularly where the leg of a magnetic particle examination yoke was sited, can produce loops in the X-Y plot, which may sometimes be confused with a discontinuity indication.

8.3.2 *Grinding marks*—magnetic permeability can also be affected by surface treatments such as grinding. These can cause localized areas of altered permeability across the line of scan direction. The extent and pressure of any grinding marks should always be reported by the probe operator, since these can give rise to strong indications in both Bx and Bz, which may be confused with a discontinuity indication. If a discontinuity is suspected in a region of grinding, further scans should be taken parallel but away from the weld toe and perpendicular across the region of grinding. The indication from a linear discontinuity will die away quickly away from the location of the discontinuity so that the scan away from the weld toe will be flatter. If there is no significant change in indication amplitude at 0.80 in. [20 mm] distance from the weld then the indication is likely due to the effect of the grinding. The indication from a region of grinding will be the same for the perpendicular scan.

8.4 Residual stress, with accompanying permeability variations, may be present with effects similar to those due to grinding, but are much smaller.

8.5 *Seam Welds:*

8.5.1 Seam welds running across the line of scanning also produce strong indications in the Bx and Bz, which can sometimes be confused, with a discontinuity indication. The same procedure is used as for grinding marks with further

scans being taken away from the affected area. If the indication remains constant then it will not have been produced by a linear discontinuity.

8.6 Ferromagnetic and Conductive Objects:

8.6.1 Problems may arise because of objects near the weld that are ferromagnetic or conductive which may reduce the sensitivity and accuracy of discontinuity characterization when they are in the immediate vicinity of the weld.

8.7 Neighboring Welds:

8.7.1 In areas where welds cross each other, there are indications, which may be mistaken for discontinuities. (See 8.5.)

8.8 Weld Geometry:

8.8.1 When a probe scans into a tight angle between two surfaces the Bx indication value will increase with little change in the Bz value. In the representative plot of Fig. 2, this appears as a rise in the X-Y plot. If the equipment is capable of measuring lift-off, the lift-off will also change.

8.9 Crack Geometry Effects:

8.9.1 *A discontinuity at an angle to the scan*—a discontinuity at an angle to the scan will reduce either the peak or the trough of the Bz as the sensor probe only passes through the edge of one end of the discontinuity. This produces an asymmetric X-Y plot. Additional scans may be made along the weld or parent plate to determine the position of the other end of the discontinuity.

8.9.2 *A discontinuity at an angle to the surface*—the effect of a discontinuity at a non-vertical angle to the probe is generally to reduce the value of the Bz signal. The value of the Bx signal will not be reduced. This has the effect of reducing the width of the X-Y plot in the representative plot of Fig. 2.

8.9.3 *Line contact or multiple discontinuities*—when contacts occur across a discontinuity then minor loops occur within the main X-Y plot loop produced by the discontinuity. If more than one discontinuity occurs in the scan then there will be a number of loops returning to the background.

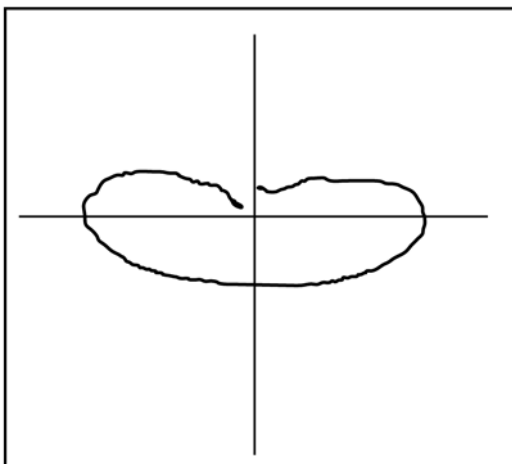


FIG. 2 Example X-Y Plot Produced by Plotting the Bx (vertical) and Bz (horizontal) Together
(The orientation of the plot may differ depending upon the instrumentation.)

8.9.4 *Transverse discontinuities*—if a transverse discontinuity occurs during the scan for longitudinal discontinuities then the Bx may rise instead of falling and the Bz signal will remain the same as for a short longitudinal discontinuity. The X-Y plot will then go upwards instead of down in the representative plot of Fig. 2. This flux leakage effect is, however, related to the opening of the discontinuity, so it may not be seen for tightly closed discontinuities. To confirm the presence of transverse discontinuities, further scans should be made with the probe orientated to give an induced field perpendicular to the weld, or through use of an array probe with twin fields.

8.9.5 *Alternating current field measurement end effect* - the field from the standard weld probe is able to propagate around the end of a weld and this can result in sloping changes in the Bx and Bz traces. A discontinuity indication may be obscured or distorted if the discontinuity or any active probe element is close to the weld end. The distance over which this effect occurs depends on probe type, but can be up to 2 in. [50 mm] for large probes. Smaller probes should be used in these situations as they have less susceptibility to edge effect.

8.10 Instrumentation:

8.10.1 The operator should be aware of indicators of noise⁵, saturation or signal distortion particular to the instrument being used. Special consideration should be given to the following concerns:

8.10.1.1 The excitation frequency of operation should be chosen to maximize discontinuity sensitivity whilst maintaining acceptable noise levels.

8.10.1.2 Saturation of electronic components is a potential problem in alternating current field measurement because signal amplitude can increase rapidly as a probe is scanned into tight angle geometry. This could cause the Bx indication to rise above the top of the range of the A/D converter in the instrument. Data acquired under saturation conditions is not acceptable and appears as a flattening of the Bx response in the representative plots of Fig. 1 at the maximum possible signal value. If saturation conditions are observed, the equipment gain should be reduced until the Bx value no longer appears to saturate and the inspection repeated. After adjusting the equipment gain, an equipment operation check as described in 11.2 is recommended, except that the loop size will be smaller. Note that this gain adjustment does not affect the discontinuity sizing capability.

8.10.2 *Instrument-induced Phase Offset*—The measurements of magnetic field are at a chosen and fixed phase so that unlike during conventional eddy current examination the phase angle does not need to be considered. The phase is selected at manufacture of the probes and is stored in the probe file and is automatically configured by the instrument.

8.11 Coating Thickness

8.11.1 If a coating thickness exceeds the specified range for uncompensated operation then the discontinuity size estimation must compensate for the coating thickness. This can be accomplished by manually entering a coating thickness and using discontinuity tables in the system software. Otherwise,

⁵ Nearby welding activities or cell phones may be a major source of interference.

using the wrong coating thickness would reduce the depth sizing accuracy. Alternatively, the compensation may be performed automatically if the equipment measures the stand-off distance or coating thickness during the scanning process.

9. Alternating Current Field Measurement System

9.1 Instrumentation

9.1.1 The electronic instrumentation shall be capable of energizing the exciter at one or more frequencies appropriate to the weld material. The apparatus shall be capable of measuring the B_x and B_z magnetic field amplitudes at each frequency. The instrument will be supplied with a processor, either internally, or in the form of a portable personal computer (PC), that has sufficient system capabilities to support the alternating current field measurement software, which will be suitable for the instrument and probes in use and the examination requirements. The software provides control of the instrumentation including set-up, data acquisition, data display, data analysis and data storage. The software provides algorithms for sizing the discontinuities (see 11.2.2). The software runs on the processor and, on start up, all communications between the processor and the instrument are automatically checked. When the software starts up it automatically sets up the instrument connected in the correct mode for alternating current field measurement examination. Configuration data for each probe is stored either on the processor or on the probe and is transmitted to the instrument whenever a probe is selected or changed. For non-magnetic materials, if configuration data is not available from the equipment manufacturer, a standardization may be performed on reference blocks prior to the material examination. Equipment operation is also checked by scanning over a reference standard (see 11.2.2). Once the instrumentation is set up for a particular probe, the software can be used to start and stop data acquisition. During data acquisition at least two presentations of the data are presented on the display screen in real time (see 4.1). Data from the probe is displayed against time (with Fig. 1 as an example) and also as an X-Y plot (with Fig. 2 as an example). The data from the probe can also be displayed against position (see Fig. 1) if an encoder is used with the probe. Depending upon equipment type, manual or automatic position markers may be incorporated with the data. Once collected the data can be further analyzed offline using the software to allow, for example, discontinuity sizing (see 11.2.2) or annotation for transfer to examination reports. The software also provides facilities for all data collected to be electronically stored for subsequent review or reanalysis, printing or archiving.

9.2 Driving Mechanism:

9.2.1 When a mechanized system is in operation, a mechanical means of scanning the probe, or probes in the form of an array, along a weld or surface area at approximately constant speed may be used.

9.3 Probes:

9.3.1 The probes selected should be appropriate for the form of examination to be carried out dependent on length of weld, geometry, size of detectable discontinuity and surface temperature.

9.3.1.1 *Standard weld probe*—commonly used for weld examination whenever possible as it has its coils positioned ideally for discontinuity sizing.

9.3.1.2 *Tight access probe*—designed specifically for occasions where the area under examination is not accessible with the standard weld probe. It is not as accurate as the weld probe for sizing in open geometries such as butt welds.

9.3.1.3 *Grind repair probe*—designed for the examination of deep repair grinds. It has the same basic geometry as a standard probe but is more susceptible to produce indications from vertical probe movement.

9.3.1.4 *Mini-probe*—designed for restricted access areas such as cut outs and cruciforms and has a reduced edge effect. It may be limited to shallow discontinuities only and is more sensitive to lift off. This probe may be in the form of a straight entry or 90°.

9.3.1.5 *Micro-probe*—designed for high-sensitivity discontinuity detection in restricted access areas and has the same limitations as a mini-probe. This probe may be in the form of a straight entry or 90°.

9.3.1.6 *Array probe*—made up of a number of elements; each element is sensitive to a discrete section of the weld width. The elements may be oriented with their axes aligned longitudinally or transversely with respect to the weld toe. The array probe may have two orthogonal field exciters to allow examination for longitudinal and transverse discontinuities in a single scan. The array probe is generally used either for scanning a weld cap in one pass or for covering a section of plate.

9.3.1.7 *Edge effect probe*—designed to reduce the edge effect when carrying out examination only near the ends of welds. (A mini probe may also be used for the same examination.)

9.4 Data Displays:

9.4.1 The data display should include B_x and B_z indications as well as an X-Y plot.

9.4.2 When multi-element array probes are being used, the facility to produce color contour maps or 3D-wire frame plots representing peaks and troughs should be available.

9.5 Excitation Mechanism:

9.5.1 The degree of uniformity of the magnetic field applied to the material under examination is determined by the equipment manufacturer. Representative magnetic field distributions are a uniform magnetic field and a graduated magnetic field. The geometry of the slots used in the operation reference standard and the discontinuity sizing model must be consistent with the excitation field.

10. Alternating Current Field Measurement Reference Standards

10.1 Artificial Slots for the Operation Reference Standard:

10.1.1 The operation reference standard has specific artificial discontinuities. It is used to check that the instrument and probe combination is functioning correctly. It may also be used for standardization of the equipment for nonmagnetic materials. Unless otherwise specified by the client or equipment manufacturer, the artificial discontinuities for the operation reference standard are elliptical or rectangular slots. The slot

geometry will be specified by the equipment manufacturer to be consistent with the crack size estimation model. Typical slot dimensions are as follows:

10.1.1.1 *Elliptical Slots*—Two elliptical slots placed in the weld toe with dimensions 2.0 in. × 0.2 in. [50mm × 5mm] and 0.8 in. × 0.08 in. [20 mm × 2 mm]. (Fig. 3, discontinuities A and B.)

10.1.1.2 *Rectangular Slots*—Three rectangular slots with depth 0.08 in. [2 mm] and lengths of 0.4 in. and 0.8 in. [10 mm and 20 mm] (Fig. 3, discontinuities C and D) and with depth 0.16 in. [4 mm] and length of 1.6 in. [40 mm] (Fig. 3, discontinuity E.)

10.1.2 These slots shall be less than 0.008 in. [0.2 mm] wide.

10.1.3 Artificial discontinuity depths are specified by giving the deepest point of the discontinuity. Discontinuity depths shall be accurate to within ±10% of the depth specified,

measured, and documented. The discontinuity length shall be accurate to within ±0.040 in. [±1.00 mm] of the dimension specified.

10.2 Reference standards having artificial or simulated discontinuities are not required for standardization when the technique is to be used to examine carbon steel welds or if configuration data is available for the examination material.

10.3 *Materials other than carbon steel:*

10.3.1 If the technique is to be used on materials other than carbon steel, then it may be necessary to standardize the probes on this material if configuration data is not available from the equipment manufacturer, refer to manufacturer’s instructions.

NOTE 2—If this is not done then the sizes of the indications may be too small (so that small discontinuities may be missed) or too large (so that spurious indications may be called), or the Bx indication may saturate making the examination invalid. This standardization is done using a slot

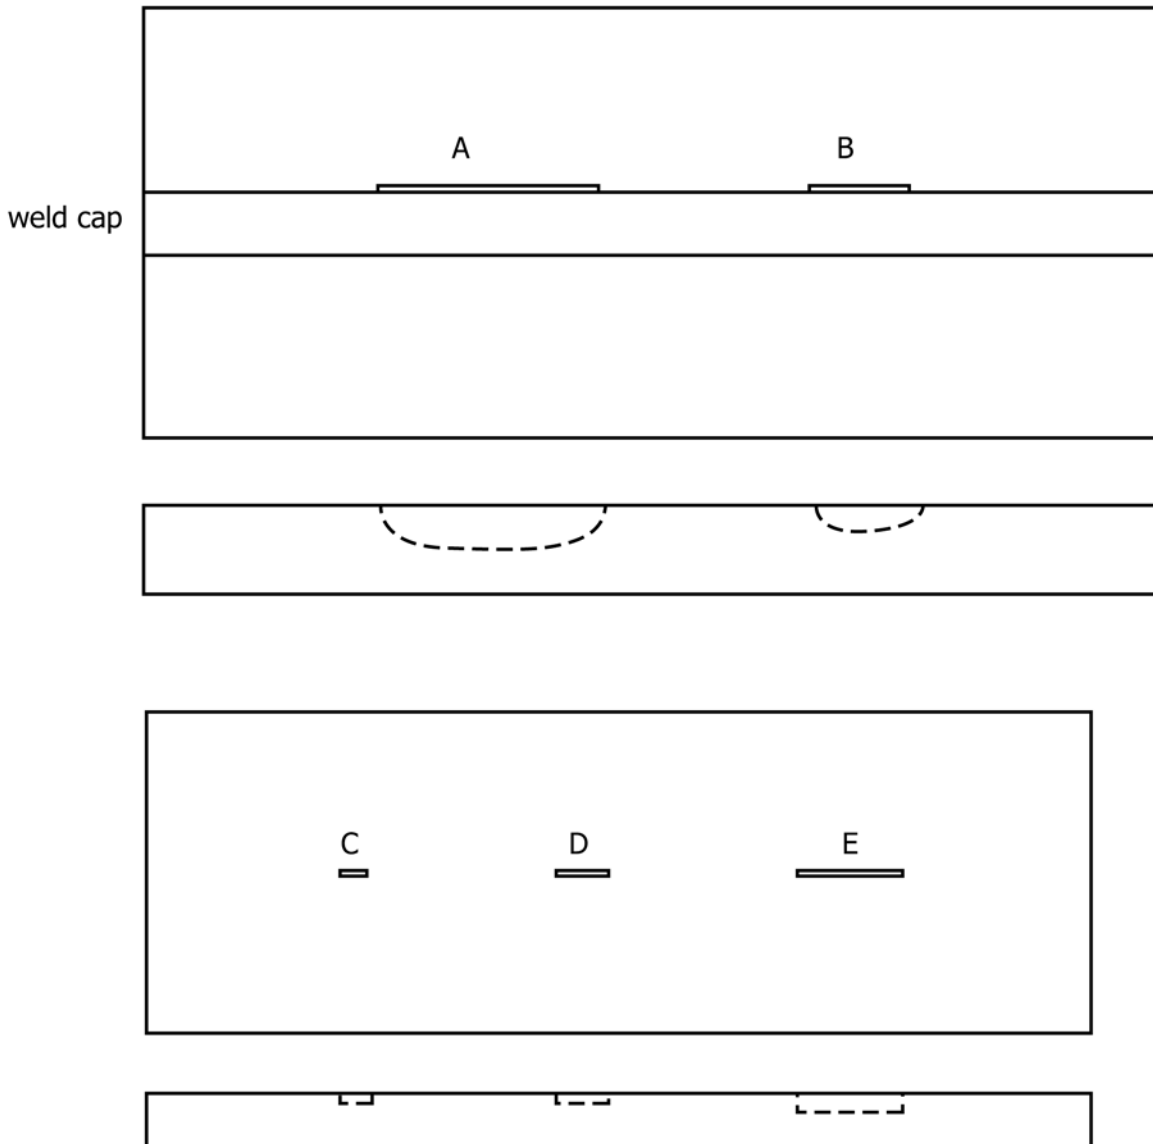


FIG. 3 Flat Plate Sample Serial Number XXX Showing Size and Location of Reference Slots (Plan View and Side View. Not to Scale)

of reasonable size located at a weld toe of a representative sample. The gain settings are altered, either automatically or manually according to equipment type, until a loop of reasonable size is produced in the X-Y plot while background noise indications are kept low. When the technique is to be used to size the depths of discontinuities detected in material for which configuration data is unavailable, then a reference standard should be manufactured from the material with at least two slots of differing depth. This provides an adjustment coefficient that modifies the estimated depth from the sizing model.

10.4 Reference standards having artificial or simulated discontinuities for welds in materials other than carbon steel shall not be used for discontinuity characterization unless the signals from the artificial discontinuities can be demonstrated to be similar to the signals for discontinuities detected. To be considered similar, a direct comparison should be performed between responses to the simulated discontinuities and real cracks. This comparison should involve at least one limited sizing trial or a probability of detection (POD) study.

10.5 *Manufacture and Care of the Operation Reference Standards:*

10.5.1 *Drawings*—for each operation reference standard and standard, there shall be a drawing that includes the as-built measured slot dimensions, material type and grade, and the serial number of the actual operation reference standard or weld standard.

10.5.2 *Serial Number*—each operation reference standard shall be identified with a unique serial number and stored so that it can be obtained and used for reference when required.

10.5.3 *Slot Spacing*—the slots should be positioned longitudinally to avoid overlapping of indications and interference from end effects.

10.5.4 Proper machining practices shall be used to avoid excessive cold-working, over-heating, and undue stress and permeability variations.

10.5.5 Blocks should be stored and shipped so as to prevent mechanical damage.

11. Equipment Operation Check

11.1 *Instrument Settings:*

11.1.1 *Operating Frequency*—using the appropriate operation reference standard the procedure in 11.2.2 below is intended to help the user select an operating frequency. Demonstrably equivalent methods may be used. The standard operating frequency depends upon the equipment to be used and typically is in the range of 5 to 50 kHz. A higher operating frequency will give better sensitivity on good surfaces. If the system available is not capable of operating at the frequency described by this practice, the inspector shall declare to the client that conditions of reduced sensitivity may exist.

11.1.2 *Standardization*—For non-magnetic materials where configuration data is not available, the equipment may need to be standardized. Standardization is performed by loading manufacturer supplied configuration data, performing standardization measurements, and saving the resulting data and instrument settings as user configuration data. The standardization measurements are performed using the appropriate operation reference standard (see 10.1). The probe is placed at the toe of the weld with the nose of the probe parallel to the longitudinal direction of the weld. The probe is then scanned

across the operation reference standard and over a reference slot as specified by the equipment manufacturer. The signal for the scanned slot is then selected and the gain is adjusted manually or automatically based on the measured signal and a reference signal for the discontinuity. Care must be used to ensure that the reference slot is the same as the discontinuity for the reference signal. This information can then be saved as user configuration data.

11.2 *Test System Check and Procedure:*

11.2.1 The test system shall consist of an alternating current field measurement instrument, a PC (if required), the probe and the operation reference standard.

11.2.2 The equipment operation check will be performed using the appropriate operation reference standard (see 10.1). The probe is placed at the toe of the weld with the nose of the probe parallel to the longitudinal direction of the weld. The probe is then scanned across the operation reference standard and over the appropriate reference slot, which depends upon the probe type and as specified by the equipment manufacturer producing a standardized data plot. Discontinuity indications are created when (1) the background level Bx value is reduced and then returns to the nominal background level (see Fig. 1) and this is associated with (2) a peak or positive (+ve) indication followed by a trough or negative (-ve) indication (or a trough followed by a peak, depending on direction of scan) in the Bz values. The resultant effect of the changes in Bx and Bz is a loop in the X-Y plot shown, for example, as the downward loop of Fig. 2. The presence of a discontinuity is confirmed when all three of these indications are present, that is, changes in the Bx and the Bz values and a loop in the X-Y plot. The loop should fill approximately 50 % of the Bx direction and 175 % of the Bz direction of the X-Y plot (that is, the loop is larger than the display in the Bz direction). The scanning speed or data sampling rate can then be adjusted if necessary, depending on the length and complexity of weld to be examined.

11.2.2.1 Once the presence of the discontinuity has been confirmed by the Bx and Bz indications the discontinuity should be sized.

11.2.2.2 Discontinuity sizing is performed in the examination software and uses look-up tables of expected responses versus discontinuity sizes. These tables are based upon mathematical models that simulate the current flow around the discontinuities and the resultant change in surface magnetic field. The operator either positions cursors on the displayed data or enters background and minimum values of Bx along with the Bz length and any coating thickness to allow the software to estimate discontinuity length and depth.

11.2.2.3 If the discontinuity sizing values differ from those expected from the operation reference standard then the instrument and probe settings should be checked. Each probe should have a unique probe file, the validity of which has been checked against the discontinuity sizing tables. The instrument settings can be checked using the software package.

11.2.3 Each alternating current field measurement unit and probe to be used during the examination should be checked with the operation reference standard. Discontinuity sizing estimation results obtained should be the same as the measured

dimensions of the slots in the block. If the dimensions differ by more a specified margin (for example, 10 %), then check that the correct probe files and gain have been used. If the correct probe files and gain have been used then there is a fault with the system, which will have to be determined. Do not use for examination unless standardization validity is confirmed within the specified margin between the estimated and measured slot dimensions.

11.3 *Frequency of System Checks:*

11.3.1 The system should be checked with all of the probes to be used during the examination prior to examining the first weld.

11.3.2 System operation should be checked at least every four hours with the probe in use or at the end of the examination being performed. If the discontinuity responses from the operation reference standard have changed by a specified margin (for example, 10 %), the welds examined since the last operations reference standard check shall be re-examined after following the procedure in 11.2.3.

12. Examination Procedure

12.1 If necessary, clean the weld surface to remove obstructions and heavy ferromagnetic or conductive debris.

12.2 Following the guidelines in 9.3, select a suitable probe for the examination task, then, using the installed software, select a data file and a probe file.

12.2.1 The probe is placed at the toe of the weld with the nose of the probe parallel to the longitudinal direction of the weld.

12.2.2 The probe is then scanned along the weld. Discontinuity indications are created when the following three points are indicated:

12.2.2.1 The background level B_x value is reduced and then returns to the nominal background level, Fig. 1.

12.2.2.2 This is associated with a peak, or positive (+ve) indication followed by a trough, or negative (-ve) indication (or a trough followed by a peak, depending on direction of scan) in the B_z values. Fig. 1.

12.2.2.3 The resultant effect of the changes in B_x and B_z is a downward loop in the X-Y plot, which is shown as a downward loop in the example plot of Fig. 2.

12.2.3 The presence of a discontinuity is confirmed when all three of these indications are present, that is, the B_x , the B_z and a loop in the X-Y plot. The scanning speed or data sampling rate can be adjusted if necessary, depending on the length and complexity of weld to be examined.

12.3 *Compensation for Material Differences:*

12.3.1 To compensate for the small differences in readings caused by variations in permeability, conductivity or geometry for a given material, the data may be centered on the display area. For larger differences, the equipment settings should be adjusted, and/or a more suitable probe configuration should be used, in accordance with the manufacturer's instructions.

12.4 *Compensation for Ferromagnetic or Conductive Objects:*

12.4.1 Techniques that may improve alternating current field measurement results near interfering ferromagnetic or conductive objects include:

12.4.1.1 Comparison of baseline or previous examination data with the current examination data.

12.4.1.2 The use of special probe coil configurations.

12.4.1.3 Use of higher or lower frequency probes may suppress non-relevant indications.

12.4.1.4 The use of a complementary method or technique.

12.5 Size and record all discontinuity indications as described in Section 14.

12.6 Note areas of limited sensitivity, using indications from the operation reference standard as an indicator of discontinuity detectability.

12.7 Using a discontinuity characterization standard, evaluate relevant indications in accordance with acceptance criteria specified by the client, if applicable.

12.8 If desired, examine selected areas using an appropriate complementary method or technique to obtain more information, adjusting results where appropriate.

12.9 Compile and present a report to the client.

13. Examination Considerations

13.1 *Scanning Speed:*

13.1.1 The scanning speed is chosen using the appropriate data sampling rate to obtain reasonable fidelity with the details of the scanned object given the length of the shortest discontinuity required to be found. A typical scan speed is 1 in. [25 mm]/second. This will produce a regular scan on the display screen. If short welds are to be examined then a faster data sampling rate should be used. If long welds are to be examined and the whole weld needs to be seen on the display screen then a slower data-sampling rate should be used. The weld length and speed of scanning will govern the data-sampling rate selected. With the introduction of faster software or hardware it is possible to select respective data sampling rates to produce faster scanning rates.

13.1.2 Acquire and record data from the operation reference standard at the selected examination speed.

13.1.3 Acquire and record data from the welds to be examined. Maintain as uniform a probe speed as possible throughout the examination to produce repeatable indications.

13.2 *Width of Scan:*

13.2.1 The scan width is determined by the size of the probe and should be considered when performing an inspection. The sensitivity of the probe to a discontinuity decreases with distance. This distance is a factor that affects the number of scans that must be performed in order to provide full coverage when inspecting the weld. Note that even if a scan width is larger than the width of the weld cap, both toes of the weld should be scanned separately in most cases.

13.3 *Continuous Cracking:*

13.3.1 Prior to the scanning of a weld, checks should be made that the discontinuity is not continuous by scanning the probe from 2 in. [50 mm] away from the weld towards the toe. If a discontinuity is present the B_x indication on the computer

screen will dip as the probe approaches the weld toe. If this form of indication occurs then this procedure shall be repeated at intervals along the toe of the weld.

13.4 Scanning Direction:

13.4.1 The probe should always be scanned parallel to the weld toe (except when confirming transverse discontinuities or discontinuities in regions of grinding) and this will give recognizable indications from longitudinal discontinuities in the weld area. Scanning in this direction will also give recognizable indications from transverse discontinuities and discontinuities inclined to the toe of the weld. The operator should be familiar with these types of indications.

13.5 Circumferential Welds:

13.5.1 The scanning pattern for a circumferential weld is shown in Fig. 4. Overlapping scans are required to ensure no discontinuities are missed if they occur at the end of a scan. The number of overlapping scans will vary depending on the component diameter. The overlap should be between 1 in. [25 mm] and 2 in. [50 mm] depending on the diameter of the tube or pipe. All detection shall be complete before any sizing operation is performed. Remember to check for continuous discontinuities before scanning.

13.6 Linear Welds:

13.6.1 The scanning pattern is similar to that for circumferential welds except that an edge effect may occur at the end of the weld or if the weld ends at a buttress. In the case of the end of the weld an edge-effect probe should be used but for the buttress a mini- or micro-probe should be used. These probes can also be used as an alternative to the edge effect probe. The standard weld probe should be used for sizing if at all possible. Recourse to other techniques, possibly including conventional eddy current techniques, may be necessary in these situations.

13.7 Attachments, corners and cutouts:

13.7.1 The scanning patterns for the attachment welds and gussets are shown in Fig. 5, Fig. 6, and Fig. 7 where lines

A1-A6, B1-B3 and C1 and 2 are the probe scan lines and positions 1-10 are the incremental positions along the weld length. The corners are difficult to scan and the micro- or mini-probes should be used where possible.

13.8 Cut outs and cruciform geometries:

13.8.1 The examination of this geometry is difficult due to the access problems; the scanning patterns and identification of the areas are shown in Fig. 8, Fig. 9, Fig. 10 and Fig. 11. The 90° mini- or micro- probe is essential for examining the cut-out areas.

13.9 Ground-out Areas:

13.9.1 The repair or groundout area is usually 0.5 in. [12.5 mm] wide, and the grind repair probe is designed for the examination of these areas. The probe should be scanned into one end of the groundout area and the scan continued through the other end. Areas with discontinuities should be noted and sized for length and depth with the grind repair probe.

14. Discontinuity Sizing Procedure

14.1 The depth and length of the discontinuity are estimated from measurements taken of the Bx signatures plus the distance between terminal peak/trough of the Bz signature with compensation provided by either a user entered coating thickness or a real-time thickness compensation function.

14.2 Length:

14.2.1 Once an area containing a discontinuity has been located, a repeat scan is taken through the discontinuity. The Bz length of the discontinuity is determined by locating the extreme ends of the discontinuity using the peak (+ve) and trough (-ve) Bz locations. These positions should be just inside the actual ends of the discontinuity. This Bz length is used with the discontinuity sizing tables to determine the true length and depth of the discontinuity. The length of the detected discontinuity may be measured directly by the system software using properly placed manual markers or a position encoder. If the markers are placed manually, then the scan speed should be kept constant.

14.3 Depth:

14.3.1 The depth of the discontinuity is calculated using the Bx minimum and Bx background values and the Bz length of the discontinuity measured from the Bz data. Once these values have been put into the discontinuity sizing table, together with the coating thickness, if the equipment does not provide for lift-off compensation, then the discontinuity depth will be estimated by the software. Alternatively, if the equipment provides a lift-off value, the coating thickness can be determined automatically and the depth can be determined from the equipment software and discontinuity sizing table.

15. Report

15.1 *Reporting Requirements*—a list of reporting requirements is given in Table 1. Reference should be made to the Client reporting requirements (7.1.14). The items listed below should be included in the examination report. All information below should be archived, whether or not it is required in the report.

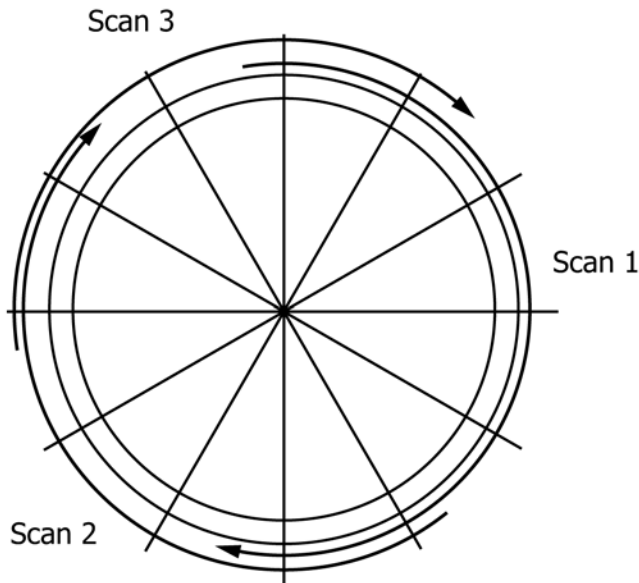


FIG. 4 Scanning Pattern for a Circumferential Weld

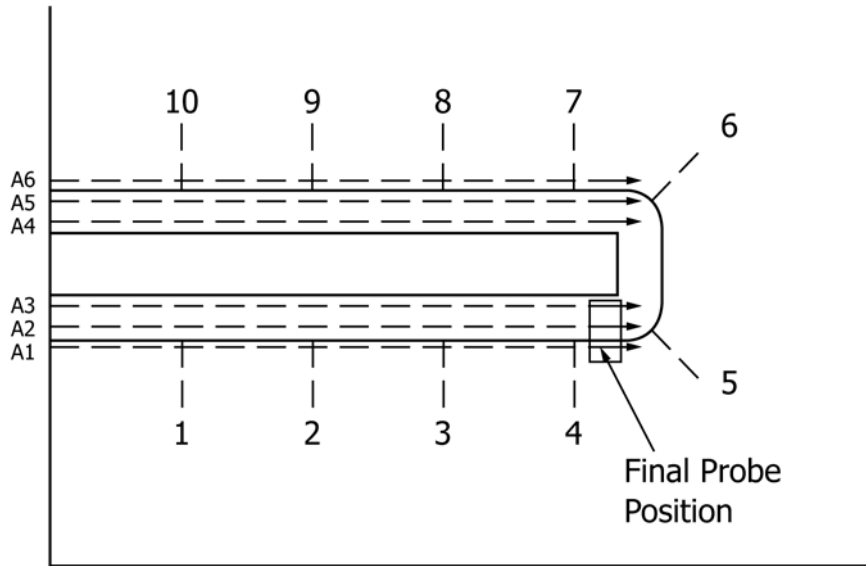


FIG. 5 Scanning Pattern for an Approach to an Attachment

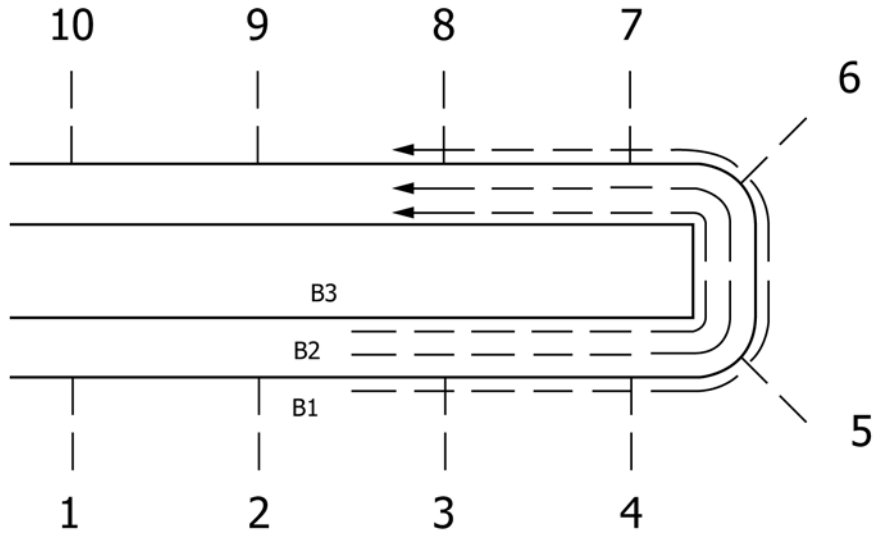


FIG. 6 Scanning Pattern for the End of an Attachment

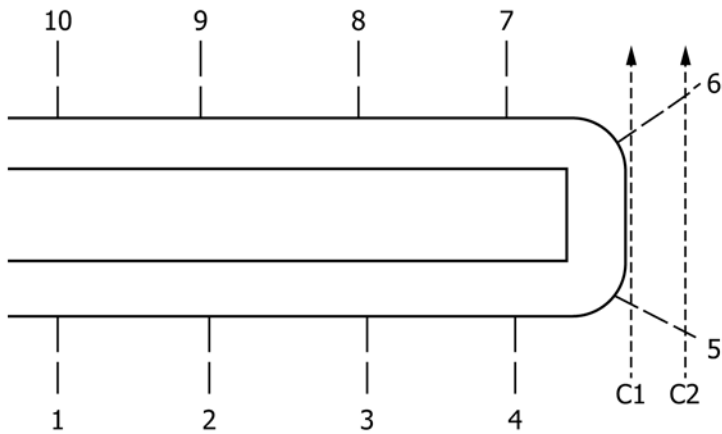


FIG. 7 Scanning Pattern Across an Attachment (Crack in the Toe End)

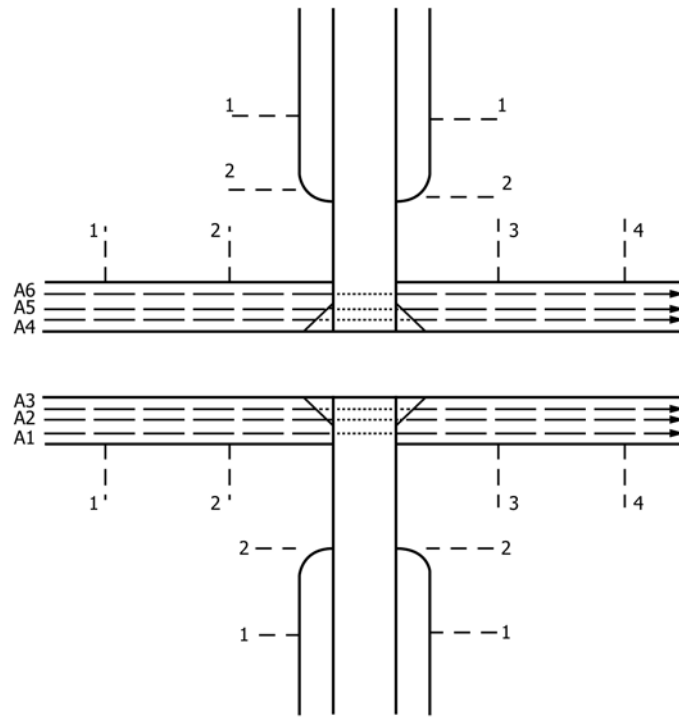


FIG. 8 Scans of the Main Weld

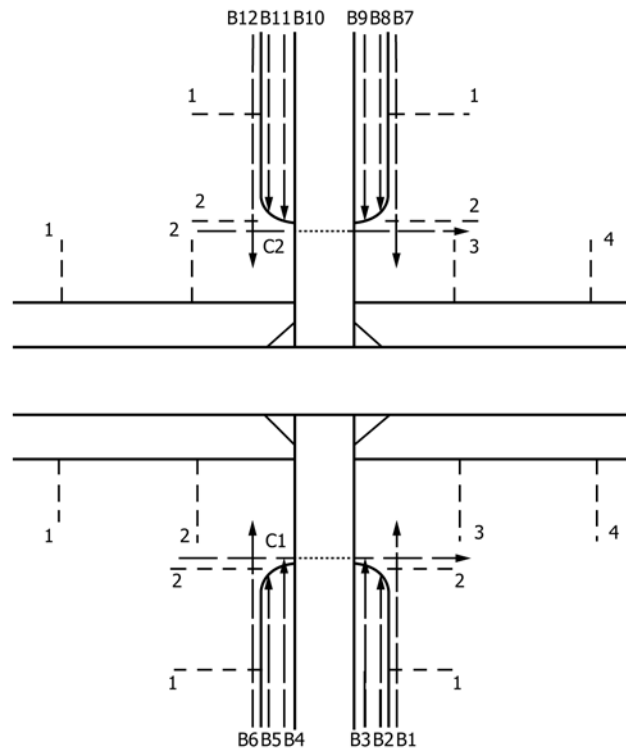


FIG. 9 Scans of the Horizontal Weld into a Cut Out

15.1.1 Owner, location, type and serial number of component examined.

15.1.2 Size, material type and grade, and configuration of welds examined. If required by type of equipment chosen, thickness of coating and variation in coating thickness.

15.1.3 Weld numbering system.

15.1.4 Extent of examination, for example, areas of interest, complete or partial coverage, which welds, and to what length.

15.1.5 The names and qualifications of personnel performing the examination.

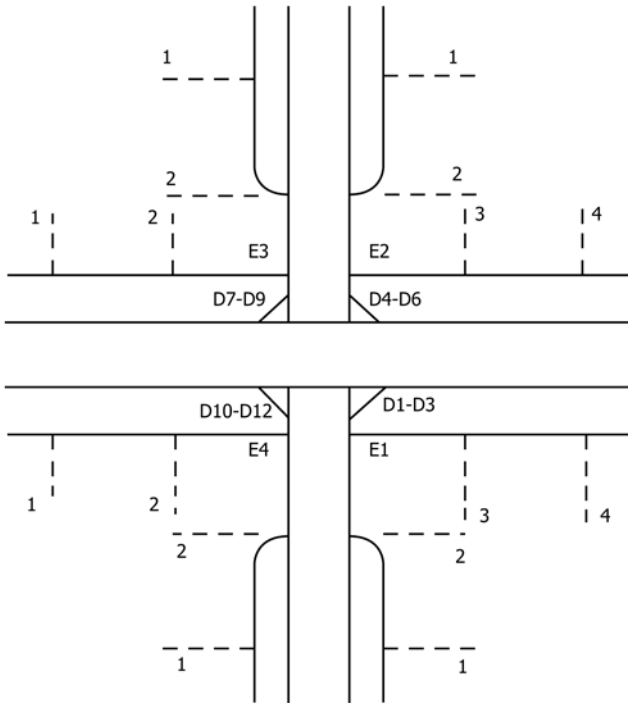


FIG. 10 Nomenclature for Vertical Welds

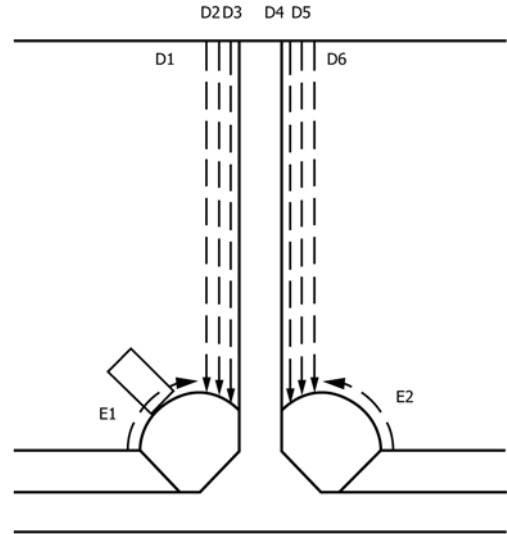


FIG. 11 Scans of Vertical Cut Out Weld and Cut Out Surface

15.1.6 Models, types, and serial numbers of the components of the alternating current field measurement system used, including all probes.

15.1.7 For the initial data acquisition from the operation reference standard, a complete list of all relevant instrument settings and parameters used, such as operating frequencies, and probe speed. The list shall enable settings to be referenced to each individual weld examined.

15.1.8 Serial numbers of all of the operations reference standards used.

15.1.9 Brief outline of all techniques used during the examination.

15.1.10 A list of all areas not examinable or where limited sensitivity was obtained. Indicate which discontinuities on the operations reference standard would not have been detectable in those regions. Where possible, indicate factors that may have limited sensitivity.

NOTE 3—Factors that influence sensitivity to discontinuities include but

are not limited to: operating frequency, instrument noise, instrument filtering, digital sample rate, probe speed, coil configuration, probe travel noise and interference described in Section 8.

15.1.11 Specific information about techniques and depth sizing for each discontinuity.

15.1.12 Acceptance criteria used to evaluate discontinuities.

15.1.13 A list of discontinuities as specified in the purchasing agreement with the thickness of the coating over these discontinuities if the equipment does not measure and compensate for lift-off.

15.1.14 Complementary examination results that influenced interpretation and evaluation.

15.2 Record data and system settings in a manner that allows archiving and later recall of all data and system settings for each weld. Throughout the examination, data shall be permanently recorded, unless otherwise specified by the client.

15.2.1 *Report form.* An example report form is shown in Table 2.

16. Keywords

16.1 alternating current field measurement; electromagnetic examination; ferromagnetic weld; non-conducting material; weld



TABLE 1 Reporting Requirements

NOTE 1—The data report sheets generated by the alternating current field measurement examination will be specifically designed with the system and current examination requirements in mind. The essential information contained on a data sheet will include:

General Information
Date
Operators Name
Probe Operator
Component ID Number
File Number
Equipment Used
Scanning Data
Filename
Page Number
Position on Weld
Probe Number
Probe Direction
Tape Position
Examination Summary
Detailed Record of Indications / Anomalies
Filename
Page Number
Position on Weld
Start of Discontinuity (Tape reference)
End of Discontinuity (Tape reference)
Length of Discontinuity (inches/millimetres)
Thickness of Coating over Discontinuity (inches/millimetres, if required by equipment)
Remarks
Diagram/Drawing of component under examination



TABLE 2 Example Alternating Current Field Measurement Report Form

Date: Time:	Location:	Sketch of geometry:
Operator:	Probe Op:	
Component ID:		
Summary of discontinuities:		
Filename:		
Probe Number:	Probe File:	

Distance from Datum	Direction of travel	Weld Position	Page	Examination report/ comments

SUMMARY OF CHANGES

Committee E07 has identified the location of selected changes to this standard since the last issue (E2261-12) that may impact the use of this standard. (June 1, 2017)

(1) Added ISO 9712 to **2.3** and **6.1.1**.

(2) Vocabulary updated in subsections **9.1.1**, **11.2.1**, and **13.1.1**.

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org). Permission rights to photocopy the standard may also be secured from the Copyright Clearance Center, 222 Rosewood Drive, Danvers, MA 01923, Tel: (978) 646-2600; <http://www.copyright.com/>