



Designation: F1505 – 16

# Standard Specification for Insulated and Insulating Hand Tools<sup>1</sup>

This standard is issued under the fixed designation F1505; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon ( $\epsilon$ ) indicates an editorial change since the last revision or reapproval.

## 1. Scope\*

1.1 This specification covers the testing of insulated and insulating hand tools used for working on, or in close proximity to, energized electrical apparatus or conductors operating at maximum voltage of 1000 V ac or 1500 V dc.

1.2 The specific use of these tools is beyond the scope of this specification.

1.3 The values stated in SI units are to be regarded as the standard. The inch-pound units given in parentheses are for information only.

1.4 The following precautionary caveat pertains to the test method portion only, Section 7, of this specification: *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

1.5 This specification does not purport to address all of the safety problems associated with the use of tools on, or in close proximity to, energized electrical apparatus.

## 2. Referenced Documents

### 2.1 ASTM Standards:<sup>2</sup>

[D149 Test Method for Dielectric Breakdown Voltage and Dielectric Strength of Solid Electrical Insulating Materials at Commercial Power Frequencies](#)

[D618 Practice for Conditioning Plastics for Testing](#)

[D5025 Specification for Laboratory Burner Used for Small-Scale Burning Tests on Plastic Materials](#)

[D5207 Practice for Confirmation of 20-mm \(50-W\) and 125-mm \(500-W\) Test Flames for Small-Scale Burning Tests on Plastic Materials](#)

<sup>1</sup> This specification is under the jurisdiction of ASTM Committee F18 on Electrical Protective Equipment for Workers and is the direct responsibility of Subcommittee F18.35 on Tools & Equipment.

Current edition approved Nov. 1, 2016. Published January 2017. Originally approved in 1994. Last previous edition approved in 2015 as F1505-10 (2015). DOI: 10.1520/F1505-16.

<sup>2</sup> For referenced ASTM standards, visit the ASTM website, [www.astm.org](http://www.astm.org), or contact ASTM Customer Service at [service@astm.org](mailto:service@astm.org). For *Annual Book of ASTM Standards* volume information, refer to the standard's Document Summary page on the ASTM website.

### 2.2 ASME/ANSI Standards:<sup>3</sup>

[ASME B18.3-2002 Socket Cap, Shoulder, Set Screws, Hex and Spline Keys](#)

[ASME B107 Series of Standards for Hand Tools and Accessories](#)

### 2.3 IEC Standard:<sup>4</sup>

[IEC 60900:2012 \(Ed. 3\) Live Working – Hand tools for use up to 1000 V ac and 1500 V dc](#)

[IEC 61318:2007 \(Ed. 3\) Live Working – Conformity assessment applicable to tools, devices and equipment](#)

### 2.4 ISO Standards:<sup>5</sup>

[ISO 1174-1:1996 Assembly tools for screws and nuts—Driving Squares—Part 1: Driving squares for hand socket tools](#)

[ISO 5744:2004 Pliers and nippers—Methods of test](#)

### 2.5 Federal Specification:<sup>6</sup>

[GGG-R-791H \(19 July 1994\) Rules, Measuring](#)

## 3. Terminology

### 3.1 Definitions:

3.1.1 *insulated hand tools, n*—those covered with insulating material in order to protect the user from electric shock and to minimize the risk of short circuits between parts at different potentials.

3.1.2 *insulating hand tools, n*—those made predominantly of insulating material, except for metal inserts at the working head or active part or used for reinforcement but with no exposed metal parts. In either case, to protect the user from electric shocks, as well as, to prevent short-circuits between exposed parts at different potentials.

### 3.2 Definitions of Terms Specific to This Standard:

3.2.1 *acceptance test, n*—a contractual test to prove to the customer that the device meets certain conditions of its specification.

<sup>3</sup> Available from American Society of Mechanical Engineers (ASME), ASME International Headquarters, Three Park Ave., New York, NY 10016-5990, <http://www.asme.org>.

<sup>4</sup> Available from Institute of Electrical and Electronics Engineers, Inc. (IEEE), 445 Hoes Ln., P.O. Box 1331, Piscataway, NJ 08854-1331, <http://www.ieee.org>.

<sup>5</sup> Available from International Organization for Standardization (ISO), 1 rue de Varembe, Case postale 56, CH-1211, Geneva 20, Switzerland, <http://www.iso.ch>.

<sup>6</sup> Available from DoD ASSIST-Quick Search, DLA Document Services, Building 4/D, 700 Robbins Ave., Philadelphia, PA 19111-5094, <http://quicksearch.dla.mil>.

\*A Summary of Changes section appears at the end of this standard

3.2.2 *formation of lots or batches, n*—the product is assembled into identifiable lots, sub-lots, batches, or in such other manner as may be prescribed. Each lot or batch, as far as practicable, consists of units of product of a single type, grade, class, size, and composition, manufactured under essentially the same conditions and essentially the same time.

3.2.3 *major defect, n*—defect on product that is likely to result in failure, or to reduce significantly the functionality of the product.

3.2.4 *minor defect, n*—defect on product, other than major, that is not likely to reduce significantly the functionality of the product.

3.2.5 *routine test, n*—a test to which each individual device is subjected during or after manufacture to ascertain whether it complies with certain criteria.

3.2.6 *sampling test, n*—a test on a number of devices taken at random from a batch.

3.2.7 *type test, n*—a test of one or more devices made to a certain design to show that the design meets certain specifications.

#### 4. Performance Requirements

4.1 Insulated and insulating tools shall be designed and manufactured in such a way that they do not constitute a danger for the user or the installation if they are used properly.

4.2 The mechanical specifications for insulated and insulating hand tools having the same function shall comply with the corresponding ANSI or ISO standards. The mechanical performance of the working parts shall be maintained even after the application of any insulating layer(s). The insulation material shall be such that it will adequately withstand the electrical, mechanical, and thermal stresses to which it may be exposed during normal use. Insulating hand tools specially designed for live working in an environment of live parts at different potentials (boxes with electrical equipment, live working on underground cables, etc.), that generally are used to hold or move live conductors or to cut wires of small section, must have adequate mechanical properties to avoid the risk of breaking and the possible corresponding electrical consequences. These tools shall be checked for compliance with 7.8.

4.3 All insulating material shall be flame resistant in accordance with 7.7.

4.4 The insulating coating may consist of one or more layers. If two or more layers are utilized, contrasting colors shall be employed.

4.5 The design and construction of the handles shall provide a secure handhold and prevent unintentional slipping.

4.6 The tool shall have an operating temperature range from  $-20$  to  $+70^{\circ}\text{C}$ .

4.7 The insulating material shall adhere securely to the conductive parts of the tool and any outer layer of the material over the temperature range from  $-20$  to  $+70^{\circ}\text{C}$ .

4.8 Tools intended for use at extremely low temperatures ( $-40^{\circ}\text{C}$ ) shall be designated “Category C” and shall be designed for this purpose.

4.9 Double-ended tools such as box wrenches, keys for hexagonal socket screws, double ended socket wrenches, double-head open-end wrenches, etc., are not allowed for insulated tools but are allowed for insulating tools.

#### 4.10 Tools Capable of Being Assembled:

4.10.1 *Retaining Devices for Tools Capable of Being Assembled*—Tools capable of being assembled shall have suitable retaining devices to prevent unintentional separation of the assembly. The retaining forces shall be tested in accordance with 7.9.

4.10.2 *Insulation Design for Tools Capable of Being Assembled*—In the case of connecting parts of tools capable of being assembled, the insulation shall be applied in such a manner that if any part becomes detached during use, no conductive part, which may still be live, can be inadvertently touched or cause a disruptive charge.

4.10.3 *Tools Capable of Being Assembled with Square Drives*—Tools capable of being assembled with square drives shall have square drives and square sockets in accordance with ISO 1174-1 (for separating forces, see 7.9.1). To ensure compatibility of insulation between different manufacturers, these tools shall be designated with overlapping elements described in Fig. 1. Their dimensions and tolerances shall be in accordance with Table 1.

4.10.4 *Interchangeability of Components Made by Different Manufacturers*—Tools capable of being assembled and designed to be interchangeable between different manufacturers shall be specifically marked in accordance with 5.6.5. There are considerable difficulties in developing a unified standard for the mechanical joining systems for components and tools for different manufacturers. For safety reasons, only mechanically locked retaining systems shall be used for these kind of tools. Manufacturers shall include the following information in the instructions for use: To ensure that the complete assembly of insulated tool components from different manufacturers will withstand separating forces that are expected during the intended use, prior to the use of any assembly the use shall ensure, by pulling by hand in a separating direction, that the retaining devices of all used elements are working efficiently and no component gets separated.

#### 5. Additional Requirements


5.1 *Screwdrivers and Wrenches*—The following uninsulated areas on the working head are permissible (see Fig. 2):

5.1.1 *Screwdrivers* for slotted head screws, cross tip and other types, an 18-mm (0.709-in.) maximum length, is permissible for the exposed tip.

5.1.2 The blade insulation of screwdrivers shall be bonded to the handle. The outer diameter of the insulation, over a length of 30 mm (1.181 in.), in Area C of Fig. 2, shall not exceed the width of the blade at the tip by more than 2 mm (0.079 in.). This area may be parallel or tapered towards the tip.

5.1.3 *Bit Screwdrivers*—Bit screwdrivers are regarded as tools capable of being assembled. They shall meet the relevant requirements. The outer diameter of the insulation may exceed the dimensions of 5.1.2.

5.1.4 *Screwdrivers with Screw Retaining Devices*—If a screwdriver has a screw retaining device, the screwdriver itself

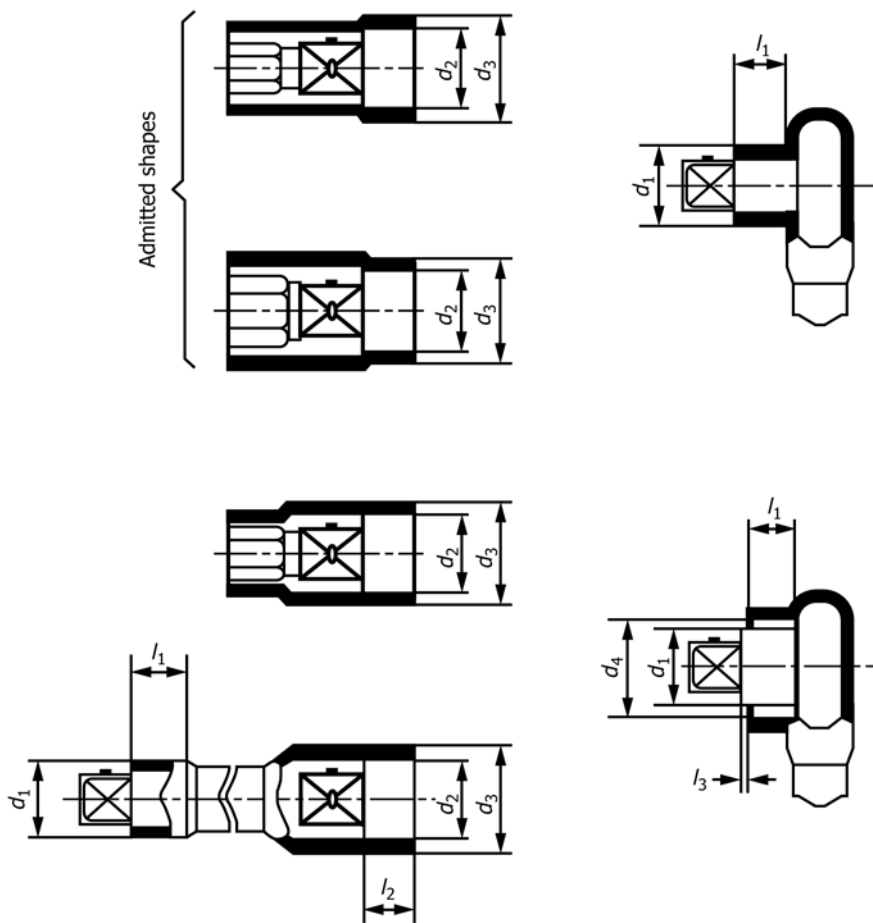

NOTE 1—Dimensions in millimetres

FIG. 1 Description of the Insulating Overlapping Element and Different Assembly Configurations for Tools Capable of Being Assembled with Square Drives (see 4.10.3)

TABLE 1 Dimensions and Tolerances of the Insulating Overlapping Element<sup>A</sup>

NOTE 1—Dimensions in millimetres.

Nominal size	$l_1$ min	$l_2$	$l_3$	$d_1$	$d_2$	$d_3$	$d_4$
		+2 0	+0.05 -0.05	0 -1.5	+1.5 0	0 -1.5	+1.5 0
6.3	19	16	2	12.5	13	18	19
10	19	16	2	17.5	18	23	24
12.5	19	16	2	21.5	22	27	28
20	19	16	2	32	33	38	39

<sup>A</sup> $l_1, l_2, l_3, d_1, d_2, d_3,$  and  $d_4$  are described in Fig. 1

shall meet the requirements of this standard. The outer diameter of the retaining device may exceed the dimensions of 5.1.2. The retaining device shall be made from insulating material.

5.1.5 *Box Wrenches, Socket Wrenches, and T-Wrenches*—The working surfaces that contact the fastener.

5.1.6 *Engineer’s Wrenches*—The working surface.

NOTE 1—At the request of the customer, the uninsulated area may be extended to the working head.


5.2 *Folding Rules*—Linear measuring instruments constructed of fiberglass reinforced plastic or other suitable synthetic material with adequate strength and rigidity comprised of multiple legs and movable joints.

5.2.1 The legs shall meet the requirements for insulating tools and pass the dielectric tests detailed in 7.4.4.2 and 7.4.4.3 (see Fig. 3).

5.2.2 Joints, End Tips and Extensions (if included) shall not be constructed of exposed metal.

5.2.3 The movable joints may be constructed using metal pins. These pins shall not extend beyond the ends of the hinge or above the surface of the joint (see Fig. 4).


5.2.4 Markings and Graduations shall be done in a permanent manner and comply with 5.6. In addition, graduations shall be lasered, etched, molded or indented directly into the surface so that it remains legible throughout the life of the product.

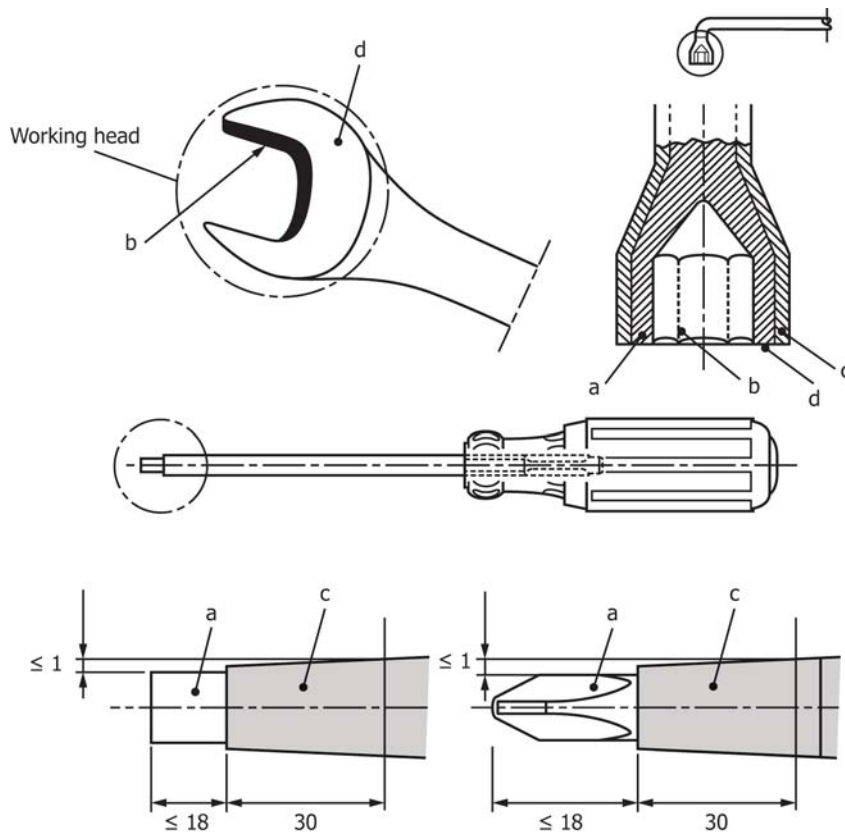

NOTE 1—Dimensions in millimetres.

NOTE 2—a = conductive part,  
 b = working part,  
 c = insulation, and  
 d = contact part.

FIG. 2 Illustrations of Insulation of Typical Tools—Examples (see 5.1)

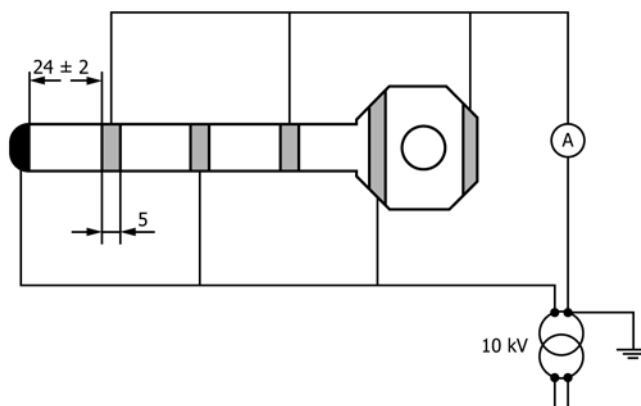

NOTE 1—Dimensions in millimetres.

FIG. 3 Dielectric Testing Device for Insulating Tools (see 7.4.4.2)

### 5.3 Pliers, Strippers, Cable Cutting Tools, Cable Scissors:

5.3.1 The handle insulation shall have a guard so that the hand is prevented from slipping towards the uncovered metal parts of the head (see Fig. 5(a) as an example). The height of the guard shall be sufficient to resist slippage of the fingers towards the conductive part during work. For pliers, the minimum dimensions of the guard shall be 10 mm (3/8 in.) on

the left and the right side of the pliers positioned on a flat surface, 5 mm (3/16 in.) on the upper and lower part of the pliers positioned on a flat surface (see Fig. 5(a)).

5.3.2 The minimum insulated distance between the inner edge of the guard and the non-insulated part shall be 12 mm (1/2 in.) (see Fig. 5(a)). The insulating material shall extend as far as possible towards the working end of the tool.

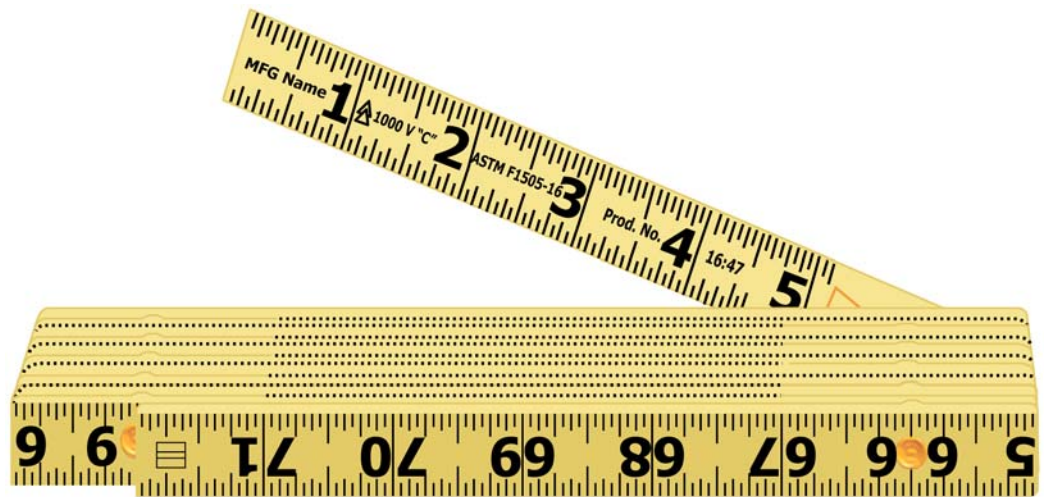


FIG. 4 Typical Fiberglass Folding Rule – Outside Reading (see 5.2)

5.3.3 In the case of a slip joint and an adjustable joint plier, a guard of 5 mm ( $\frac{3}{16}$  in.) minimum shall be provided for the inner part of the handles (see Fig. 6).

5.3.4 In the case of “micro tools” (that is, pliers and nippers for electronics) the dimensions of the guard shall be at least 5 mm on the left and right side of the pliers held on a flat surface and 3 mm on the upper part and the lower part of the pliers held on a flat surface. The minimum insulated distance between the inner edge of the guard and the non-insulated part shall extend as far as possible towards the working head (see Fig. 7).

5.3.5 If the handles of the tools exceed the length of 400 mm (16 in.), a guard is not required.

5.3.6 *Scissors*—A typical insulation of scissors is shown in Fig. 8. The finger rings of the scissors shall have one of the designs presented in Fig. 8(a and b). The maximum length of the uninsulated parts of scissors shall not exceed 100 mm (4 in.). The insulation portion in front of the guard shall extend as far as possible towards the working head. If the insulated length in front of the finger rings is less than 50 mm, at least one guard is required.

5.4 *Knives*—The minimum length of the insulated handle shall be 100 mm (4 in.). The handle shall have a guard on the side (see Fig. 5(b)) toward the blade to prevent the slipping of the hand onto the conductive blade. The minimum height of the guard shall be 5 mm ( $\frac{3}{16}$  in.). The minimum insulated distance between the inner edge of the guard and the non-insulated part shall be 12 mm ( $\frac{1}{2}$  in.) (see Fig. 5(b), letter b). The length of the uninsulated part of the knife blade shall not be longer than 65 mm (2½-in.) (see Fig. 5(b), letter c).

5.5 *Tweezers* (see Fig. 9):

5.5.1 The total length ( $l$ ) shall be 130-mm (5-in.) minimum and 200-mm (8-in.) maximum. The length of the handle ( $g$ ) shall be 80-mm (3-in.) minimum.

5.5.2 Both handles of the tweezers shall have a guard towards the working head. The guard shall not be movable. Its height  $h$  and width  $b$  shall be sufficient (5 mm ( $\frac{3}{16}$  in.) minimum, to prevent any slipping of the fingers during the work towards the uninsulated working head  $u$ . On both

handles, the insulated part between the guard and the working head  $e$  shall be 12-mm ( $\frac{1}{2}$ -in.) minimum and 35-mm (1- $\frac{3}{8}$ -in.) maximum.

5.5.3 In the case of tweezers with a metallic working head, the metallic part shall have a minimum hardness of 35 HCR (Rockwell Hardness – C Scale) at least from the working head to the handles.

5.5.4 The uninsulated length  $u$  of the working head shall not exceed a length of 20 mm ( $\frac{3}{4}$  in.).

5.5.5 Insulating tweezers shall not have exposed conductive parts.

5.6 *Marking*—Each tool or tool component, or both, shall be marked permanently and legibly with the following information:

5.6.1 On the insulating material layer or on the metal conductive part include the following information:

5.6.1.1 Manufacturer’s name or trademark,

5.6.1.2 Type or product reference.

5.6.2 On the insulating material layer include the following (see Fig. 10):

5.6.2.1 The double triangle symbol,



5.6.2.2 1000 V (the electrical working limit for alternating current), and

5.6.2.3 Year of manufacture (at least the last two digits of the year).

5.6.2.4 For tools designed for use at extremely low temperatures ( $-40^{\circ}\text{C}$ ), include letter “C”.

5.6.2.5 The number of the relevant ASTM standard in the vicinity of the symbol with the year of publication (ASTM F1505-07). Where there is a lack of space on the product itself, it is permissible to limit this marking to the number of the standard. In such case, the complete marking, including the year of publication shall appear on the smallest unit container in which the product is packaged.

5.6.3 The double triangle symbol shall be at least 3 mm ( $\frac{1}{8}$  in.) high. The letters and the figures shall be at least 2 mm ( $\frac{1}{16}$  in.) high (see Fig. 11).

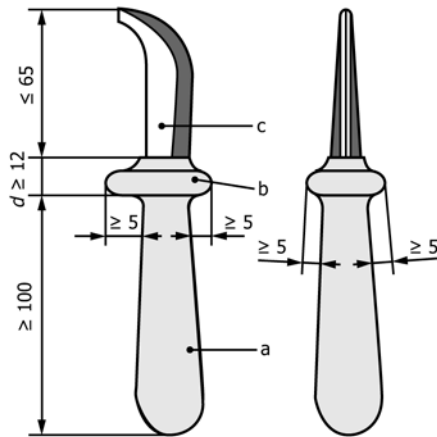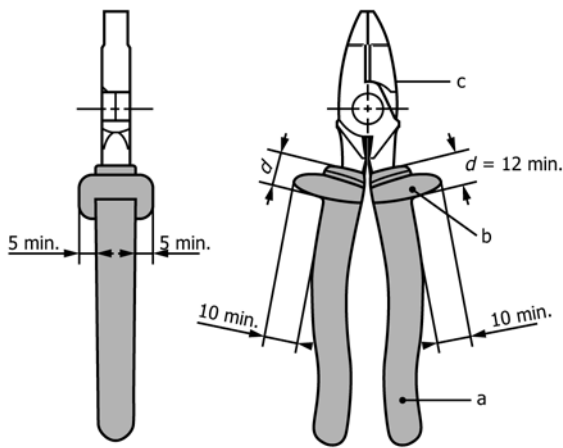

(a) Insulation of Pliers  
(b) Insulation of Knives

NOTE 1—Dimensions in millimetres.

NOTE 2—a = insulated handle or leg,

b = guard,

c = working head (not insulated), and

d = distance between the inner edge of the guard and the non-insulated part.

**FIG. 5 (a and b) Illustrations of Insulation of Pliers and Knives**  
(see 5.3.1, 5.3.2 and 5.4)

5.6.4 The voltage markings described in 5.6.2 shall be the only voltage shown on the tool.

NOTE 2—The indication of a test voltage may lead to the erroneous assumption that the tool is suitable for work at that voltage.

5.6.5 The symbol for tools capable of being assembled and designed to be interchangeable between different manufacturers—the marking symbol and the dimensions are given in Fig. 12. The dimension  $H$  shall be greater than or equal to 5 mm.

5.6.6 Additional markings where specified by the customer.

5.7 *Instructions for Use*—In the case of tools that require assembly or adjustment, the proper method shall be stated in the instructions for use. See Section 12.

## 6. Significance and Use

6.1 The performance and durability of the tools covered in this specification are not covered beyond those referenced in the applicable ASME, ANSI, or ISO standards and GGG specifications.

## 7. Type Tests

7.1 *General Test Specification*—The following tests shall be utilized to check compliance with the requirements outlined in Sections 4 and 5:

7.1.1 Perform the test procedures in 7.2 – 7.10 on each specimen sample in the sequence listed.

7.1.2 Perform the type tests on at least three samples of the same batch.

7.1.3 If there is any change in the design or manufacture of the tool since the last type test, repeat the type test.

7.1.4 Should a sample fail any part of the type tests, repeat the type tests on at least six additional samples of the same batch. Should any one sample then fail in any part of the repeated type test, the whole test is to be regarded as having failed.

7.1.5 Unless stated in the specification, perform the test after a minimum storage time of 16 h under IEC climatic conditions;  $23 \pm 5^\circ\text{C}$ , relative humidity 45 to 75 %.

7.1.6 Unless otherwise stated, deviations of 5 % from any test values required are permissible.

7.1.7 All tools that have failed the test shall be either destroyed or rendered unsuitable for use in live working. This also applies to any other tools from the batch unless the test is nondestructive. In this case, all tools shall be tested.

### 7.2 Visual and Dimensional Check:

7.2.1 *Visual*—The tool and insulation shall be visually checked and shall be determined to be free from external defects. The marking shall be checked for legibility and completeness in accordance with 5.6.

7.2.2 *Dimensional*—Check the dimensions in accordance with Section 5.

### 7.3 Impact Test:

7.3.1 Perform the test in accordance with one of the two alternatives shown in Fig. 13 and Fig. 14. The hardness of the hammer shall be at least 20 HRC.


7.3.2 Select at least three points of the insulating material or insulating layer as testing points, these being points that could be damaged when the tool drops on a flat surface.

7.3.3 The test is passed if the insulating material shows no breaks, exfoliation, or cracks penetrating the insulating layer of the insulated tool, or are likely to reduce the solidity of the insulating tool.

### 7.3.4 Ambient Temperature Test:


7.3.4.1 Test the tool at the ambient temperature ( $23 \pm 5^\circ\text{C}$ ) of the test room.

7.3.4.2 Determine the fall height  $H$  as a function of its weight,  $P$ , so that the energy,  $W$ , of impact on the tool to be

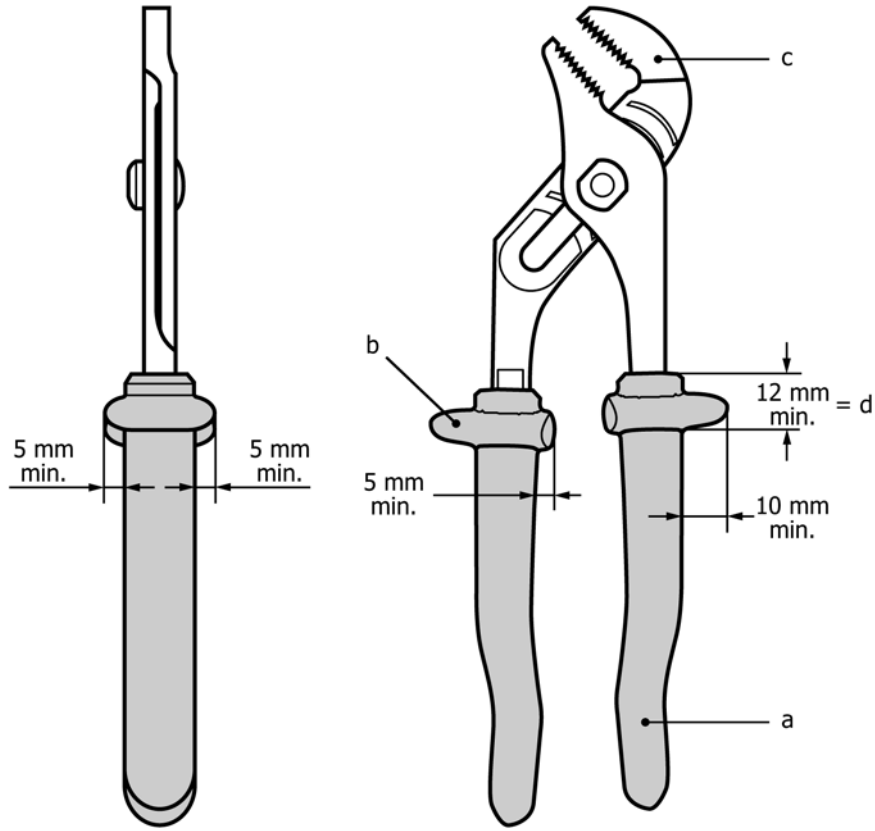


NOTE 1—Dimensions in millimetres

FIG. 6 Example for Insulation of the Handles of Multiple-Position, Adjustable and Slip-Joint Pliers (see 5.3.3)

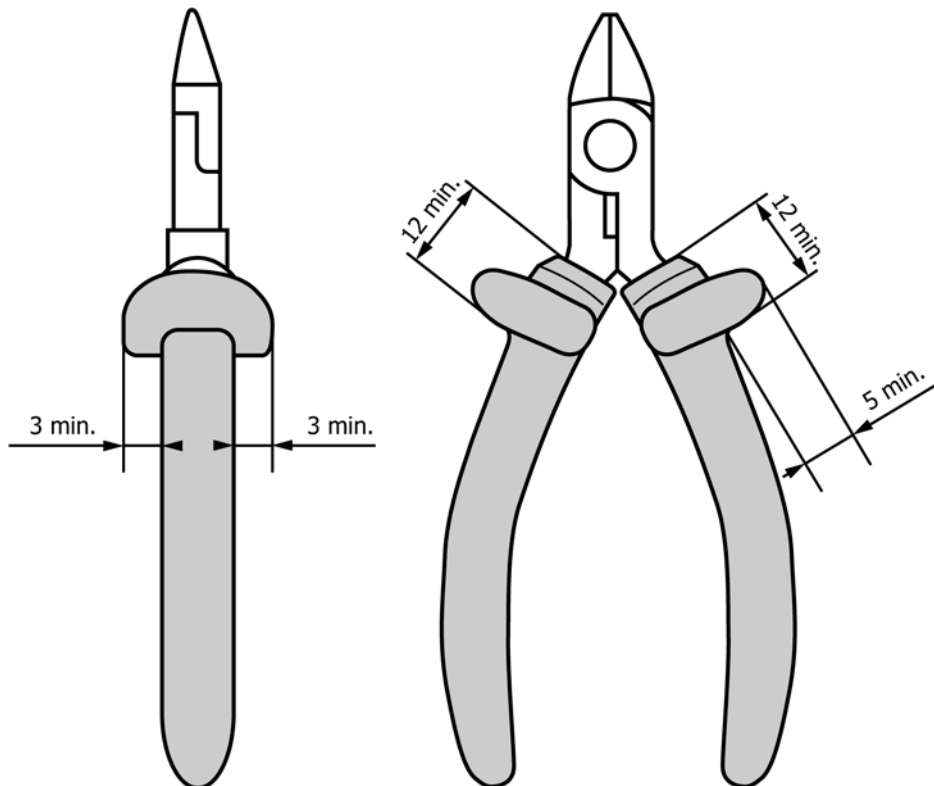


NOTE 1—Dimensions in millimetres

FIG. 7 Illustration of Insulation of Pliers and Nippers for Electronics (see 5.3.4)

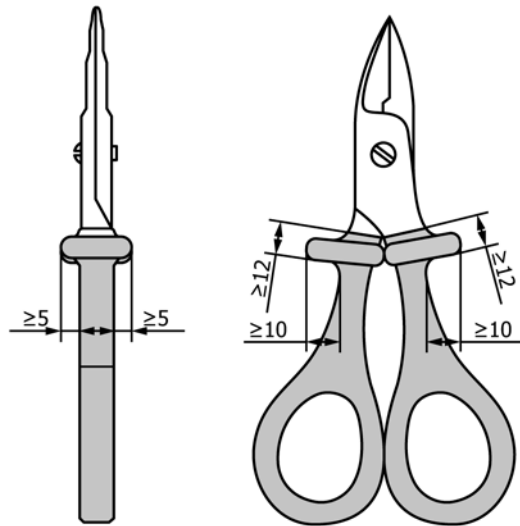

(a) Style A, Closed Finger Rings

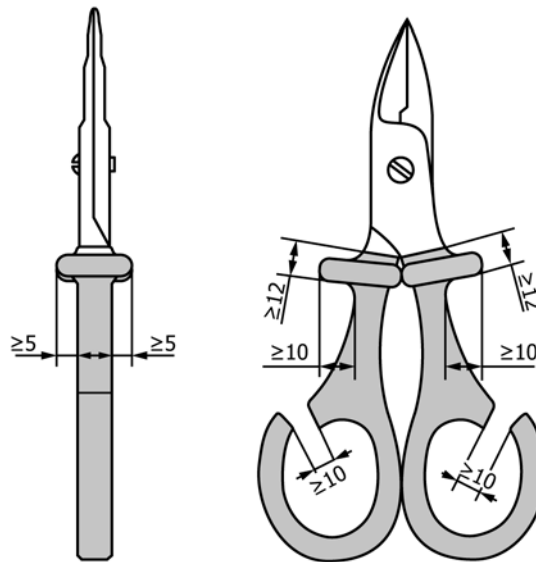

(b) Style B, Open Finger Rings

FIG. 8 Insulation of Scissors (see 5.3.6)

tested shall be equal to that of this tool falling from a height of 2 m onto a hard surface:

$$H = (W)/(P) = (2 \times F)/(P) \quad (1)$$

where:

$H$  = fall height of the hammer, m,  
 $F$  = weight of the tool tested, N, and  
 $P$  = weight of the hammer, N.

7.3.5 Low-Temperature Test:

7.3.5.1 Condition the tool by placement in a cooling chamber for 2 h at  $-25 \pm 3^\circ\text{C}$ .


7.3.5.2 The impact test shall take place within 2 min after removal from the cooling chamber. The ambient temperature shall be  $23 \pm 5^\circ\text{C}$ . The impact test shall be carried out according to 7.3.4.2.

7.3.6 Extreme Low Temperature Test:

7.3.6.1 The tool shall be conditioned by placement in a cooling chamber for 2 h at  $-40^\circ\text{C} \pm 3^\circ\text{C}$ .


7.3.6.2 The impact test shall take place within 2 min after removal from the cooling chamber. The ambient temperature shall be  $23 \pm 5^\circ\text{C}$ .



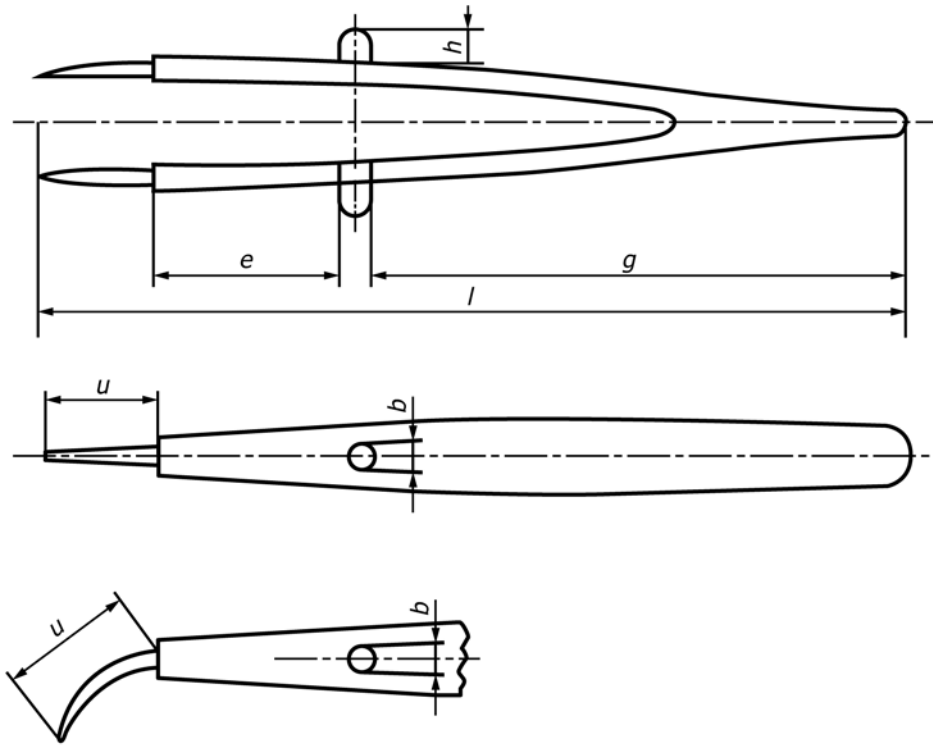

l = total length of the tweezers  
 g = length of the handle (grip)  
 b = width of the guard  
 h = height of the guard  
 e = insulated part of the handle between the guard and the working head  
 u = uninsulated part of the working head

FIG. 9 Example for Insulation of the Handles of Tweezers (see 5.5)

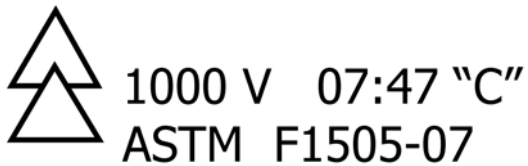

NOTE 1—The specific markings and the order of the markings may vary depending on the product.

FIG. 10 Example of Markings on Insulating Materials, Consisting of (see 5.6.2): The double triangle symbol, the voltage rating for the tool, an example of a manufacturer's date code (YR:WK), the low temperature (−40°C) symbol, and the relevant ASTM standard


7.3.6.3 Determine the fall height  $H$  as a function of its weight,  $P$ , so that the energy,  $W$ , of the impact on the tool to be tested shall be equal to that of the tool falling from a height of 0.6 m onto a hard surface.

$$H = (W)/(P) = (0.6 \times F)/(P) \quad (2)$$

where:

- $H$  = fall height of the hammer, m,
- $F$  = weight of the tool tested, N, and
- $P$  = weight of the hammer, N.

7.4 Dielectric Test Conditioning Before Testing—Condition the tools by total immersion in a bath of tap water at room

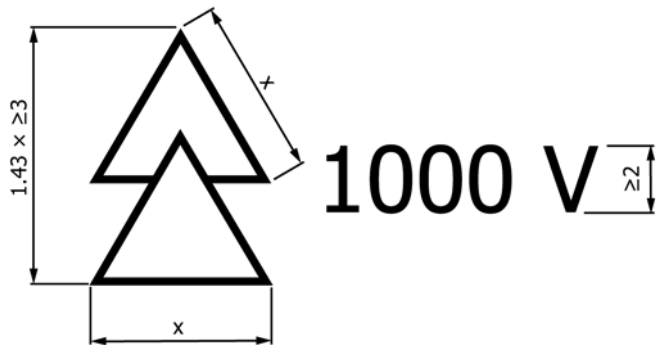

NOTE 1—Dimensions in millimetres.


NOTE 2—For the symbol, the exact ratio of the height of the figure to the base of the triangle is 1.43. For the purpose of convenience, this ratio can be between the values of 1.4 and 1.5.

FIG. 11 Suitable for Live Working Symbol: Double Triangle with Voltage Indication (see 5.6.3)

temperature ( $23 \pm 5^\circ\text{C}$ ) for a period of  $24 \pm 0.5$  h. The water shall have a minimum conductivity of  $100 \mu\text{S}/\text{cm}$ .

7.4.1 In the case of tools capable of being field assembled, the water immersion shall be replaced by a storage at a relative humidity between 91 % and 95 % at a temperature of  $23 \pm 5^\circ\text{C}$  for 48 h. Tools shall not be assembled prior to conditioning.

NOTE 3—This humidity may be obtained by storage in a closed

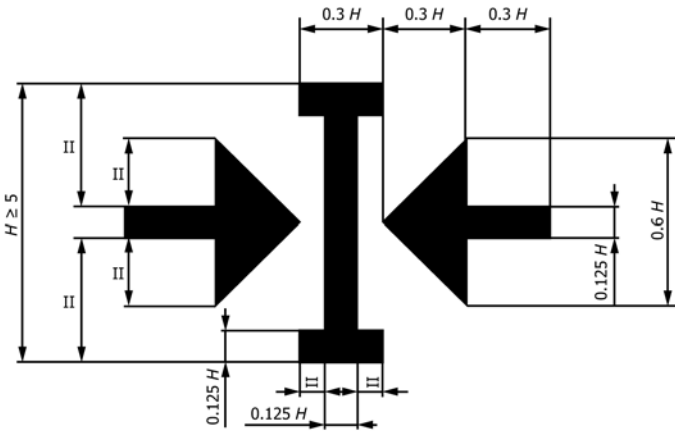

NOTE 1—Dimensions in millimetres.

**FIG. 12 Marking Symbol for Tools Capable of Being Assembled and Designed to be Interchangeable Between Different Manufacturers (see 5.6.5)**

chamber which contains a saturated solution of sodium sulfate decahydrate  $\text{Na}_2\text{SO}_4 \cdot 10\text{H}_2\text{O}$  (Glauber's salt) having a large exposed surface.

7.4.2 After this conditioning, wipe the tools dry and submit to the dielectric tests:

7.4.3 *Insulated Tools*—Immerse the sample tool with its insulated part in a bath of tap water to a level of  $24 \pm 2$  mm ( $1 \pm 1/16$  in.) from the nearest non-insulated part. The conductive part shall be above water level (see Fig. 15). The water shall have a minimum conductivity of 100  $\mu\text{S}/\text{cm}$ . The conductivity check shall be made before each Type or Batch test.

7.4.3.1 Test pliers and similar tools in such a position that the gap "d" between the two inner sides of the insulated handles is 2 to 3 mm ( $1/16$  to  $1/8$  in.), or the minimum possible by the tools construction, but not less than 2 mm ( $1/16$  in.) (see Fig. 15).

7.4.3.2 For tools capable of being field assembled, replace the water bath with a bath of 3 mm ( $1/8$  in.) diameter nickel stainless steel balls measured with normal industrial tolerances.

7.4.3.3 Continuously apply a voltage of 10 kV (rms) at commercial power frequencies for 3 min and measure the leakage current. This current shall be less than 1 mA for 200 mm (8 in.) of coated tool. This corresponds to a maximum value of the leakage current of:  $I = 5L$

where:

$I$  = leakage current rounded to the upper value, mA, and  
 $L$  = coated developed length in m (rounded to the lower value in centimeters).

NOTE 4—Appendix X1 gives examples of calculations of the developed length of coating and the limits of acceptable leakage current.

7.4.3.4 Test tools capable of being field assembled in all possible variations. Test tools with holding devices on both end positions, if applicable. The test is considered passed if no electrical puncture, sparkover, or flashover occurs during the test period, and the limits of the leakage current are not exceeded.

7.4.3.5 *Dielectric Tests of Tools Capable of Being Assembled with Square Drives (see 4.10.3)*—In case of tools capable of being assembled with square drives, the tools can be tested in separate parts, if the parts are assembled with

dummies described in Fig. 16. The dimensions and tolerances of the dummies shall be in accordance with Table 2. Dummy part 1 shall be assembled with female tool ends and dummy part 2 with male tool ends. On all single parts tested with dummies, the dielectric testing on the complete assembly is not required. The test shall be considered successful if no electrical puncture, sparkover or flashover occurs during the test period, and if the limits of leakage current are not exceeded.

7.4.4 *Insulating Tools—Dielectric Test Between the Working Head and the Handle (or Handles):*

7.4.4.1 Tools having a metallic working head shall be tested in accordance with 7.4.3.

7.4.4.2 *Tools Having No Exposed Metal Parts*—The purpose of this test is to check the dielectric quality of the material used for the handles. Electrodes (see Fig. 3) of conductive tape, foil, or conductive paint 5-mm ( $3/16$ -in.) wide are placed on the surface of the handles at  $24 \pm 2$ -mm ( $15/16 \pm 1/16$ -in.) spacing.

7.4.4.3 A voltage of 10 kV rms at commercial power frequencies shall be continuously applied for 3 min in accordance with Test Method D149 between each adjacent electrode. Measure the leakage current. The test is successful if no electrical puncture or flashover occurs during the test period, and if the leakage current measured is less than 0.5 mA multiplied by the number of spaces between the electrodes.

7.5 *Indentation Tests (for Insulated Tools):*

7.5.1 All parts of the insulated coating electrically tested in accordance with 7.4 shall pass this test. Perform the test on the most vulnerable part(s) for screwdrivers with insulated blades, and for other tools, at the external middle part of the handles.


7.5.2 If the radius,  $r$ , at the test point is greater than or equal to 10 mm ( $3/8$  in.), make the test with a test device in accordance with Fig. 17(a) in a heating chamber with natural ventilation. The part of the mass,  $m$ , that contacts the test piece shall be a stainless steel hemispheric nose piece of 5-mm ( $3/16$ -in.) diameter. The applied force  $F$  shall be 20 N (4.5 lbf).

7.5.3 If the radius,  $r$ , at the test point is less than 10 mm ( $3/8$  in.), use a rod of 4-mm ( $3/16$ -in.) diameter at least 30-mm ( $13/16$ -in.) length with the same force,  $F$ , of 20 N (4.5 lbf) placed at right angles to the tool axis (see Fig. 17(b)).

7.5.4 Position the tool in such a way that the insulating material coating at the test point is in a horizontal position. After setting up the testing device, hold the arrangement in accordance with Practice D618 ( $2\text{h}[\text{sol}]70^\circ\text{C}[\text{sol}]<20\%$ ). At the end of the heating time and after a cooling period outside the chamber of 5 min, apply a voltage of 5 kV rms at commercial power frequencies continuously between the testing device and the conductive part of the tool for 3 min in accordance with Test Method D149. The test is successful if no electrical puncture, sparkover, or flashover occurs during the test period.

7.6 *Test for Adhesion of the Insulating Material Coating for Insulated Tools:*

7.6.1 *Conditioning*—Condition the tools before the test in a heating chamber with normal ventilation at a temperature of  $70 \pm 3^\circ\text{C}$  for 168 h in accordance with Test Method D149. Perform the following tests at room temperature between the third and fifth minute after removal from the heating chamber in accordance with Practice D618.

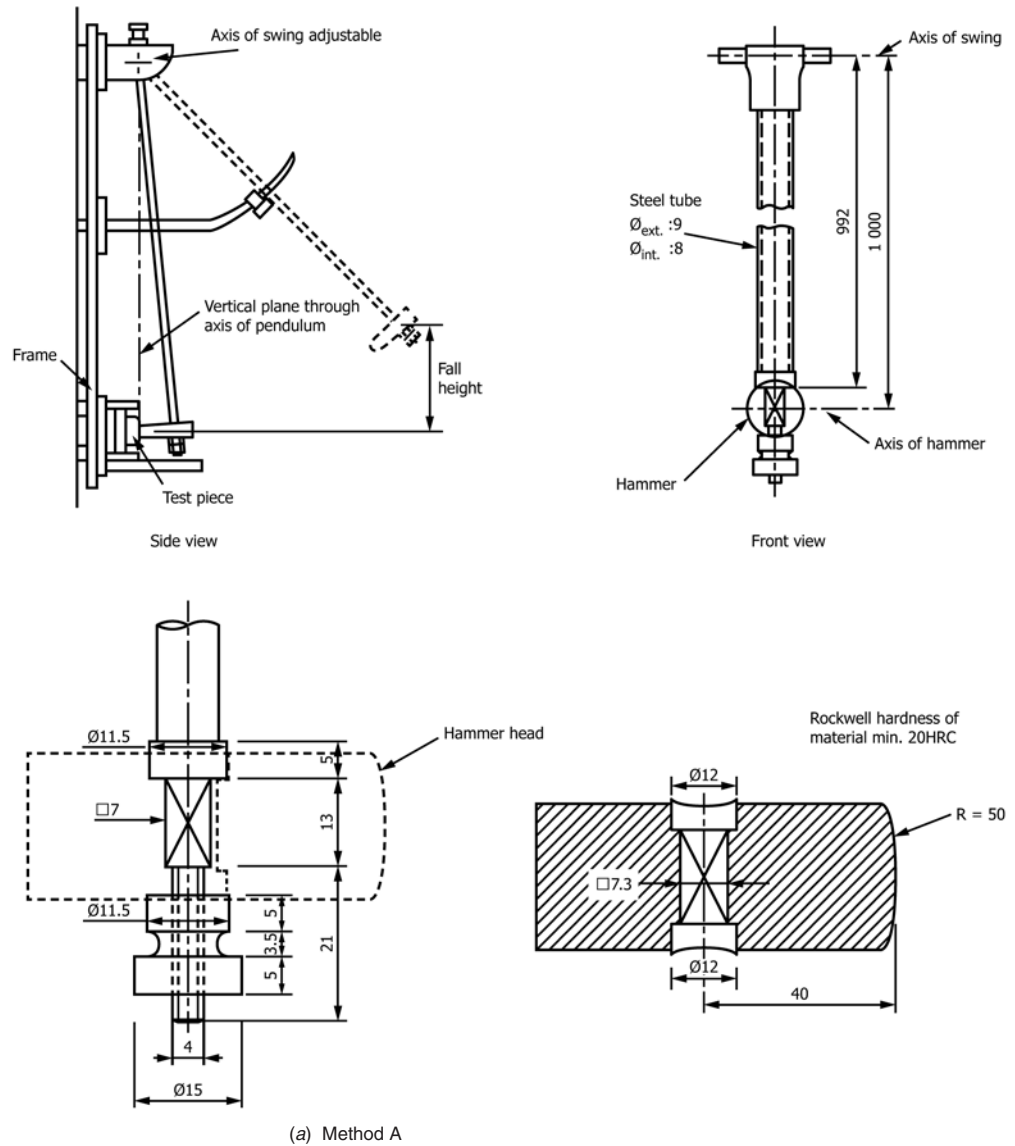

NOTE 1—Dimensions in millimetres.

FIG. 13 Example of Test Arrangements for the Low-Temperature Impact Test (see 7.3.1)

7.6.2 *Test on the Working Head*—Make the test on the following tools: wrenches, that is, open-end, box-end, and adjustable wrenches; any other tool with a covered working head; and, tools capable of being assembled, except for pieces acting as screwdrivers. The test may be carried out using either method in Fig. 18 and Fig. 19 respectively.

7.6.2.1 *Test Method A* (see Fig. 18)—Place a hook having a cutting edge of 5-mm ( $\frac{3}{16}$ -in.) width in such a manner that it does not touch the conductive part. Apply a force,  $F$ , of 50 N (11.25 lbf) in the direction of the line dividing the insulating material coating from the conductive part for 3 min.


7.6.2.2 *Test Method B* (see Fig. 19)—Place a device having the cutting edges, each of 5-mm ( $\frac{3}{16}$ -in.) width, on the working head in such a manner that they do not touch the conductive part. Apply a force,  $F$ , of 100 N (22.4 lbf) in the direction of the dividing line of the insulating material coating and the conductive part for 3 min.

7.6.2.3 Either test is considered passed if the insulating material coating does not move more than 3 mm ( $\frac{1}{8}$  in.) from its initial location on the conductive part, and if there is no breakage of the insulating material.

7.6.3 *Test on the Insulation of the Blade of Screwdrivers:*

7.6.3.1 Perform the test on a screwdriver with the testing apparatus as shown in Fig. 20. The penetration depth of the cutting edges of the testing apparatus shall not exceed 50 % of the thickness,  $t$ , of the insulating material coating. Place the cutting edges on the blade insulation 10 to 15 mm ( $\frac{3}{8}$  to  $\frac{5}{8}$  in.) from the point where the blade emerges from the handle or from the body of the tools capable of being assembled acting as screwdrivers.

7.6.3.2 If the cutting edges slide on the insulation, it is permissible to cut a groove up to 50 % of the thickness into the blade insulation to prevent movement.

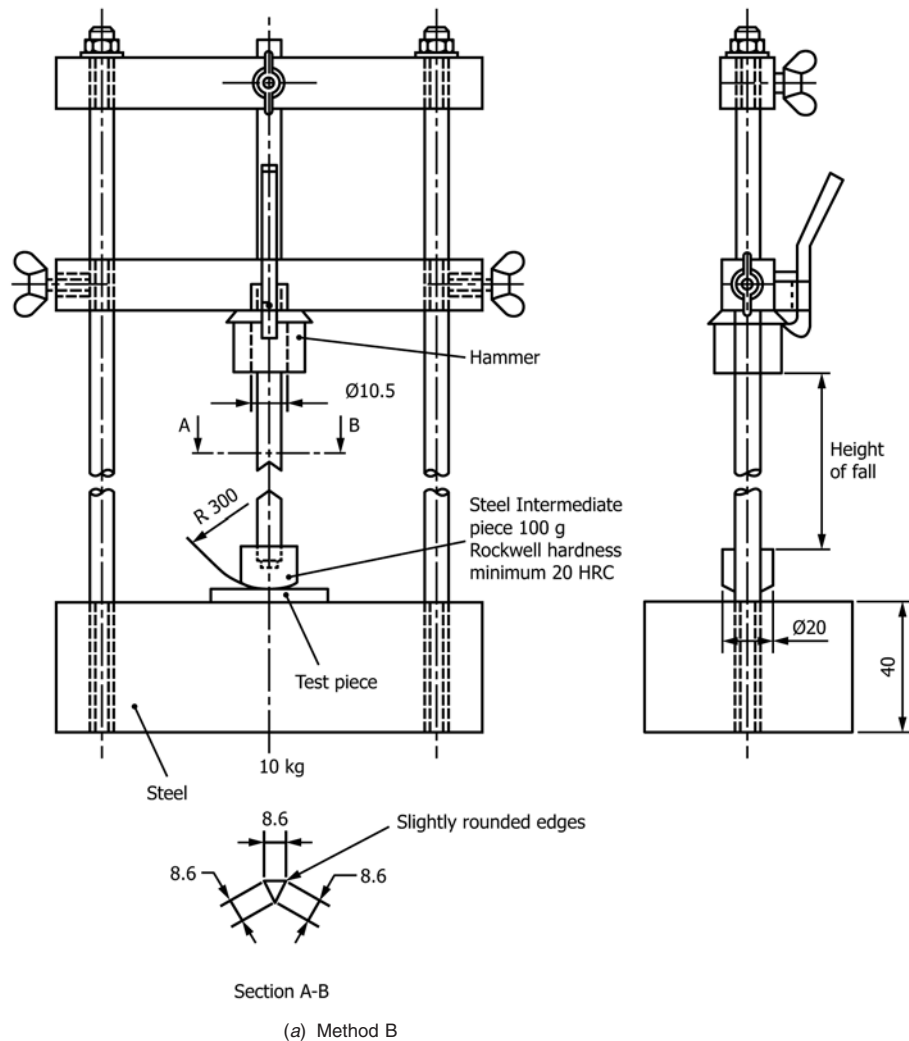

NOTE 1—Dimensions in millimetres.

FIG. 14 Example of Test Arrangements for the Low-Temperature Impact Test (see 7.3.1)

7.6.3.3 The force,  $F$ , in Newtons shall be equal to 35 times the blade diameter or 35 times the greatest dimension of the blade cross section in millimetres. The maximum force to be applied is 200 N. It shall be applied in the axial direction to the blade for 1 min.

7.6.3.4 The test is considered passed if the insulating coating does not move more than 3 mm ( $1/8$  in.) from its initial location on the conductive part and if there is no breakage of the insulating material.

7.6.4 *Test of Adhesion of the Insulation of the Complete Tool:*


7.6.4.1 Conduct the test on pliers, strippers, cable-cutting tools, cable scissors, and knives with the testing apparatus in accordance with Fig. 21. Apply the force,  $F$ , of 500 N (112.4 lbf) for 3 min.

7.6.4.2 The test is considered passed if the handle(s) remain firmly attached to the conductive part(s), and if the guard(s) remain firmly attached to the handle.

NOTE 5—Deformation of the insulation coating is not considered a failure.

7.6.5 *Test of Adhesion of Insulating Covers of Conductive Adjusting or Switching Elements*—A separating force of 50 N shall be applied to the cover in a possible separating direction by a suitable device for 3 min. The test shall be considered passed if the covers do not come off the elements they are insulating, if the function of the elements they are insulating is still given and if the dielectric test of 8.3 is passed after this test. Deformation of the covers due to this test is not considered a failure. If covers are used in areas that are not touched during work, this test need not be performed. Also, the test need not be performed where the design of the sealing elements does not allow application of a separating force.

7.7 *Flame Resistance Test*—Perform the test in a draft-free room. Clamp the sample in a horizontal position. Arrange a small burner in such a way that the axis of the burner nozzle and the axis of the handle of the tool are at right angles and form a vertical plane. The gas supply shall be technical grade methane gas with a suitable regulator and meter to produce a uniform gas flow.

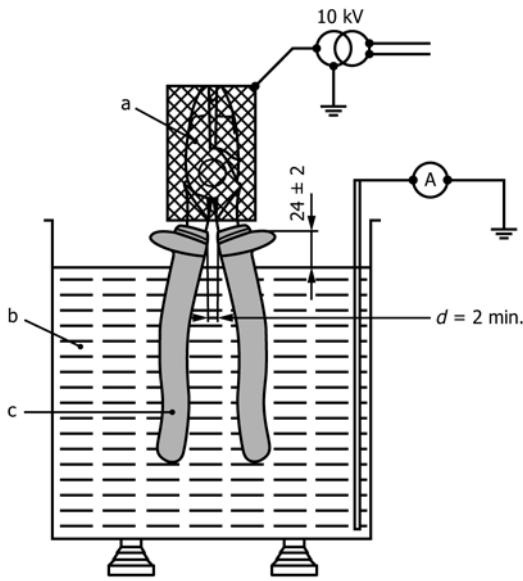

NOTE 1—Dimensions in millimetres.

NOTE 2—

- a = conductive working head,
- b = tap water bath,
- c = insulated part of the tool, and
- d = gap to be maintained between the two inner sides of the legs.

**FIG. 15 Electrical Testing Device for Insulated Tools (see 7.4.3 and 7.4.3.1)**

NOTE 6—If natural gas is used as an alternative to methane, its heat content should be approximately 37 MJ/m<sup>3</sup> that has been found to provide similar results.

7.7.1 The nozzle of the burner shall have a diameter of  $9.5 \pm 0.5$  mm ( $\frac{3}{8} \pm \frac{1}{32}$  in.) to produce a  $20 \pm 2$ -mm ( $\frac{3}{4} \pm \frac{1}{16}$ -in.) high blue flame. Place the burner remote from the sample and adjust in the vertical position to produce a blue flame  $20 \pm 2$  mm ( $\frac{3}{4} \pm \frac{1}{16}$  in.) high. The flame then is obtained by adjusting the gas supply and the air ports of the burner until a  $20 \pm 2$ -mm ( $\frac{3}{4} \pm \frac{1}{16}$ -in.) yellow-tipped blue flame is produced, then increase the air supply until the yellow tip disappears. Measure the height of the flame again, and correct if necessary.

NOTE 7—A burner conforming to Specification D5025 will meet these requirements.

7.7.2 Place the burner in the test position as shown in Fig. 22 with the axis of the flame being at right angles to that of the tool. At the start of the test, the tip of the testing flame should touch the insulating material at the lower part of the working head facing the sample (see Fig. 22). The horizontal reference line *d* of Fig. 22 at the level of the lower end of the insulating material, is the datum for measuring the flame height on the sample. If different types of insulating material are used for the same tool, conduct the test made on each individual type insulating material.

7.7.3 The testing flame shall act upon the specimen for 10 s. After this period, withdraw the testing flame. Ensure that no air draft interferes with the test. Observe the propagation of the flame on the sample for 20 s after the withdrawal of the testing flame. The test is considered passed if the flame height, *h*, on

the sample does not exceed 120 mm (4- $\frac{3}{4}$  in.) during the 20 s of the observation period and there are no drops of melted material.

7.8 Mechanical Tests:

7.8.1 Insulated Tools—The tools shall comply with all specific mechanical requirements of ANSI/ASME or ISO standards corresponding to the different types of tools. The manufacturers shall provide the certificates of these tests at the request of the customer.

7.8.2 Insulating Tools—Insulating tools specifically designed for live working may have lower stress resistance than insulated tools, but they shall withstand the expected work loads without failing due to remaining deformation or breaking (see Appendix X5).

7.8.2.1 Pliers and Nippers—Test these tools as follows:

(a) Bending Test of the Handles (see Fig. 23—A force, *F*, in Newtons shall be applied to the legs as indicated in Fig. 23 for 3 min. If *L* in millimeters is smaller than 100 mm (4 in.), *F* = 0.5 *L*; if *L* is equal to or greater than 100 mm (4 in.), *F* = 50 N. The test is considered passed if there is no break in any part of the tool and if the ends of the legs do not meet.

(b) Torque Test (see Fig. 24(b))—Connect the pliers by means of a test piece to a device capable of measuring the torque.

(c) In the case of flat nose pliers, the test piece shall be of steel, 12-mm ( $\frac{1}{2}$ -in.) wide and 3-mm ( $\frac{1}{8}$ -in.) thick. Insert into the jaws for a distance of  $6 \pm 1$  mm ( $\frac{1}{4} \pm \frac{1}{32}$  in.).

(d) In the case of round-nose pliers, the test piece shall have two parallel holes or grooves with center-axis and diameter adapted to allow the plier noses to be inserted to a depth of  $6 \pm 1$  mm ( $\frac{1}{4} \pm \frac{1}{32}$  in.). The edges of the holes or grooves shall be rounded. The test pieces shall have a hardness of at least 50 HRC. Tighten the legs of the pliers between the Points A and B, defined by the Length *b*, with force *P* equal to the force *F* indicated for the bending test. The force in *F* (Newtons) = 0.5 *L* (millimeters) with a maximum of 50 N (11.2 lbf).

(e) Hold correctly the handles of the pliers in order to be able to resist the torque.


(f) The test is considered passed if the tools withstand a torque of 5 N·m (3.7 ft·lb) without any visible permanent deformation.

7.8.2.2 Tweezers—A clamping force of 10 N shall be applied 10 mm behind the guard, clamping a test piece with a thickness of 2 mm, a width and length of 10 mm and a hardness of not less than 35 HRC. This stress shall not cause any permanent deformation.

7.9 Locking Test—Assemble tools that consist of more than one part in accordance with the manufacturer's instructions.

7.9.1 Tools With Spring-Loaded Balls—For tools capable of being assembled with spring-loaded balls, use the following values:

- 7.9.1.1 4 N (0.89 lbf) for the square drive of 6.3 mm ( $\frac{1}{4}$  in.),
- 7.9.1.2 11 N (2.7 lbf) for the square drive of 10 mm ( $\frac{3}{8}$  in.),
- 7.9.1.3 30 N (6.74 lbf) for the square drive of 12.5 mm ( $\frac{1}{2}$  in.), and
- 7.9.1.4 80 N (17.98 lbf) for the square drive exceeding 12.5 mm ( $\frac{1}{2}$  in.).

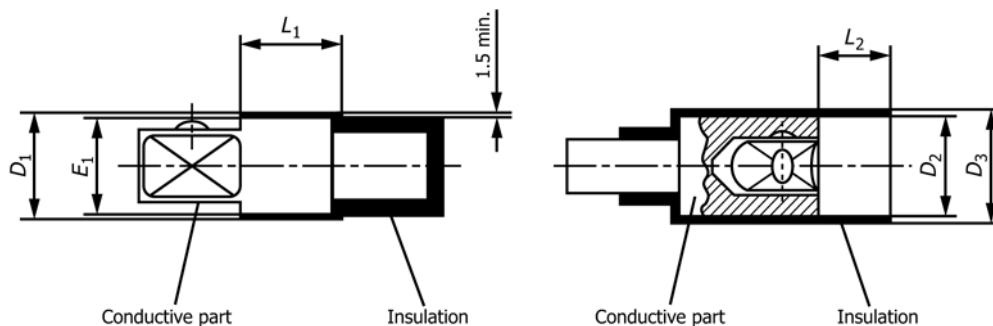

NOTE 1—Left figure—Dummy part 1 to be used with female tool ends.  
 Right figure—Dummy part 2 to be used with male tool ends.  
 Dimensions in millimetres.


FIG. 16 Description of Dummies for Electrical Tests for Tools Capable of Being Assembled with Square Drives (see 7.4.3.5)

TABLE 2 Dimensions and Tolerances for Dummies to be used for Dielectric Tests<sup>A</sup>

NOTE 1—Dimensions in millimetres.

Nominal size	$L_1 \pm 0.1$	$L_2 \pm 0.1$	$E_1 \pm 0.05$	$D_1 \pm 0.05$	$D_2 \pm 0.05$	$D_3 \pm 0.05$
6.3	19	16	8.4	11	14.5	16.5
10	19	16	12.7	16	19.5	21.5
12.5	19	16	16.9	29	23.5	25.5
20	19	16	25.4	30.5	34.5	35.6

<sup>A</sup> $L_1, L_2, E_1, D_1, D_2$  and  $D_3$  are described in Fig. 16

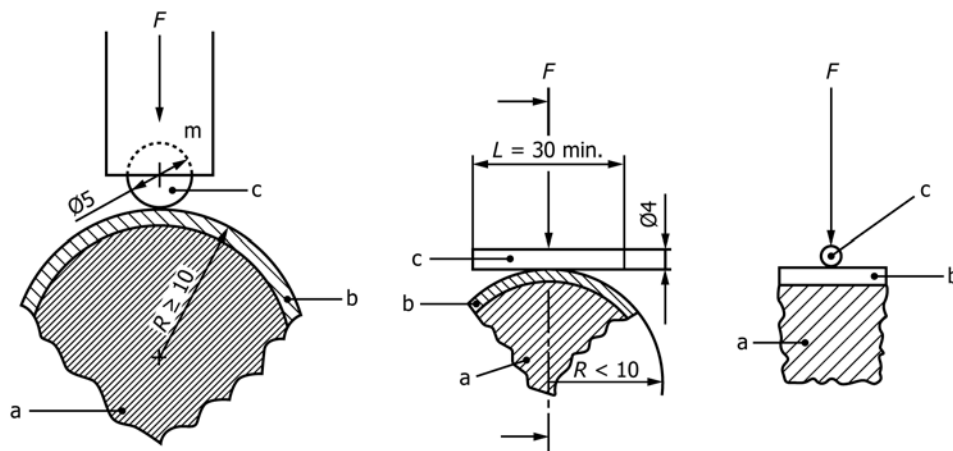

NOTE 1—Left figure—(a) Radius at the Test Point of the Tool  $\geq 10$  mm.

Right figure—(b) Radius at the Test Point of the Tool  $< 10$  mm.

Dimensions in millimetres.

NOTE 2—For Fig. 15(a):

a = conductive part,

b = insulation (test point),

c = hemispheric nose-piece,

R = radius at the test point of the tool, and

m = testing mass.

NOTE 3—For Fig. 15(b):

a = conductive part,

b = insulation (test point),

c = rod, and


R = radius at the test point of the tool.

FIG. 17 Indentation Test (see 7.5.2 and 7.5.3)

7.9.2 Tools With Screwed Fittings—In the case of screwed fittings, use a load of 500 N (112 lbf).

7.9.3 Procedure:

7.9.3.1 Maintain the tool in such a position that the dismantling direction of the detachable part is vertical and downwards.

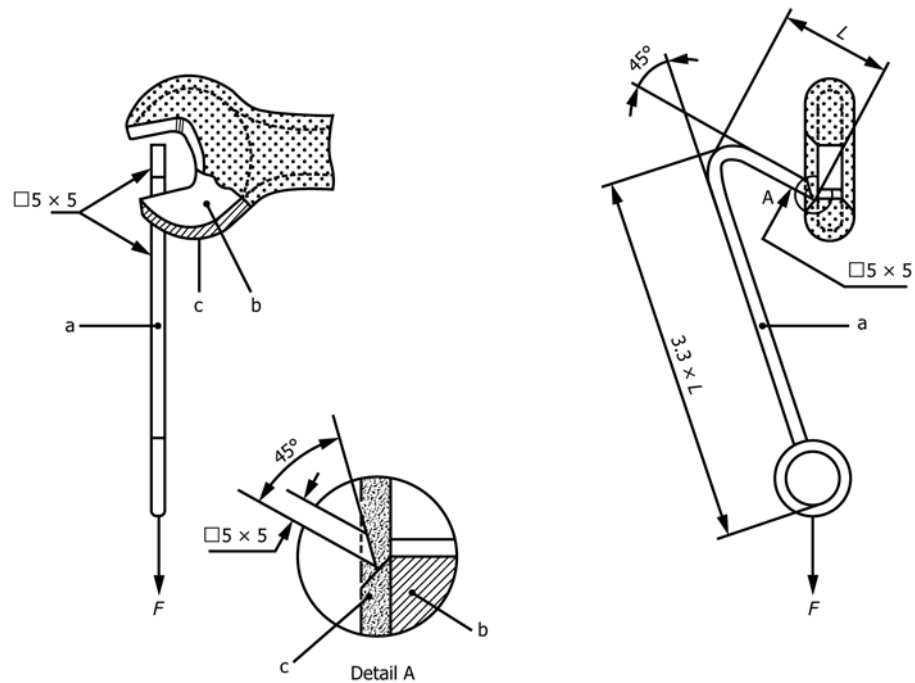

(a) Method A—Test on the Working Head

NOTE 1—Dimensions in millimetres.

NOTE 2—

a = hook (the length of the leg depends on the size of the tool),

b = conductive parts,

c = insulating material coating, and

l = length of the short arm of the hook.

**FIG. 18 Principle of the Testing Device for Checking Adhesion of the Insulating Coating on Metallic Parts of the Tool (see 7.6.2 and 7.6.2.1)**

7.9.3.2 Gradually apply the load along the dismantling direction to reach the value given in 7.9.1 and 7.9.2 within 2 s. Hold for 1 min. The test is considered passed if the assembly does not come apart.

7.10 *Durability of Marking*—Rub the tools for 15 s with a rag soaked in water and then for 15 s with a rag soaked in mineral spirits. After this rubbing, the markings shall still be legible.

## 8. Routine Tests

8.1 Routine tests are performed to detect critical defects.

8.2 *Visual Check*—Visually check the tool according to 7.2.1. Tools failing the visual inspection shall be either repaired or rejected.

8.3 *Dielectric Test*—Test tools in accordance with 7.4, but with the following modifications:

8.3.1 Conditioning as specified in 7.4 is not necessary.

8.3.2 The test time shall be 10 s after reaching the specified voltage.

8.3.3 The leakage current measurement shall not be carried out.

8.3.4 The distance of the water level (or ball level) from the nearest exposed metal part shall be 24 mm + 4 / - 2 mm (1 in. + 1/8 / - 1/16 in.).

8.4 Test tools capable of being assembled either as a complete assembly or as separate parts.

8.4.1 The test method used shall be equivalent to the requirements for surface contact in accordance with 7.4.3.

8.5 Tools failing dielectric tests shall be rejected. Rejected tools shall be either destroyed or rendered unsuitable for use.

## 9. Sampling Tests

9.1 The sampling procedure shall be based on the type test procedures in conformance with Appendix X3.

## 10. Acceptance Test


10.1 The customer shall specify these tests in the contract with the manufacturer (see Appendix X2).

10.2 The manufacturer shall keep records of all tests in accordance with the manufacturer's quality control procedures, for inspection by a prospective customer.

10.3 Records also shall be kept of any additional tests requested by the customer.

## 11. Quality Assurance Plan

11.1 In order to ensure the delivery of products that meet this specification, the manufacturer shall employ an approved quality assurance plan that complies with the provisions of ISO 9000 series.

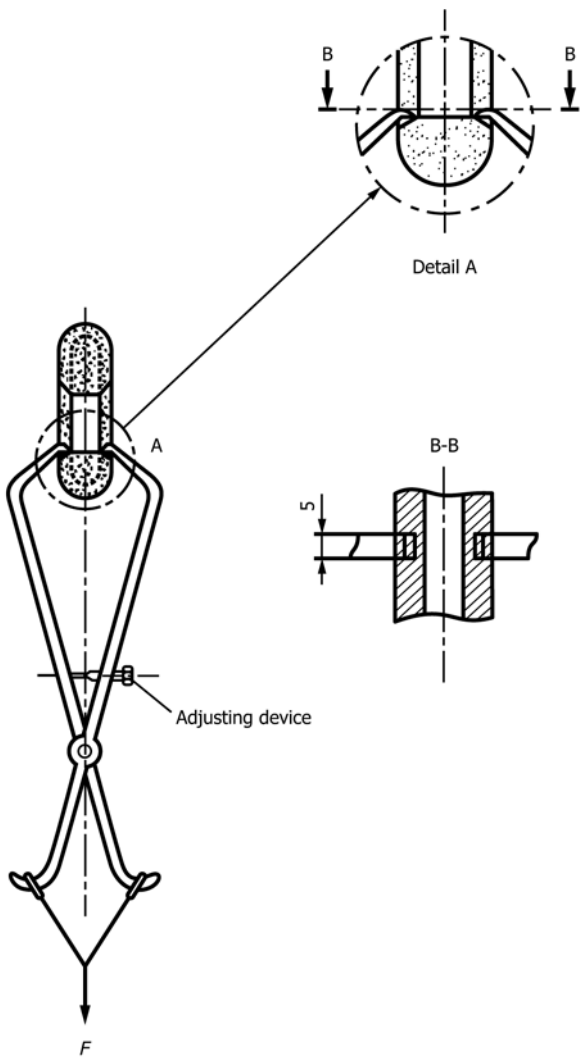


(a) Method B—Test on the Working Head

NOTE 1—Dimensions in millimetres.

**FIG. 19 Principle of the Testing Device for Checking Adhesion of the Insulating Coating on Metallic Parts of the Tool (see 7.6.2 and 7.6.2.2)**

11.2 The quality assurance plan shall ascertain that the product meets the requirements contained in this specification.

11.3 At a minimum, the sampling procedure contained in this specification shall be carried out (see [Appendix X3](#)).

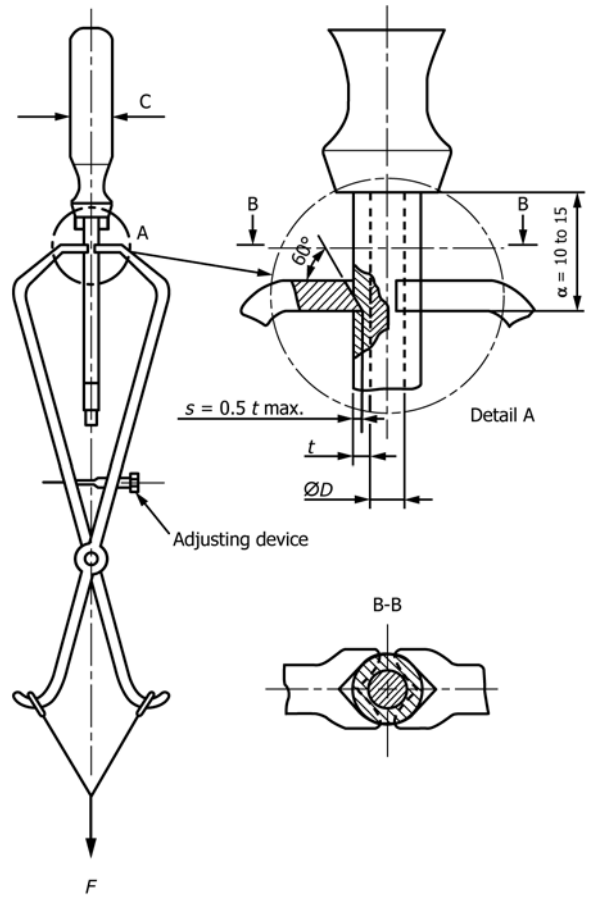

NOTE 1—Dimensions in millimetres.

NOTE 2— $s$  = depth of penetration ( $s = 0.5 t \text{ max.}$ ),  
 $t$  = thickness of the insulating material coating,  
 $F$  = testing force, and

$a$  = spacing between the point where the blade comes out of the handle and the cutting edge of the testing appliance.


**FIG. 20 Testing Device for Checking Adhesion of the Insulating Coating of Screwdrivers on Conductive Parts and the Handle (see 7.6.3.1)**

## 12. In-Service Care

12.1 Other instructions, such as inspection criteria, test methods and frequency shall be provided by the manufacturer.


12.2 Field inspection, cleaning and proper storage shall be performed by the user (see [Appendix X4](#)).



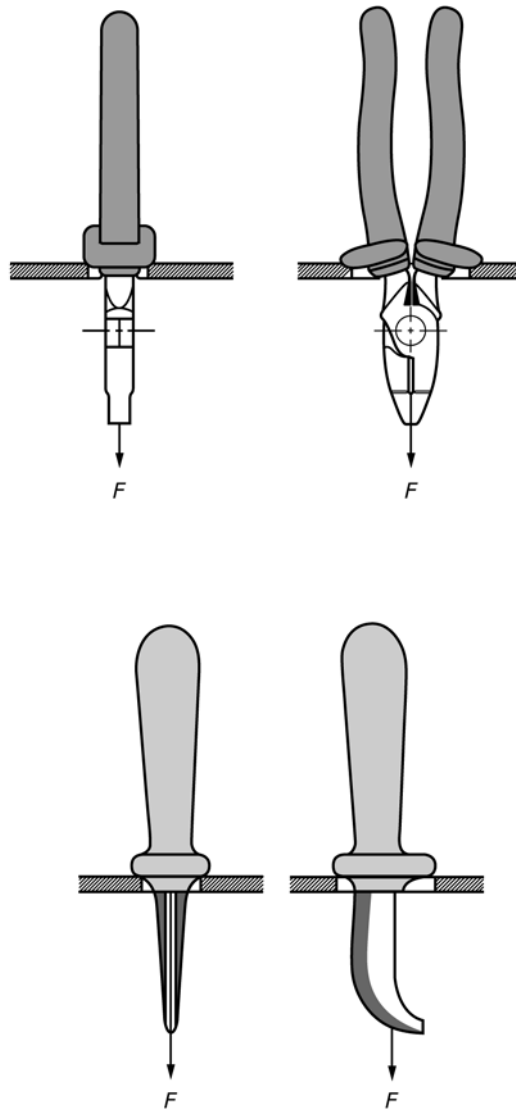

- (a) Pliers
- (b) Knife

FIG. 21 Examples of Mountings for Checking Stability of Adhesion of the Insulation of the Entire Tool (see 7.6.4.1)

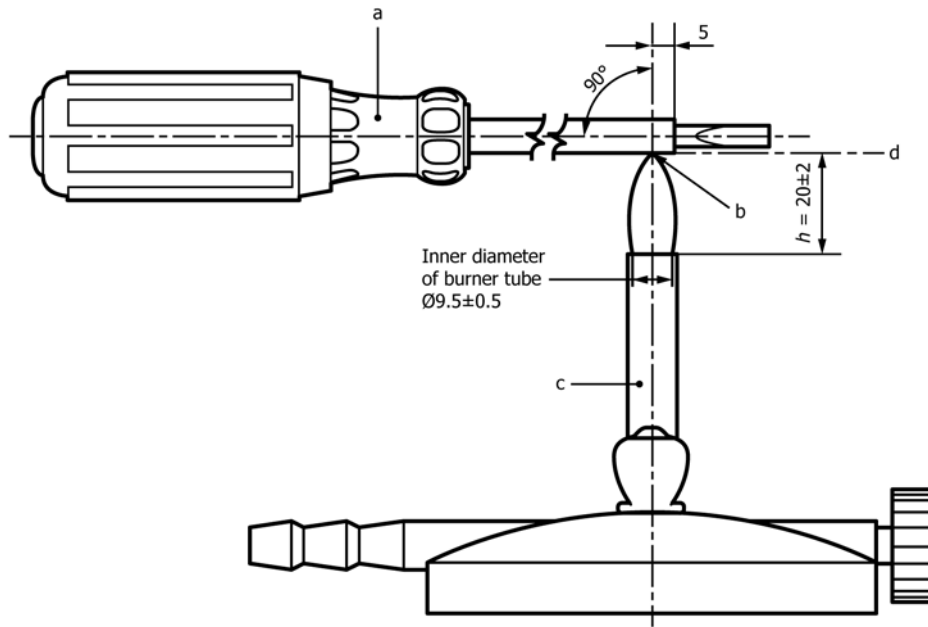


NOTE 1—Dimensions in millimetres.

NOTE 2—


- a = test piece,
- b = tip of the flame,
- c = burner,
- d = horizontal reference line, and
- e = maximum flame height, h.

FIG. 22 Example of a Flame Retardancy Test Arrangement (see 7.7.2)

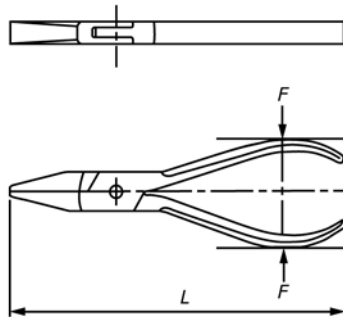

NOTE 1— $F$  (newtons) =  $0.5 L$  (mm), with a maximum of 50 N.

FIG. 23 Insulating Pliers—Bending Test on Legs (see 7.8.2.1)

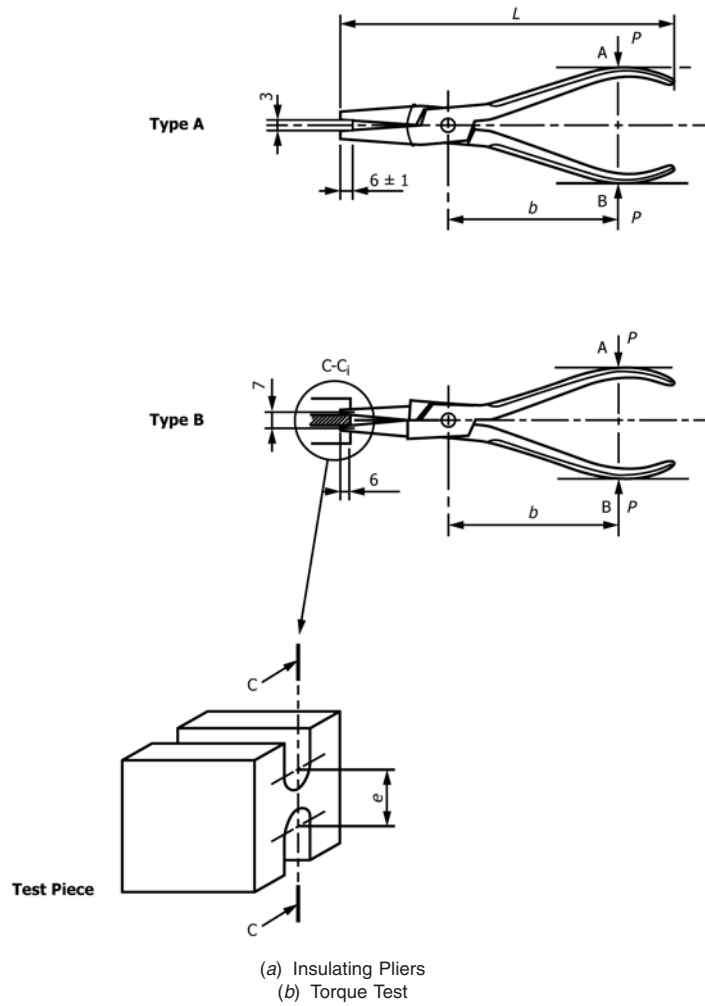

NOTE 1—Dimensions in millimetres.

NOTE 2— $e$  = the distance between the axis of the holes depends on the dimensions of the nose.

NOTE 3— $P = F$  (newtons) =  $0.5 L$  (mm) with a maximum of 50 N.

**FIG. 24 Insulating Pliers—Torque Test (see 7.8.2.1)**

APPENDIXES

(Nonmandatory Information)

X1. EXAMPLES OF CALCULATION OF THE DEVELOPED LENGTH OF COATING AND ACCEPTABLE LEAKAGE CURRENT

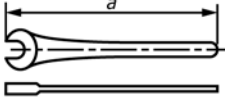
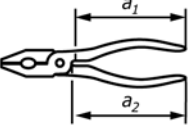
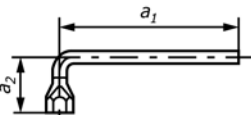
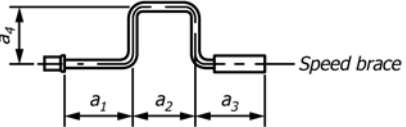
Designations	Developed length of coating $L$	Limits of acceptable leakage current $I_M = 5 L$
 <p>Engineers' wrench, single head</p>	$L = a$ Example for a 22 mm wrench $L = a = 0.20 \text{ m}$	$5 L = 1$  $I_M = 1 \text{ mA}$
 <p>All-purpose pliers</p>	$L = a_1 + a_2 = 2a_1$ Example: $a_1 = a_2 = 0.14 \text{ m}$ $L = 0.28 \text{ m}$	$5 L = 1.4$ rounded to $I_M = 2 \text{ mA}$
 <p>Socket wrench, single head</p>	$L = a_1 + a_2$ Example: $a_1 = 0.30 \text{ m}$ $a_2 = 0.10 \text{ m}$ $L = 0.40 \text{ m}$	$5 L = 2$  $I_M = 2 \text{ mA}$
 <p>Speed brace</p>	$L = a_1 + a_2 + a_3 + 2a_4$ Example: $a_1 = 0.30 \text{ m}$ $a_2 = 0.15 \text{ m}$ $a_3 = 0.15 \text{ m}$ $a_4 = 0.25 \text{ m}$ $L = 1.10 \text{ m}$	$5 L = 5.50$ rounded to $I_M = 6 \text{ mA}$

FIG. X1.1 Example

## X2. ACCEPTANCE TESTS

X2.1 An acceptance test is a contractual test to prove to the customer that the device meets certain conditions of its specification. These tests may be carried out on every unit (routine tests) or on a sampling of the units (sampling tests).

X2.2 If a customer indicates in this specification that the device must meet this specification only, the acceptance tests are those (both routine and sampling), which are specified in this specification.

X2.3 The customer however, may ask for additional tests or modify the sampling size. These modifications must be included in their specification.

X2.4 The customer may wish to witness the tests, have someone witness them, or simply accept the results of the tests as carried out by the manufacturer. It may be specified that the tests be carried out in an independent laboratory of the customer's choosing or even in his own laboratory.

## X3. SAMPLING PROCEDURE

### X3.1 General

X3.1.1 Sampling tests shall be done in accordance with and in the sequence described in Section 7.

### X3.2 Classification of Defects

X3.2.1 Defects are classified as major or minor. **Table X3.1** gives the nature of defects in relation with the tests specified for the sampling procedure.

### X3.3 General Sampling Plan

X3.3.1 *Plans for Major Defects*—For major defects, **Table X3.2** is limited to 35 000 units. For lots equal to or larger than 35 001, use other test lots less than 35 000 according to **Table X3.2**.

**TABLE X3.1 Classification of Defects**

Description of Test	Section	Minor Defect	Major Defect
Dimensional	7.2	X	
Impact	7.3		X
Dielectric	7.4		X
Indentation	7.5	X	
Adhesion	7.6		X
Flame retardancy	7.7	X	
Mechanical	7.8	X	
Locking	7.9	X	
Durability of marking	7.10	X	

**TABLE X3.2 Major Defects**

Batch or Lot Size	Sample Size	Acceptance Number	Rejection Number
Up to 15	2	0	1
16–50	3	0	1
51–150	5	0	1
151–500	8	0	1
501–3200	13	1	2
3201–35000	20	1	2

**TABLE X3.3 Minor Defects**

Batch or Lot Size	Sample Size	Acceptance Number	Rejection Number
Up to 50	2	0	1
51–500	3	0	1
501–35000	5	0	1

X3.3.2 *Plans for Minor Defects*—For minor defects, **Table X3.2** is limited to 35 000 units. For lots equal to or larger than 35 001, use other test lots less than 35 000 according to **Table X3.3**.

## X4. RECOMMENDATION FOR USE AND IN-SERVICE CARE

X4.1 This appendix is for guidance only for the maintenance, inspection, retest, and use of hand tools after purchase.

X4.1.1 *Storage*—Insulated or insulating hand tools should be stored properly to minimize risk of damage to the insulation due to storage or transportation. These tools should be stored generally separated from other tools to avoid mechanical damage or confusion. Furthermore, these tools should be protected from excessive heat (for example heating or steam pipes) as well as UV-radiation.

X4.1.2 *Inspection Before Use*—Before each use, the hand tool should be inspected visually by the user. If there is any

doubt concerning the safety of the tool it should either be scrapped or subject to examination by a competent person and retested if necessary.

X4.1.3 *Temperature*—According to their compatibility, tools should be used only in areas having ambient temperature between  $-20$  and  $+70^{\circ}\text{C}$  and, for tools marked “C”, between  $-40$  and  $+70^{\circ}\text{C}$ .

X4.1.4 *Periodic Examination and Electrical Retesting*—An annual visual examination by a competent person is recommended to determine the suitability of the tool for further service. In case of doubt after visual examination, the prescribed dielectric test shall apply (see 8.3).

X4.1.5 *Cleaning*—Keep the insulated portion of the tools clean, dry and free of surface contaminants. Clean and lubricate tools as needed according to the manufacturer’s recommendations.

## X5. MECHANICAL STRENGTH OF INSULATING TOOLS

### INTRODUCTION

Hand tools complying with ANSI/ASME or ISO standards are often tested with test loads for beyond loads that can really be applied by hand. Among the reasons for this are:

- the application of these universal tools is not always known in detail, and
- such tools are required to resist various improper uses that are to be expected, without failing and endangering the user.

For live working, the workers have to have a much better training level, and the applications of some tools are very well defined. The following informative proposals are based on loads that can be applied by hand only and under regular conditions.

Insulating tools specially designed for live working applications may have lower stress resistance than insulated tools, if they withstand the expected work loads without failing due to permanent deformation or breaking.

#### X5.1 General

X5.1.1 To check the ability of insulating tools to withstand the expected maximum workloads specified in X5.1 to X5.4, tests should be performed in accordance with the test procedures defined in ANSI/ASME or ISO standards for similar insulated tools. If such ANSI/ASME or ISO standards do not exist, test may be specified by the manufacturer or by the customer.

X5.1.2 If insulating tools are equipped with devices that limit the workloads that can be applied with them, for example overload slipping clutches, these limiting devices are activated before these tools reach the test loads specified hereafter.

#### X5.2 Insulating Screwdrivers

X5.2.1 See **Table X5.1**.

**TABLE X5.1 Torque Values for Insulating Screwdrivers**

Blade Diameter mm	Test Torque N·m
More than 8.0	10
6.5 to 7.9	8.0
5.5 to 6.4	5.5
4.5 to 5.4	4.5
4.0 to 4.4	2.5
3.5 to 3.9	1.3
3.0 to 3.4	0.7
2.5 to 2.9	0.4
Up to 2.4	0.3

#### X5.3 Insulating Wrenches and Ratchets

X5.3.1 Wrenches and ratchets: maximum hand force = 500 N.

X5.3.2 The force is applied 35 mm away from the outer extremities of the handles right angled to the axle of the work piece to be turned.

#### X5.4 Insulating T-wrenches

X5.4.1 T-wrenches: maximum hand force = 250 N.

X5.4.2 The force is applied simultaneously on both handles in opposite directions, 35 mm away from the outer extremities of the handles right angled to the axle of the work piece to be turned.

#### X5.5 Insulating Pliers and Cable Shears

X5.5.1 A hand load test in accordance with ISO 5744 should be performed with a hand load of 500 N.

X5.5.2 The load is to be applied 35 mm away from the outer extremities of the handles squeezing the handles.

X5.5.3 A torsion test in accordance with ISO 5744 should be performed for gripping pliers with a flat nose. The hand force for clamping is to be 350 N, applied 35 mm away from the outer extremities of the handle. The torque to be applied is 4 N·m. The maximum permissible twist angle at the torque is 20°.

## SUMMARY OF CHANGES

Committee F18 has identified the location of selected changes to this standard since the last issue (F1505-10(2015)) that may impact the use of this standard.

- (1) Added further definition to ‘major defect’ and ‘minor defect’ (see 3.2.3 and 3.2.4).
- (2) Updated the exposed tip requirement for screwdrivers (see 5.1.1).
- (3) Added a new section covering folding rules (see 5.2).
- (4) Added a new section for scissors (see 5.3.6).
- (5) Added a minimum conductivity requirement for the water bath (see 7.4).
- (6) Corrected the developed length of the speed brace example in Fig. X1.1.
- (7) Confirmed Table X3.2 is AQL 2.5 - Special Inspection Level S-3, and revised Table X3.3 to AQL 4.0 – Inspection Level S-1.

*ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.*

*This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.*

*This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org). Permission rights to photocopy the standard may also be secured from the Copyright Clearance Center, 222 Rosewood Drive, Danvers, MA 01923, Tel: (978) 646-2600; <http://www.copyright.com/>*