

BS EN 62047-14:2012



BSI Standards Publication

Semiconductor devices — Micro-electromechanical devices

Part 14: Forming limit measuring method
of metallic film materials

bsi.

...making excellence a habit.™

National foreword

This British Standard is the UK implementation of EN 62047-14:2012. It is identical to IEC 62047-14:2012.

The UK participation in its preparation was entrusted to Technical Committee EPL/47, Semiconductors.

A list of organizations represented on this committee can be obtained on request to its secretary.

This publication does not purport to include all the necessary provisions of a contract. Users are responsible for its correct application.

© The British Standards Institution 2012

Published by BSI Standards Limited 2012

ISBN 978 0 580 72297 4

ICS 31.080.99

Compliance with a British Standard cannot confer immunity from legal obligations.

This British Standard was published under the authority of the Standards Policy and Strategy Committee on 31 May 2012.

Amendments issued since publication

Amd. No.	Date	Text affected
-----------------	-------------	----------------------

EUROPEAN STANDARD
 NORME EUROPÉENNE
 EUROPÄISCHE NORM

EN 62047-14

April 2012

ICS 31.080.99

English version

**Semiconductor devices -
 Micro-electromechanical devices -
 Part 14: Forming limit measuring method of metallic film materials
 (IEC 62047-14:2012)**

Dispositifs à semiconducteurs -
 Dispositifs microélectromécaniques -
 Partie 14: Méthode de mesure des limites
 de formage des matériaux à couche
 métallique
 (CEI 62047-14:2012)

Halbleiterbauelemente -
 Bauelemente der Mikrosystemtechnik -
 Teil 14: Verfahren zur Ermittlung der
 Grenzformänderung metallischer
 Dünnschichtwerkstoffe
 (IEC 62047-14:2012)

This European Standard was approved by CENELEC on 2012-04-03. CENELEC members are bound to comply with the CEN/CENELEC Internal Regulations which stipulate the conditions for giving this European Standard the status of a national standard without any alteration.

Up-to-date lists and bibliographical references concerning such national standards may be obtained on application to the CEN-CENELEC Management Centre or to any CENELEC member.

This European Standard exists in three official versions (English, French, German). A version in any other language made by translation under the responsibility of a CENELEC member into its own language and notified to the CEN-CENELEC Management Centre has the same status as the official versions.

CENELEC members are the national electrotechnical committees of Austria, Belgium, Bulgaria, Croatia, Cyprus, the Czech Republic, Denmark, Estonia, Finland, France, Germany, Greece, Hungary, Iceland, Ireland, Italy, Latvia, Lithuania, Luxembourg, Malta, the Netherlands, Norway, Poland, Portugal, Romania, Slovakia, Slovenia, Spain, Sweden, Switzerland, Turkey and the United Kingdom.

CENELEC

European Committee for Electrotechnical Standardization
 Comité Européen de Normalisation Electrotechnique
 Europäisches Komitee für Elektrotechnische Normung

Management Centre: Avenue Marnix 17, B - 1000 Brussels

Foreword

The text of document 47F/108/FDIS, future edition 1 of IEC 62047-14, prepared by SC 47F, "Micro-electromechanical systems", of IEC TC 47, "Semiconductor devices" was submitted to the IEC-CENELEC parallel vote and approved by CENELEC as EN 62047-14:2012.

The following dates are fixed:

- latest date by which the document has to be implemented at national level by publication of an identical national standard or by endorsement (dop) 2013-01-03
- latest date by which the national standards conflicting with the document have to be withdrawn (dow) 2015-04-03

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. CENELEC [and/or CEN] shall not be held responsible for identifying any or all such patent rights.

Endorsement notice

The text of the International Standard IEC 62047-14:2012 was approved by CENELEC as a European Standard without any modification.

Annex ZA
(normative)
**Normative references to international publications
with their corresponding European publications**

The following documents, in whole or in part, are normatively referenced in this document and are indispensable for its application. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

NOTE When an international publication has been modified by common modifications, indicated by (mod), the relevant EN/HD applies.

<u>Publication</u>	<u>Year</u>	<u>Title</u>	<u>EN/HD</u>	<u>Year</u>
IEC 62047-1	2005	Semiconductor devices - Micro-electromechanical devices - Part 1: Terms and definitions	EN 62047-1	2006

CONTENTS

1	Scope.....	5
2	Normative references	5
3	Terms, definitions and symbols	5
3.1	Terms and definitions	5
3.2	Symbols	6
4	Testing method.....	6
4.1	General	6
4.2	Equipment	6
4.3	Specimen	7
5	Test procedure and analysis.....	8
5.1	Test procedure	8
5.2	Data analysis	9
6	Test report.....	10
	Annex A (informative) Principles of the forming limit diagram	11
	Annex B (informative) Grid marking method.....	13
	Annex C (informative) Gripping method	15
	Annex D (informative) Strain measuring method	17
	Figure 1 – Equipment and tools for forming limit tests.....	7
	Figure 2 – Rectangular specimens with six kinds of aspect ratio	8
	Figure 3 – Strain for forming limit measurement.....	9
	Figure 4 – Construct the forming limit diagram by plotting the major and minor strains	9
	Figure A.1 – Forming limit diagram	11
	Figure A.2 – Hemispherical punch for forming limit measurement	11
	Figure A.3 – Grid for forming limit measurement	12
	Figure A.4 – Loading path of the specimen with various aspect ratios	12
	Figure B.1 – Procedure of a photographic grid marking method	13
	Figure B.2 – Procedure for an inkjet grid marking method.....	14
	Figure C.1 – Gripping of the specimen using a ring shaped die.....	15
	Figure C.2 – Gripping of the specimen using adhesive bonding	16
	Figure D.1 – Set up for strain measurement using digital camera.....	17
	Figure D.2 – Example of pixel converting image of deformed specimen	17
	Table 1 – List of letter symbols	6

SEMICONDUCTOR DEVICES – MICRO-ELECTROMECHANICAL DEVICES –

Part 14: Forming limit measuring method of metallic film materials

1 Scope

This part of IEC 62047 describes definitions and procedures for measuring the forming limit of metallic film materials with a thickness range from 0,5 μm to 300 μm . The metallic film materials described herein are typically used in electric components, MEMS and micro-devices.

When metallic film materials used in MEMS (see 2.1.2 of IEC 62047-1:2005) are fabricated by a forming process such as imprinting, it is necessary to predict the material failure in order to increase the reliability of the components. Through this prediction, the effectiveness of manufacturing MEMS components by a forming process can also be improved, because the period of developing a product can be reduced and manufacturing costs can thus be decreased. This standard presents one of the prediction methods for material failure in imprinting process.

2 Normative references

The following documents, in whole or in part, are normatively referenced in this document and are indispensable for its application. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

IEC 62047-1:2005, *Semiconductor devices – Micro-electromechanical devices – Part 1: Terms and definitions*

3 Terms, definitions and symbols

3.1 Terms and definitions

For the purposes of this document, the terms and definitions given in IEC 62047-1 and the following apply.

3.1.1

circular grid

grid used for measuring the localized deformation of the specimens within the circle

3.1.2

grid patterns

pattern marked on the surface of the testing material permitting immediate and direct measurement of the formability for the metallic film materials

Note 1 to entry The grid consists of a pattern of small circles or rectangles.

3.1.3

major axis

longest line of the deformed elliptical shape, which passes through both foci of the ellipse

3.1.4

minor axis

longest line of the deformed elliptical shape, which is perpendicular to the major axis

3.1.5

square grid

grid used for measuring the overall deformation of the testing material

3.2 Symbols

For the purpose of this document, letter symbols given in Table 1 are used.

Table 1 – List of letter symbols

Name and designation	Letter symbol
Grid size	
– initial diameter of the grid before deformation	d_0
– diameter of the grid along the major axis after deformation	d_1
– diameter of the grid along the minor axis after deformation	d_2
Strain	
– major strain	ε_1
– minor strain	ε_2
Equipment, tool and specimen size	
– diameter of the hemispherical punch	D_{punch}
– inner diameter of the die hole	D_{die}
– diameter of the bead ring	D_{bead}
– fillet radius of the upper die edge	r_{de}
– thickness of the testing specimen	t
– height of the testing specimen	h
– width of the testing specimen	w

4 Testing method

4.1 General

The forming limit diagram (FLD) is determined by pressing the micro film material using a hemispherical punch. This pressing process is performed until the film material fractures. The major and minor strains of a deformed specimen can be measured in many ways, for example, by using a digital camera module or an optical device. However, using a digital camera module with sufficient resolution and a high magnifying power lens is recommended.

NOTE See Annex A for principles of forming limit diagram.

4.2 Equipment


Micro press equipment is utilized as the loading equipment for FLD tests as described in Figure 1. A hemispherical punch is attached to the micro press to stretch the film material to measure the forming limits of the specimen. Conventional hard chrome coating to the punch surface using hexavalent chromium is recommended to guarantee a surface roughness less than 0,8 μm (RMS: Root Mean Square). In addition, lubricants such as graphite can be applied for reducing the friction force between the surfaces of the punch and the specimen. The movement of the punch is controlled by a constant crosshead speed of the measuring devices in the micro press. The punch speed shall be lowered to the quasi-static condition. A punch speed of less than 20 $\mu\text{m/s}$ is recommended in order not to result in the dynamic inertia

effect during the test. Although the dimension of the hemispherical punch and the test samples can be varied with forming product and inspected measuring region, it is recommended that the dimension should be determined as the following ratio.

$$D_{\text{die}} = D_{\text{punch}} + 2,5t \quad (1)$$

$$D_{\text{bead}} = 2 \times D_{\text{punch}} \quad (2)$$

It is also recommended that the hemispherical punch diameter and the die edge radius should be 5 mm and 0,5 mm respectively.

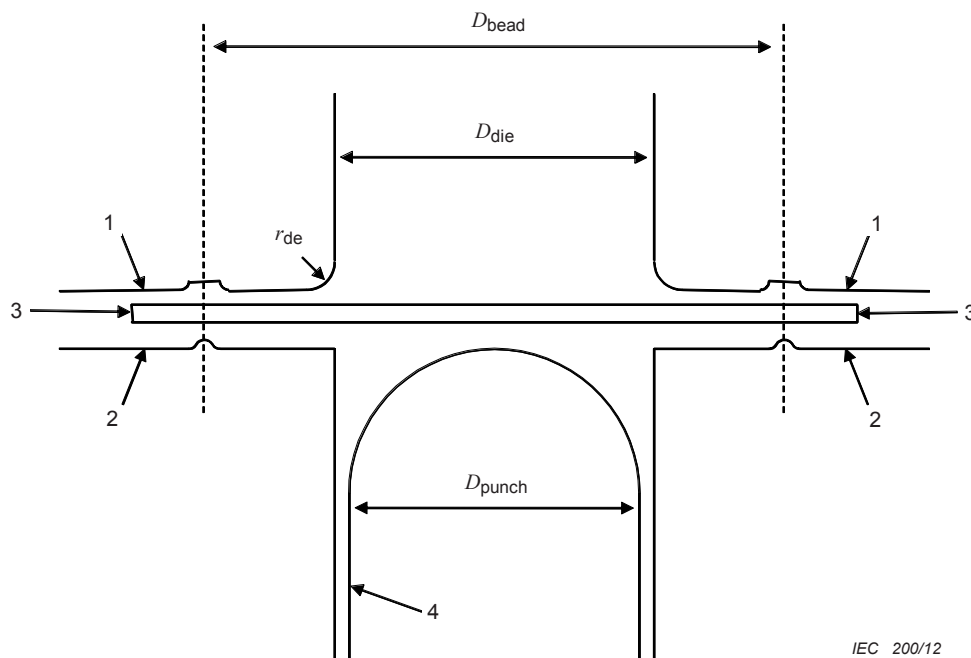

IEC 200/12

Key

- 1 upper die
- 2 lower die
- 3 specimen
- 4 hemispherical punch

Figure 1 – Equipment and tools for forming limit tests

4.3 Specimen

Rectangular specimens with different aspect ratios shall be used in the test. At least six kinds of specimens with the aspect ratios of 1,0, 1,5, 1,75, 2,0, 3,5 and 7,0 are recommended as shown in Figure 2 in order to cover the various loading paths on the domain of the forming limit diagram.

$$h = 2,5 \times D_{\text{punch}} \quad (3)$$

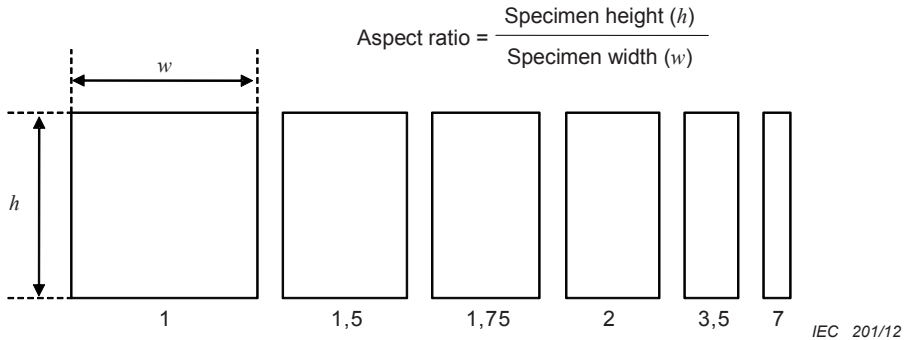


Figure 2 – Rectangular specimens with six kinds of aspect ratio

Grids shall be marked to the surface of the testing sample to measure the localized and overall deformation of the film material. The grid consists of a pattern of small circles or rectangles. It is recommended to arrange the grid patterns with an interval range from 50 μm to 200 μm and that the thickness of the grid is less than 10 % of the specimen thickness.

NOTE See Figure A.3 for detailed grid pattern.

5 Test procedure and analysis

5.1 Test procedure

In a FLD test, the following items from a) to e) are steps to obtain a localized fracture of a specimen which is firstly observed. Then the values of a major strain and a minor strain which are used to quantify the deformation of the specimen will be measured.

a) Preparation of the specimen

Specimens with different aspect ratios are prepared to conduct the test.

NOTE 1 Both the positive and negative region of the FLD curve can be obtained by varying the aspect ratio of the specimen and the lubricant.

b) Grid marking on the specimen

Appropriate marking conditions which have a lesser effect on the microstructure and the properties of materials should be applied in the grid marking since the thickness of the film is relatively smaller.

NOTE 2 See Annex B for detail expression of several grid marking methods.

c) Gripping the specimen

In order to measure the strain only in the testing region, it is important that the sample should be clamped without any sliding. Also, pre-fracture should not occur when it is being clamped.

NOTE 3 See Annex C for several recommended gripping methods.

d) Moving the punch until the specimen fails

The hemispherical punch moves by controlling the constant crosshead speed of equipment until the localized fracture of the specimen is first observed.

e) Measuring the major and minor strains of deformed specimen

Major and minor strains of the deformed specimen are measured representatively using the digital camera module with a high magnifying power lens. The recommended magnification factor of the camera lens is less than 5 μm/pixel in order to measure the strain precisely.

NOTE 4 See Annex D for strain measuring method.

f) Construct the FLD by plotting the measured major and minor strains (refer to Figure 4).

5.2 Data analysis

In order to quantify the deformation of the specimen, two kinds of strains – major and minor strains – are measured between the initial state of the circle and the deformed elliptical shape. After the circular grid deforms, the longest dimensions of the ellipse is major axis and the dimension perpendicular to the major axis is the minor axis, as explained in Figure 3.

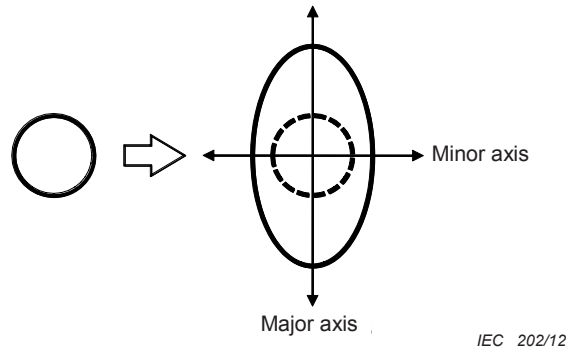



Figure 3 – Strain for forming limit measurement

The major strain, ϵ_1 , and the minor strain, ϵ_2 , are calculated with following equations:

$$\epsilon_1 = \ln \frac{d_1}{d_0} \tag{4}$$

$$\epsilon_2 = \ln \frac{d_2}{d_0} \tag{5}$$

Here, d_0 is the initial diameter of the circular grid while d_1 and d_2 represent the major and the minor diameters of the grid after deformation.

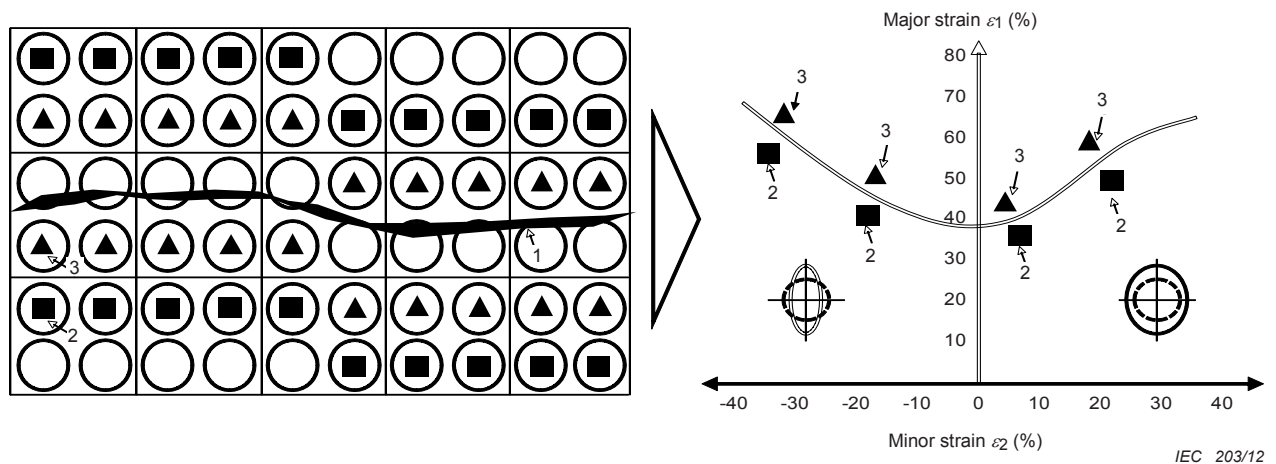

- Key**
- 1 fracture
 - 2 good
 - 3 failure

Figure 4 – Construct the forming limit diagram by plotting the major and minor strains

The major and minor strains calculated from the grids in the neighbourhood of the failure zone of the specimen are regarded as critical failure strains. By conducting a series of experiments with various specimens, it is possible to find combinations of major strain and minor strain for which neither necking nor fracture occurs by plotting on the strain domain. The diagram plotting the combinations of major and minor strains is a forming limit diagram as shown in Figure 4.

6 Test report

The test report should contain at least the following information:

- a) reference to this international standard;
- b) testing material;
- c) grid marking method;
- d) number of specimens used in the test;
- e) dimensions of the specimen(s);
- f) description of testing apparatus (punch diameter, gripping method, punch roughness, etc.);
- g) lubrication condition;
- h) crosshead speed of testing apparatus;
- i) strain measurement module: specification of the digital camera, scale factor of each pixel;
- j) measured diameters and calculated strains of each specimen;
- k) forming limit diagram.

Annex A (informative)

Principles of the forming limit diagram

The maximum major and minor strains at fracture are plotted in the strain domains. The surface of metallic film material part deforms differently based on the type of loading. A relationship exists between the deformation of the film material and the type of stressing. By conducting a series of experiments, it is possible to find combinations of maximum strain (corresponding to the major axis of the ellipse) and minimum strain (perpendicular to the major strain and corresponding to the minor axis of the ellipse) for which neither necking nor fracture occurs. The FLD is valid for a definite formability and defines two zones "good" and "failure". The strains plotted are the critical points, where cracks are likely to form. Between the two zones of "good" and "failure", there is a curve of critical deformation shown in Figure A.1

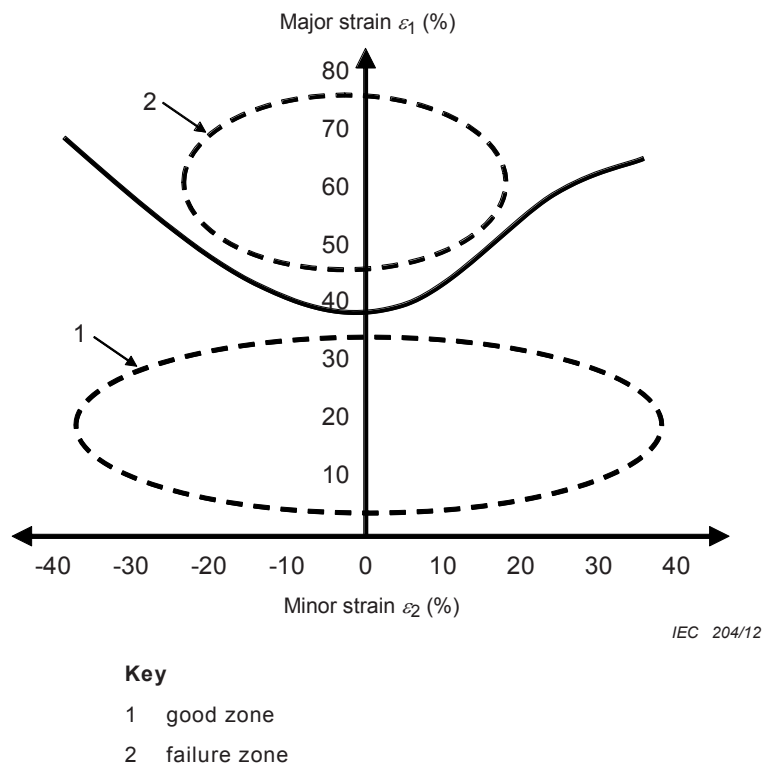


Figure A.1 – Forming limit diagram

Forming limit diagrams can be obtained by conducting experiments for different zones. The most widely used method of obtaining the forming limit diagram is by means of drawing tests of the specimens with a hemispherical punch shown in Figure A.2.


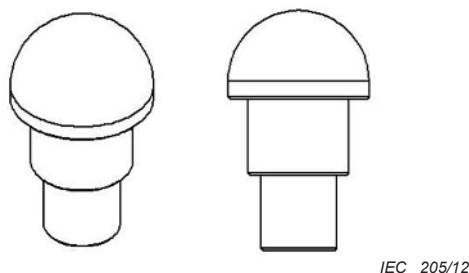


Figure A.2 – Hemispherical punch for forming limit measurement

In order to evaluate the deformation behaviour and forming limits of metallic thin film, grid patterns are marked on the specimen. This permits immediate and direct measurement of the formability of the metallic thin film at any location. The grid consists of a pattern of small circles and rectangles as described in Figure A.3

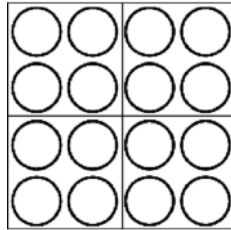

IEC 206/12

Figure A.3 – Grid for forming limit measurement

Circular grid patterns on the surface of a film material part deform differently based on the type of loading. The different stress conditions are simulated by changing the width of the specimen. The specimens with various widths are drawn until cracks occur. With details from these tests, the FLD can be obtained for strain paths ranging from biaxial tension (stretch forming) to equal tension and compression (deep drawing) as explained in Figure A.4. The diagram shall be determined for each particular film material.

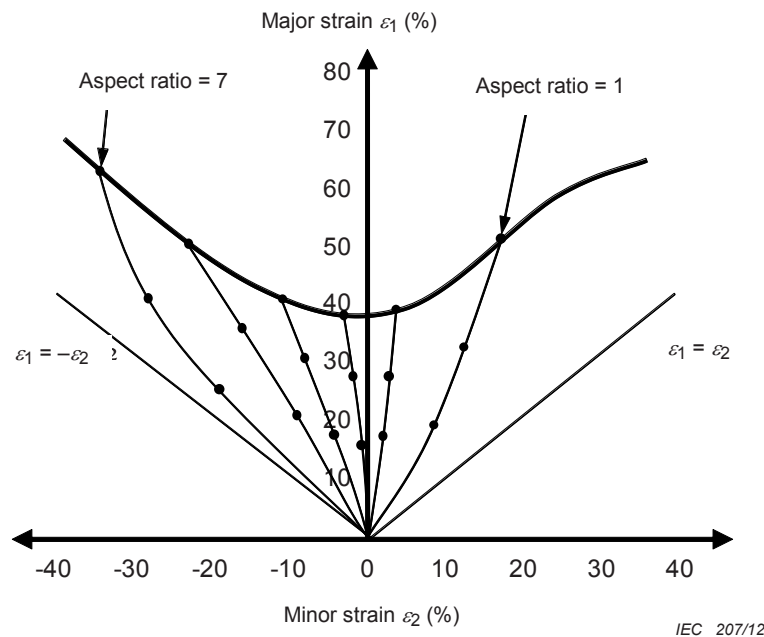


Figure A.4 – Loading path of the specimen with various aspect ratios

Annex B (informative)


Grid marking method

B.1 General

Photographic and inkjet methods are typical grid marking methods. The photographic method can achieve very small-sized grid marking through its precise processing, but there are disadvantages such as complex, slow work. The inkjet method has merits such as simplicity and quickness. However there are limits to precision work. The procedures and concepts for each method are as follows.

B.2 Photographic method

- a) Deposit the photographic sensitive materials on the specimen;
- b) Expose the photographic sensitive materials using a photo-mask;
- c) Clean the specimen (refer to Figure B.1).

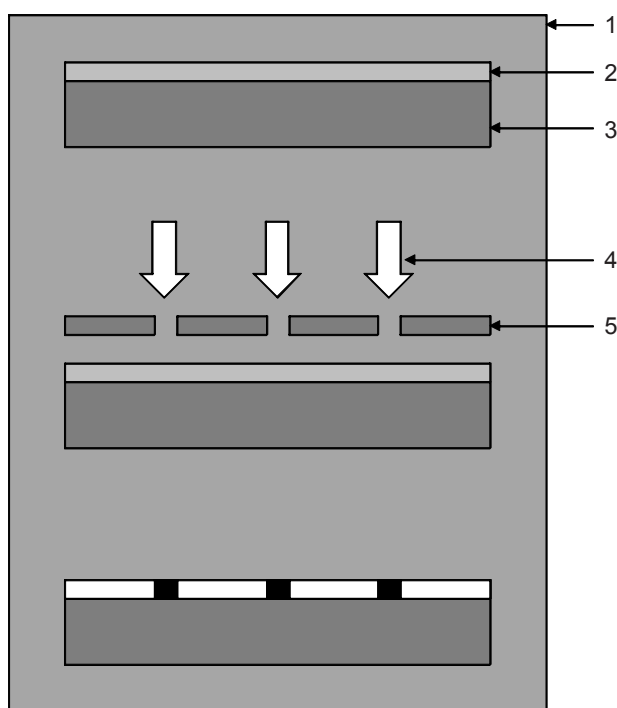

IEC 208/12


Key

- 1 dark room
- 2 photographic sensitive materials
- 3 specimen
- 4 light
- 5 photo mask

Figure B.1 – Procedure of a photographic grid marking method

B.3 Inkjet method

- a) Place the specimen on the hot plate and inkjet machine;
- b) Carry out the inkjet process according to the grid marking tool path data (refer to Figure B.2).

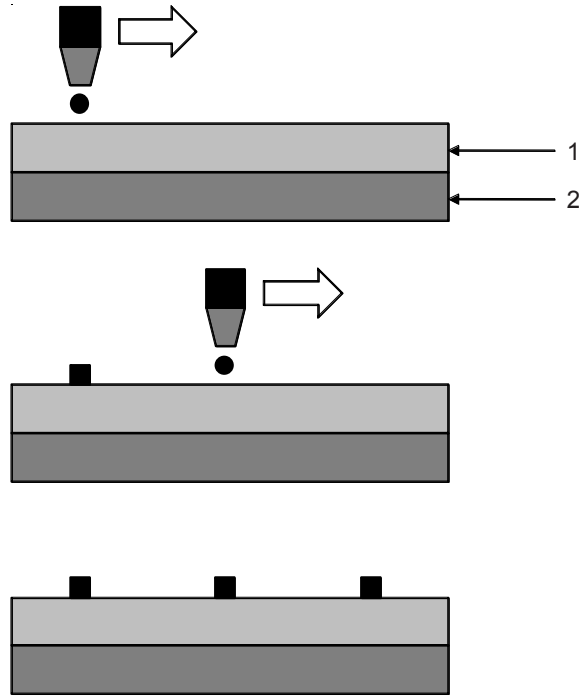

IEC 209/12

Key

- 1 specimen
- 2 hot plate


Figure B.2 – Procedure for an inkjet grid marking method

Annex C (informative)

Gripping method

C.1 Bead method

Figure C.1 shows the gripping method using ring shaped dies composed respectively of the female and male beads in the upper and lower dies. Also, the detailed dimensions of the bead parts are recommended. These dimensions can be modified if they satisfy the no slip conditions of the specimen.

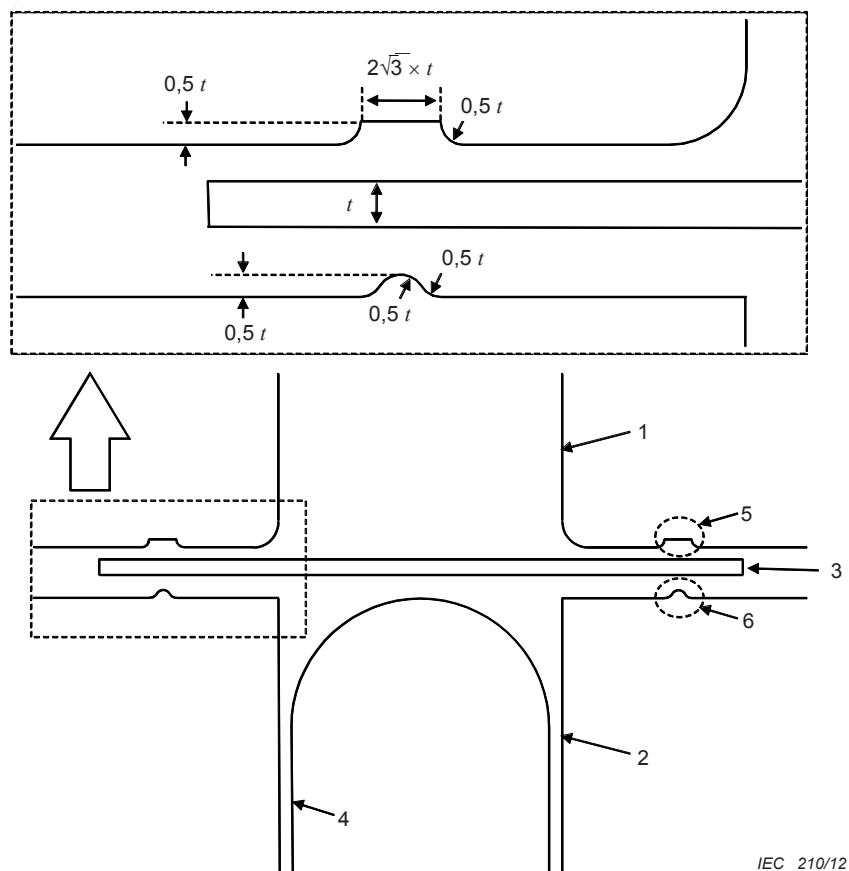


Key

- 1 upper die
- 2 lower die
- 3 specimen
- 4 hemispherical punch
- 5 female bead
- 6 male bead

Figure C.1 – Gripping of the specimen using a ring shaped die

C.2 Bonding method

As shown in Figure C.2, a gripping method using adhesive bonding can be adopted in the test. Either upper or lower adhesive can be used if they satisfy the no slip condition. At this point, it should be ensured that the adhesive does not invade the round part of the upper die edge. Additionally, it is recommended that the upper and lower thicknesses of the adhesive layer respectively should not exceed 10 % of the specimen thickness.

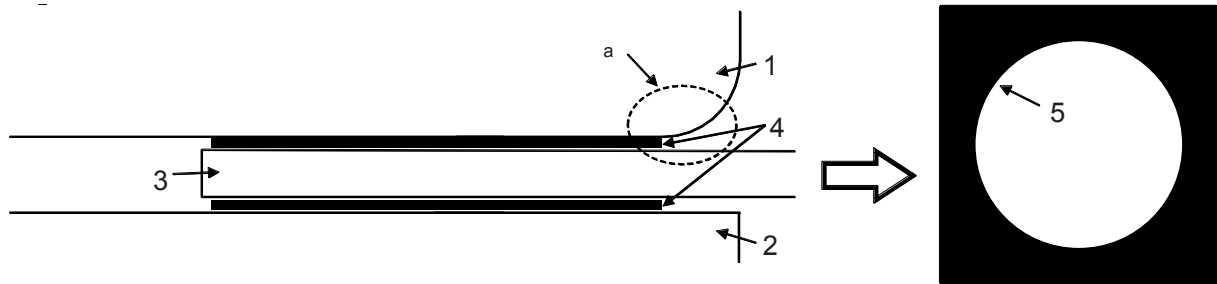

IEC 211/12

Key

- 1 upper die
- 2 lower die
- 3 specimen
- 4 adhesive
- 5 specimen with adhesive

NOTE Figure C.2 illustrates the bonding method.

^a It shall be ensured that the round part of the edge is not invaded.

Figure C.2 – Gripping of the specimen using adhesive bonding

Annex D (informative)

Strain measuring method

Major and minor strains of the deformed specimen can be measured representatively using the digital camera module with a high magnifying power lens. As shown in Figure D.1, the digital camera module shall be located so that the line of sight is perpendicular to the surface of the deformed specimen. Alternatively, the digital camera is fixed and the deformed specimen can be moved. The image captured from the digital camera shall be converted to real scale data by the pixel calculating algorithm described in Figure D.2. Manual calculation of the strains can be adopted, but using a software which can calculate the strains would be convenient. The detailed step-by-step procedure for the strain measurement is as follows.

- Step 1. Install the high magnified digital camera over the deformed specimen so that the screen displayed from the camera including the grid pattern of the specimen can be observed clearly.
- Step 2. Manipulate the software so that one or more grid patterns on the region of interest of the deformed specimen appear(s) on the monitor.
- Step 3. Concerning the corresponding ellipse, calculate the major and minor deformations by counting the pixels.

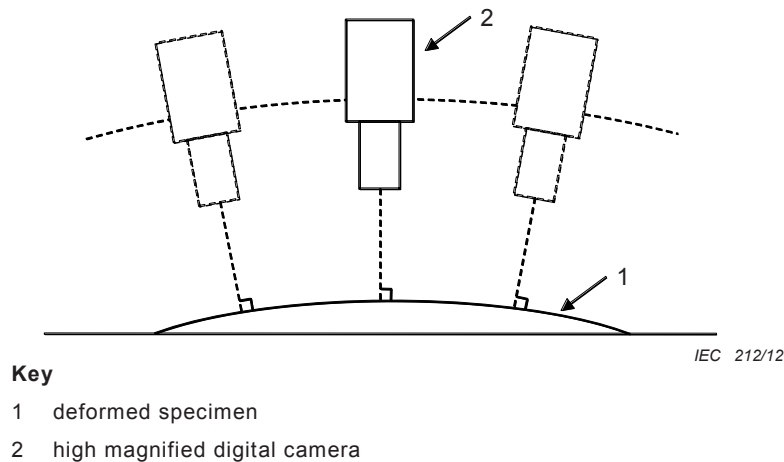


Figure D.1 – Set up for strain measurement using digital camera

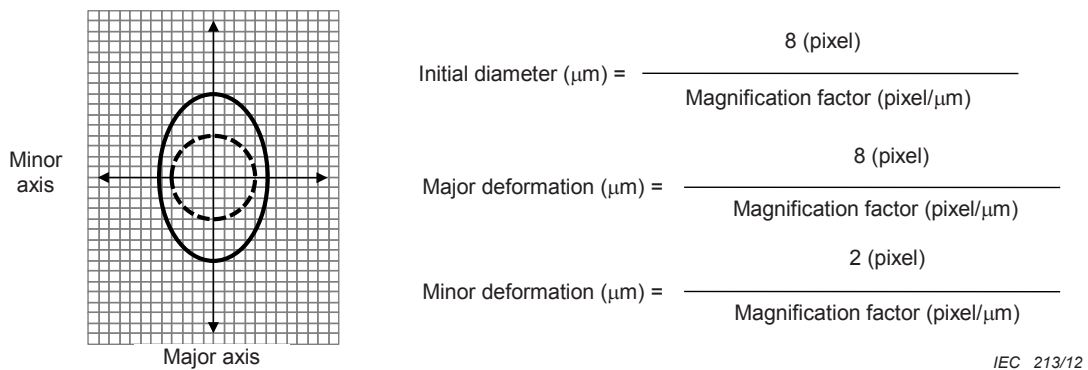


Figure D.2 – Example of pixel converting image of deformed specimen

British Standards Institution (BSI)

BSI is the national body responsible for preparing British Standards and other standards-related publications, information and services.

BSI is incorporated by Royal Charter. British Standards and other standardization products are published by BSI Standards Limited.

About us

We bring together business, industry, government, consumers, innovators and others to shape their combined experience and expertise into standards-based solutions.

The knowledge embodied in our standards has been carefully assembled in a dependable format and refined through our open consultation process. Organizations of all sizes and across all sectors choose standards to help them achieve their goals.

Information on standards

We can provide you with the knowledge that your organization needs to succeed. Find out more about British Standards by visiting our website at bsigroup.com/standards or contacting our Customer Services team or Knowledge Centre.

Buying standards

You can buy and download PDF versions of BSI publications, including British and adopted European and international standards, through our website at bsigroup.com/shop, where hard copies can also be purchased.

If you need international and foreign standards from other Standards Development Organizations, hard copies can be ordered from our Customer Services team.

Subscriptions

Our range of subscription services are designed to make using standards easier for you. For further information on our subscription products go to bsigroup.com/subscriptions.

With **British Standards Online (BSOL)** you'll have instant access to over 55,000 British and adopted European and international standards from your desktop. It's available 24/7 and is refreshed daily so you'll always be up to date.

You can keep in touch with standards developments and receive substantial discounts on the purchase price of standards, both in single copy and subscription format, by becoming a **BSI Subscribing Member**.

PLUS is an updating service exclusive to BSI Subscribing Members. You will automatically receive the latest hard copy of your standards when they're revised or replaced.

To find out more about becoming a BSI Subscribing Member and the benefits of membership, please visit bsigroup.com/shop.

With a **Multi-User Network Licence (MUNL)** you are able to host standards publications on your intranet. Licences can cover as few or as many users as you wish. With updates supplied as soon as they're available, you can be sure your documentation is current. For further information, email bsmusales@bsigroup.com.

BSI Group Headquarters

389 Chiswick High Road London W4 4AL UK

Revisions

Our British Standards and other publications are updated by amendment or revision.

We continually improve the quality of our products and services to benefit your business. If you find an inaccuracy or ambiguity within a British Standard or other BSI publication please inform the Knowledge Centre.

Copyright

All the data, software and documentation set out in all British Standards and other BSI publications are the property of and copyrighted by BSI, or some person or entity that owns copyright in the information used (such as the international standardization bodies) and has formally licensed such information to BSI for commercial publication and use. Except as permitted under the Copyright, Designs and Patents Act 1988 no extract may be reproduced, stored in a retrieval system or transmitted in any form or by any means – electronic, photocopying, recording or otherwise – without prior written permission from BSI. Details and advice can be obtained from the Copyright & Licensing Department.

Useful Contacts:

Customer Services

Tel: +44 845 086 9001

Email (orders): orders@bsigroup.com

Email (enquiries): cservices@bsigroup.com

Subscriptions

Tel: +44 845 086 9001

Email: subscriptions@bsigroup.com

Knowledge Centre

Tel: +44 20 8996 7004

Email: knowledgecentre@bsigroup.com

Copyright & Licensing

Tel: +44 20 8996 7070

Email: copyright@bsigroup.com



...making excellence a habit.™