

Plastics — Thermomechanical analysis (TMA) —

**Part 2: Determination of coefficient of
linear thermal expansion and glass
transition temperature**

ICS 83.080.01

National foreword

This British Standard reproduces verbatim ISO 11359-2:1999 and implements it as the UK national standard.

The UK participation in its preparation was entrusted to Technical Committee PRI/21, Testing of plastics, which has the responsibility to:

- aid enquirers to understand the text;
- present to the responsible international/European committee any enquiries on the interpretation, or proposals for change, and keep the UK interests informed;
- monitor related international and European developments and promulgate them in the UK.

A list of organizations represented on this committee can be obtained on request to its secretary.

Cross-references

The British Standards which implement international or European publications referred to in this document may be found in the BSI Standards Catalogue under the section entitled “International Standards Correspondence Index”, or by using the “Find” facility of the BSI Standards Electronic Catalogue.

A British Standard does not purport to include all the necessary provisions of a contract. Users of British Standards are responsible for their correct application.

Compliance with a British Standard does not of itself confer immunity from legal obligations.

Summary of pages

This document comprises a front cover, an inside front cover, the ISO title page, pages ii and iii, a blank page, pages 1 to 10, an inside back cover and a back cover.

The BSI copyright notice displayed in this document indicates when the document was last issued.

This British Standard, having been prepared under the direction of the Sector Committee for Materials and Chemicals, was published under the authority of the Standards Committee and comes into effect on 15 November 1999

© BSI 11-1999

ISBN 0 580 35346 X

Amendments issued since publication

Amd. No.	Date	Comments

**Plastics — Thermomechanical analysis
(TMA) —**

Part 2:

**Determination of coefficient of linear thermal
expansion and glass transition temperature**

Plastiques — Analyse thermomécanique (TMA) —

*Partie 2: Détermination du coefficient de dilatation thermique linéique et de
la température de transition vitreuse*



Contents

1 Scope	1
2 Normative references	1
3 Terms and definitions	1
4 Principle.....	3
5 Apparatus	3
6 Test specimens	3
7 Procedure	3
8 Expression of results	4
9 Test report	7
Annex A (informative) Precision and reproducibility data for the determination of the mean coefficient of linear thermal expansion using TMA	9
Bibliography	10

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 3.

Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

International Standard ISO 11359-2 was prepared by Technical Committee ISO/TC 61, *Plastics*, Subcommittee SC 5, *Physical-chemical properties*.

ISO 11359 consists of the following parts, under the general title *Plastics — Thermomechanical analysis*:

$\frac{3}{4}$ *Part 1: General principles*

$\frac{3}{4}$ *Part 2: Determination of coefficient of linear thermal expansion and glass transition temperature*

$\frac{3}{4}$ *Part 3: Determination of penetration temperature*

Annex A of this part of ISO 11359 is given for information only.

Plastics — Thermomechanical analysis (TMA) —

Part 2:

Determination of coefficient of linear thermal expansion and glass transition temperature

1 Scope

This part of ISO 11359 specifies a test method, using thermodilatometry, for the determination of the coefficient of linear thermal expansion of plastics in a solid state by thermomechanical analysis (TMA). This part of ISO 11359 also specifies the determination of the glass transition temperature using TMA.

NOTE The coefficient of linear thermal expansion can be measured using various types of thermodilatometry apparatus. This part of ISO 11359 concerns only TMA apparatus.

2 Normative references

The following normative documents contain provisions which, through reference in this text, constitute provisions of this part of ISO 11359. For dated references, subsequent amendments to, or revisions of, any of these publications do not apply. However, parties to agreements based on this part of ISO 11359 are encouraged to investigate the possibility of applying the most recent editions of the normative documents indicated below. For undated references, the latest edition of the normative document referred to applies. Members of ISO and IEC maintain registers of currently valid International Standards.

ISO 291, *Plastics — Standard atmospheres for conditioning and testing*.

ISO 11359-1, *Plastics — Thermomechanical analysis (TMA) — Part 1: General principles*.

3 Terms and definitions

For the purposes of this part of ISO 11359, the terms and definitions given in ISO 11359-1 apply, plus the following:

3.1

thermal expansion

increase in dimensions of a specimen as a function of temperature, measured by thermodilatometry

3.2

coefficient of linear thermal expansion

reversible increase in length of a material per unit length per degree change in temperature

NOTE Two different coefficients of thermal expansion can be determined: the differential coefficient of linear thermal expansion and the mean coefficient of linear thermal expansion.

3.2.1 differential coefficient of linear thermal expansion

coefficient of expansion for any of the three dimensions at temperature T and at constant pressure p given, in reciprocal kelvins, by the following equation:

$$\alpha = \frac{(dL)_p}{(dT)_p} \frac{1}{L_0} = \frac{(dL/dt)_p}{(dT/dt)_p} \frac{1}{L_0} \quad (1)$$

where

L_0 is the reference length at room temperature T_0 , in the axis of measurement;

L is the length at temperature T , in the axis of measurement;

dL is the change in length over the time interval dt at constant pressure p ;

dT is the change in temperature over the time interval dt at constant pressure p .

3.2.2 mean coefficient of linear thermal expansion

$\bar{\alpha}$

coefficient of expansion for any of the three dimensions at constant pressure, given, in reciprocal kelvins, by the following equation:

$$\bar{\alpha} = \frac{\Delta L}{\Delta T} \frac{1}{L_0} \quad (2)$$

where

L is the change in length of the test specimen between two temperatures T_1 and T_2 ;

L_0 is the reference length of the test specimen at room temperature in the axis of measurement;

T is the change in temperature, equal to $T_2 - T_1$.

The determination is made over a temperature interval T between T_1 and T_2 . The representative temperature is given by

$$T(\text{representative}) = \frac{T_1 + T_2}{2}$$

NOTE By replacing the term "length" by "volume" in equations (1) and (2), the coefficient of volumetric thermal expansion can be obtained.

3.3 glass transition

reversible change in an amorphous polymer or in the amorphous regions of a partially crystalline polymer from (or to) a viscous or rubbery state to (or from) a hard and relatively brittle one

3.4 glass transition temperature

T_g

approximate midpoint of the temperature range over which the glass transition takes place

The glass transition temperature obtained by thermodilatometry is defined as the point of intersection of the tangents to the length versus temperature curve before and after the glass transition (see Figure 3).

4 Principle

The change in a dimension of a test specimen is measured as a function of temperature using a TMA apparatus to generate a TMA curve from which the coefficient of linear thermal expansion can be calculated.

5 Apparatus

The components of the TMA apparatus used for this part of ISO 11359 shall be as specified in ISO 11359-1 and shall also be capable of:

- a) operating in a compression mode or a tension mode or both;
- b) maintaining the specimen under a controlled atmosphere in accordance with ISO 291.

NOTE 1 Measurements on specimens of film or fibre are made in the tension mode.

NOTE 2 It is preferable to use an atmosphere of dry air or an inert gas such as nitrogen.

6 Test specimens

6.1 Preparation

Prepare test specimens in accordance with ISO 11359-1, clause 7.

The standard test specimen is a rectangular specimen 5 mm to 10 mm in length and about 5 mm in width. However, specimens of other dimensions may be used by agreement between the interested parties. The ends of the test specimen shall be parallel. Record, if applicable, the orientation of the specimen with respect to the direction of production, i.e. machine direction, transverse direction or other.

Refer to the relevant material standards for the number of test specimens, but prepare and test at least three specimens from each sample.

6.2 Conditioning

Refer to the relevant material standards for the conditioning of specimens before measurement.

NOTE 1 In order to eliminate any thermal-memory effects in the specimen, it is preferable that each specimen be heated from the minimum measurement temperature (at least 50 °C below T_g) to the maximum temperature (at least 50 °C above T_g), then held at this latter temperature for 5 min. Subsequently, cool the specimen to the minimum temperature at the same rate as that which will be used for the actual determination.

NOTE 2 Heating the test specimen to temperatures of 50 °C above T_g may result in changes in molecular orientation and/or blend morphology, thereby changing the coefficient of linear thermal expansion in certain directions.

7 Procedure

7.1 Calibration of apparatus

Calibrate the apparatus in accordance with ISO 11359-1. After cleaning the surfaces of the specimen, probe and sample holder, place the specimen on the sample holder with the probe as close as possible.

7.2 Determination

Set the unloaded probe on the upper surface of the specimen. Apply a load of preferably 4,0 kPa \pm 0,1 kPa. Provided the effect on the measured value is small, other loads may be used.

ISO 11359-2:1999(E)

When specimens made of film, fibre or soft material are tested, carry out the determination in the tension mode with both ends of the specimen gripped.

Maintain a constant gas flow, preferably of dry air, around the specimen within a flowrate range of 50 ml/min to 100 ml/min. However, other atmospheres may be used by agreement between the interested parties.

Increase the temperature of the specimen at a constant rate of not more than 5 °C/min.

Record the TMA curve for the test specimen, i.e. the change in length with increasing temperature.

NOTE 1 It is preferable with some samples that specimens taken in different directions from the sample be investigated.

Measure, under the same conditions, the change in length of a reference specimen having a known mean coefficient of linear thermal expansion and about the same length as the test specimen.

NOTE 2 This is not necessary when the apparatus used measures the difference in length between the test specimen and a reference specimen directly.

8 Expression of results

8.1 Method of calculation

8.1.1 Coefficient of linear thermal expansion

The coefficient of linear thermal expansion α , in reciprocal kelvins (K^{-1}), at temperature T is obtained from the TMA curve using the following equation (see Figure 1):

$$\alpha = \frac{dL}{dT} \frac{1}{L_0}$$

where

L_0 is the length of the specimen, in micrometres, at room temperature;

L is the length of the specimen, in micrometres, at temperature T ;

T is in kelvins.

Calculate the value of α to the nearest $10^{-7} K^{-1}$ for each specimen. Calculate the mean of these individual values and round the mean to the nearest $10^{-6} K^{-1}$.

In the case of a test specimen exhibiting a glass transition, calculate the coefficient before and after the glass transition.

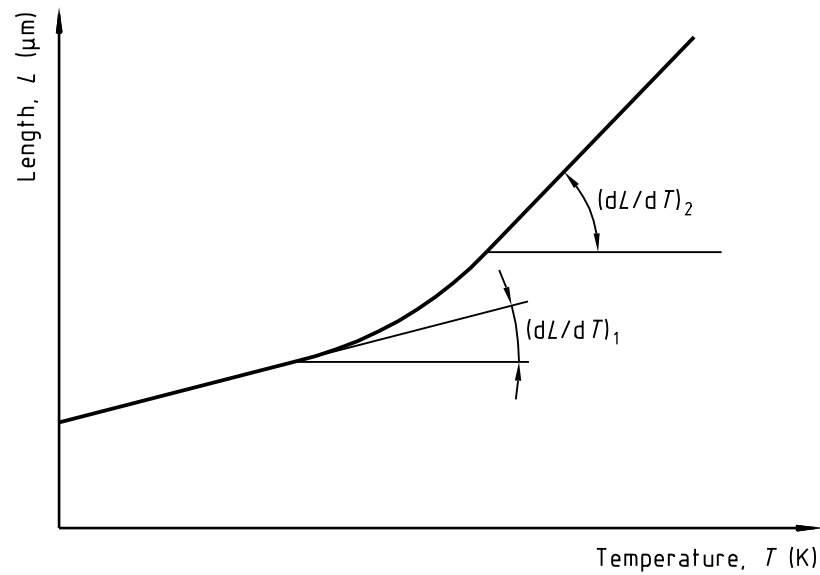


Figure 1 — Determination of coefficient of linear thermal expansion

8.1.2 Mean coefficient of linear thermal expansion $\bar{\alpha}$

8.1.2.1 Method A: Determination without reference specimen

The mean coefficient of linear thermal expansion $\bar{\alpha}$, in reciprocal kelvins (K^{-1}), between two temperatures T_1 and T_2 is obtained from the TMA curve using the following equation (see Figure 2):

$$\bar{\alpha} = \frac{\Delta L}{\Delta T} \frac{1}{L_0}$$

where

L_0 is the length of the specimen, in micrometres, at room temperature;

L is the difference in length, in micrometres;

$T (= T_2 - T_1)$ is the temperature difference, in kelvins.

Select two temperatures and calculate the difference in temperature T .

Determine the corresponding change in length L from the TMA curve.

Calculate the value of $\bar{\alpha}$ to the nearest 10^{-7} K^{-1} for each specimen. Calculate the mean of these individual values and round the mean to the nearest 10^{-6} K^{-1} .

In the case of a test specimen exhibiting a glass transition, calculate the coefficient before and after the glass transition.

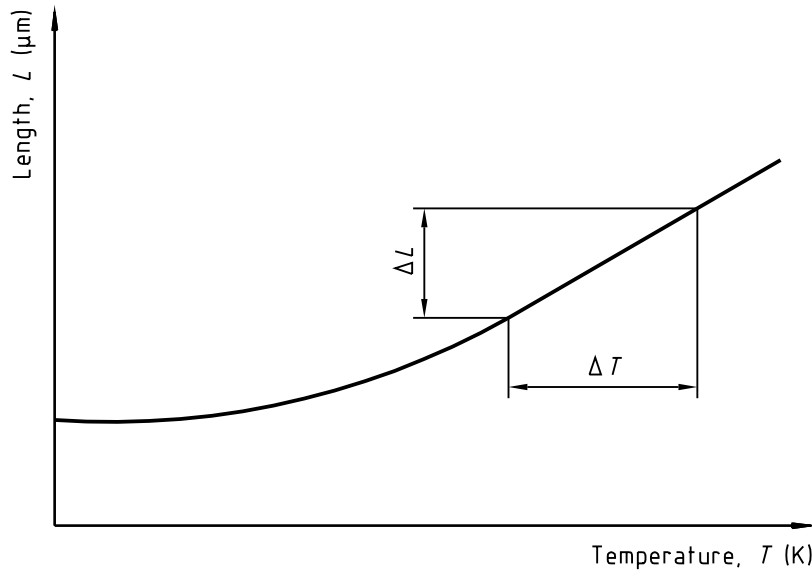


Figure 2 — Determination of mean coefficient of linear thermal expansion $\bar{\alpha}$

8.1.2.2 Method B: Determination with reference specimen

The mean coefficient of linear thermal expansion $\bar{\alpha}$, in reciprocal kelvins (K^{-1}), between two temperatures T_1 and T_2 is obtained using the following equation:

$$\bar{\alpha} = \frac{\Delta L_{\text{Spm}}}{L_0} \frac{1}{(T_2 - T_1)} + \bar{\alpha}_{\text{Ref}}$$

where

- $\bar{\alpha}$ is the mean coefficient of linear thermal expansion, in reciprocal kelvins (K^{-1});
- L_0 is the length of the specimen, in micrometres, at room temperature;
- T_1 is the lower end of the temperature range, in degrees Celsius, used to measure the coefficient of linear thermal expansion;
- T_2 is the higher end of the temperature range, in degrees Celsius, used to measure the coefficient of linear thermal expansion;
- L_{Spm} is the difference in test specimen length, in micrometres, between T_1 and T_2 , i.e. the measured value of [(length at T_2) – (length at T_1)];
- L_{Ref} is the difference in reference specimen length, in micrometres, between T_1 and T_2 , i.e. the measured value of [(length at T_2) – (length at T_1)];
- $\bar{\alpha}_{\text{Ref}}$ is the calculated value of the mean coefficient of linear thermal expansion of the reference specimen, in reciprocal kelvins, between T_1 and T_2 .

Calculate the value of $\bar{\alpha}$ to the nearest 10^{-7} K^{-1} for each specimen. Calculate the mean of these individual values and round the mean to the nearest 10^{-6} K^{-1} .

In the case of a test specimen exhibiting a glass transition, calculate the coefficient before and after the glass transition.

NOTE 1 Silica or aluminium can be used for the reference specimen.

NOTE 2 If the apparatus used measures the difference in length between the test specimen and the reference specimen, then L_{Spm} is the difference in length between the test specimen and the reference specimen and L_{Ref} is zero. L_0 should be the same for test and reference specimens.

8.1.3 Glass transition temperature

The glass transition temperature is determined as the point of intersection of the tangents to the TMA curve before and after the transition (see Figure 3).

NOTE The extrapolated glass transition onset temperature T_{eig} and the extrapolated glass transition end temperature T_{efg} can be determined from a differential TMA (DTMA) curve as the points of intersection of the tangent at the point of inflection with the extrapolated baseline before the glass transition and the extrapolated baseline after the glass transition respectively. The extent of the transition region is given by $T_{\text{efg}} - T_{\text{eig}}$.

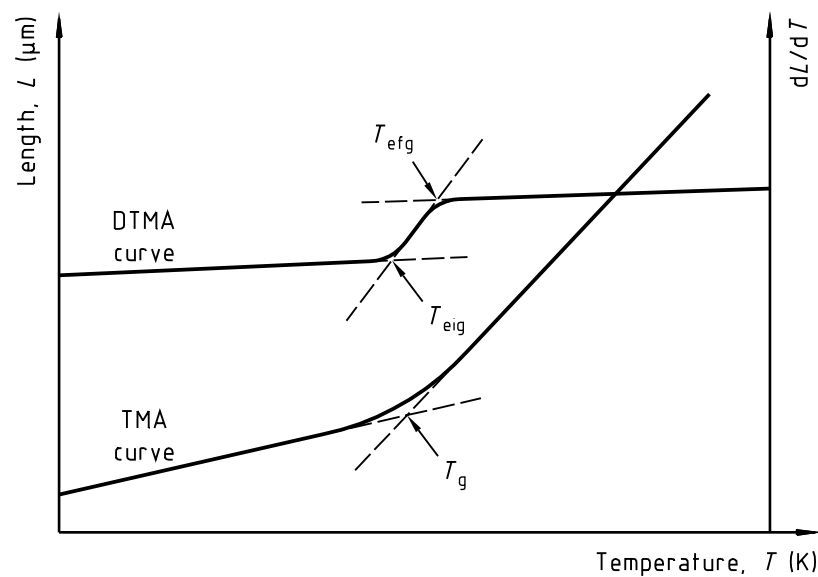


Figure 3 — Determination of glass transition temperature

8.1.4 Representative temperature

Calculate the representative temperature (see 3.2.2) to the nearest $\pm 0,1$ °C for each specimen. Calculate the mean of these individual values and round to the nearest whole number.

8.2 Precision

Round-robin testing for method A has been performed in the USA, and the results show precision ranging from $\pm 2,6$ % to ± 12 %. Round-robin testing for method B has been performed in Japan, and the results show a coefficient of variation ranging from 0,99 % to 14,37 %. (See annex A for details.)

9 Test report

The test report shall include the following:

- a reference to this part of ISO 11359;
- all details necessary for complete identification of the material or product tested (lot number, etc.);
- the type of test specimen used, its dimensions, the method of preparation and its orientation with reference to the sheet or article it was taken from;
- details of the conditioning of the test specimen, if applicable;

ISO 11359-2:1999(E)

- e) the type of TMA equipment used;
- f) the shape and dimensions of the probe;
- g) the materials used for calibration purposes and the values obtained;
- h) the experimental conditions used for the determination, i.e. the rate of heating, the test atmosphere, the rate of gas flow (if any), the temperature range over which the mean coefficient of linear thermal expansion was measured and the representative temperature;
- i) details of the reference specimen used;
- j) the results of the test, i.e. the value of the coefficient of linear thermal expansion for each specimen, the mean of and the standard deviation, the value of the mean coefficient of linear thermal expansion $\bar{\alpha}$ for each specimen, the mean of $\bar{\alpha}$ and the standard deviation, the glass transition temperature and the TMA curves obtained;
- k) details of any operation not specified in this part of ISO 11359 and/or agreed upon between the parties concerned;
- l) the date(s) of testing.

Annex A (informative)

Precision and reproducibility data for the determination of the mean coefficient of linear thermal expansion using TMA

Precision data calculated from round-robin determinations of the mean coefficient of linear thermal expansion using method A are presented in Table A.1. Eight laboratories in the USA participated, using six different models of instrument, specimens 8 mm long and a 100 °C temperature range.

Table A.1 — Precision data using method A (USA)

Mean coefficient of linear thermal expansion $\bar{\alpha}$ K ⁻¹	Precision %	Maximum deviation %
$\bar{\alpha} \geq 20 \times 10^{-6}$	$\pm 2,6$	3,7
$20 \times 10^{-6} > \bar{\alpha} \geq 5 \times 10^{-6}$	$\pm 5,1$	7,8
$5 \times 10^{-6} > \bar{\alpha} \geq 1 \times 10^{-6}$	± 12	61
NOTE See ASTM E 831.		

Reproducibility data calculated from round-robin determinations of the mean coefficients of linear thermal expansion of different materials using method B are presented in Table A.2. Five laboratories participated in Japan.

Table A.2 — Reproducibility data for different materials using method B (Japan)

Material	Mean coefficient of linear thermal expansion $\bar{\alpha}$ K ⁻¹	Standard deviation s_R K ⁻¹	Coefficient of variation $s_R/\bar{\alpha}$ %
Polyethylene (30 °C to 60 °C)	$147,4 \times 10^{-6}$	$6,11 \times 10^{-6}$	4,14
Polyethyleneoxide (30 °C to 120 °C)	$106,5 \times 10^{-6}$	$3,63 \times 10^{-6}$	3,41
Polyimide (30 °C to 200 °C)	$17,5 \times 10^{-6}$	$2,51 \times 10^{-6}$	14,37
Polyimide film (30 °C to 200 °C)	$25,4 \times 10^{-6}$	$1,58 \times 10^{-6}$	6,21
Aluminium (30 °C to 120 °C)	$25,1 \times 10^{-6}$	$0,25 \times 10^{-6}$	0,99
Aluminium (30 °C to 240 °C)	$25,8 \times 10^{-6}$	$0,37 \times 10^{-6}$	1,44

Bibliography

- [1] ISO 472:1999, *Plastics — Vocabulary*.
- [2] ICTA, *For Better Thermal Analysis*, 3rd edn., 1991.
- [3] ASTM E 831-93, *Standard Test Method for Linear Thermal Expansion of Solid Materials by Thermomechanical Analysis*.

BSI — British Standards Institution

BSI is the independent national body responsible for preparing British Standards. It presents the UK view on standards in Europe and at the international level. It is incorporated by Royal Charter.

Revisions

British Standards are updated by amendment or revision. Users of British Standards should make sure that they possess the latest amendments or editions.

It is the constant aim of BSI to improve the quality of our products and services. We would be grateful if anyone finding an inaccuracy or ambiguity while using this British Standard would inform the Secretary of the technical committee responsible, the identity of which can be found on the inside front cover. Tel: 020 8996 9000. Fax: 020 8996 7400.

BSI offers members an individual updating service called PLUS which ensures that subscribers automatically receive the latest editions of standards.

Buying standards

Orders for all BSI, international and foreign standards publications should be addressed to Customer Services. Tel: 020 8996 9001. Fax: 020 8996 7001.

In response to orders for international standards, it is BSI policy to supply the BSI implementation of those that have been published as British Standards, unless otherwise requested.

Information on standards

BSI provides a wide range of information on national, European and international standards through its Library and its Technical Help to Exporters Service. Various BSI electronic information services are also available which give details on all its products and services. Contact the Information Centre. Tel: 020 8996 7111. Fax: 020 8996 7048.

Subscribing members of BSI are kept up to date with standards developments and receive substantial discounts on the purchase price of standards. For details of these and other benefits contact Membership Administration. Tel: 020 8996 7002. Fax: 020 8996 7001.

Copyright

Copyright subsists in all BSI publications. BSI also holds the copyright, in the UK, of the publications of the international standardization bodies. Except as permitted under the Copyright, Designs and Patents Act 1988 no extract may be reproduced, stored in a retrieval system or transmitted in any form or by any means – electronic, photocopying, recording or otherwise – without prior written permission from BSI.

This does not preclude the free use, in the course of implementing the standard, of necessary details such as symbols, and size, type or grade designations. If these details are to be used for any other purpose than implementation then the prior written permission of BSI must be obtained.

If permission is granted, the terms may include royalty payments or a licensing agreement. Details and advice can be obtained from the Copyright Manager. Tel: 020 8996 7070.