

BS ISO 18907:2013



BSI Standards Publication

Imaging materials — Photographic films and papers — Wedge test for brittleness

bsi.

...making excellence a habit.™

National foreword

This British Standard is the UK implementation of ISO 18907:2013. It supersedes BS ISO 18907:2000, which is withdrawn.

The UK participation in its preparation was entrusted to Technical Committee CPW/42, Photography.

A list of organizations represented on this committee can be obtained on request to its secretary.

This publication does not purport to include all the necessary provisions of a contract. Users are responsible for its correct application.

© The British Standards Institution 2013.
Published by BSI Standards Limited 2013

ISBN 978 0 580 80498 4

ICS 37.040.20

Compliance with a British Standard cannot confer immunity from legal obligations.

This British Standard was published under the authority of the Standards Policy and Strategy Committee on 28 February 2013.

Amendments issued since publication

Date	Text affected
------	---------------

INTERNATIONAL
STANDARD

BS ISO 18907:2013

ISO
18907

Second edition
2013-02-01

**Imaging materials — Photographic
films and papers — Wedge test for
brittleness**

*Matériaux pour l'image — Films et papiers photographiques —
Détermination de la méthode dite <<du coin>>*



Reference number
ISO 18907:2013(E)

© ISO 2013



COPYRIGHT PROTECTED DOCUMENT

© ISO 2013

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 749 09 47
E-mail copyright@iso.org
Web www.iso.org

Published in Switzerland

Contents

Page

Foreword	iv
Introduction	v
1 Scope	1
2 Normative references	1
3 Terms and definitions	1
4 Principle	1
5 Apparatus	1
5.1 Wedge tester for brittleness.....	1
5.2 Test chamber.....	2
6 Sampling	2
6.1 Preparation of specimens.....	2
6.2 Selection of specimens.....	2
6.3 Size of specimens.....	2
7 Conditioning and test conditions	4
7.1 Conditioning of specimens.....	4
7.2 Test conditions.....	5
8 Procedure	5
9 Test report	6
9.1 Test data.....	6
9.2 Significance.....	6
Bibliography	7

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 18907 was prepared by Technical Committee ISO/TC 42, *Photography*.

This second edition cancels and replaces the first edition (ISO 18907:2000), of which it constitutes a minor revision with the following changes:

- Clause 2 has been updated;
- Annex A has been removed.

Introduction

In the case of photographic films and papers, brittleness is an undesirable property since satisfactory performance in equipment or in handling requires sufficient flexibility (or lack of brittleness) to ensure good tolerances to bending stresses under the atmospheric conditions likely to be encountered in practice.

Photographic films and papers are laminates of two or more different materials, usually a plastic or paper support and firmly bonded gelatin layers that contain image forming and other substances. These laminate structures must have sufficient flexibility to withstand the stresses imposed by bending and flexing during use. However, under low relative humidity and low temperature conditions, the gelatin layers and/or support tend to become brittle. This can cause the formation of cracks and/or breaks when the laminate is stressed beyond its diminished capacity to withstand bending and flexing.

Different types of brittle failure occur when film and paper are subjected to stress in different ways. For example, failure can consist of very fine cracks in the emulsion (without a break in the support) which are objectionable when the photograph is viewed. Under different conditions or with different materials, failure can consist of cracks in the support or a complete break of all components of the laminate.

Brittleness is not an absolute physical property. The apparent brittleness of photographic material is very dependent upon the manner in which it is mechanically treated as well as the ambient conditions of temperature and relative humidity. As a result, no one test for brittleness is capable of ranking a variety of types of photographic material as they would behave under widely different practical conditions.

The wedge test for brittleness specified in this International Standard subjects the photographic material to a high rate of strain in a simple folding action. It has been an accepted method of rating brittleness for many years and has correlated with product behaviour under many practical applications. It is a widely accepted method in the photographic industry. Other methods used have consisted of flex tests in which the specimen is subjected to a repeated folding action until it breaks, or the bending over mandrels of different diameters. There are a considerable number of flexibility tests available and standardization is not possible at this time.

Brittleness is affected adversely by both reduced temperature and reduced relative humidity. Brittleness at low relative humidity is encountered more frequently than brittleness at low temperature in most applications. Moreover, a marked change in brittleness can occur with only a very small change in relative humidity below a level of about 25 %. Consequently, brittleness tests are carried out only in an atmosphere which is very accurately controlled with respect to both temperature and relative humidity.

Brittleness is also very dependent on the sample thickness, increasing with increasing thickness of either support or emulsion. For this reason, the thickness of the layers must be considered when comparing the behaviour of different materials. The thermal and moisture exposure history of the material between manufacture and testing can also affect the brittleness even though the sample is reconditioned to a standard temperature and humidity.

Gelatin is generally more brittle than the support, so that photographic products having a gelatin layer on only one side are usually more brittle when bent with the gelatin side out (that is, gelatin under tension).

Brittleness can vary with the bend axis depending upon the orientation of the support. There is generally no directional effect in the brittleness of the emulsion.

Imaging materials — Photographic films and papers — Wedge test for brittleness

1 Scope

This International Standard specifies a method for determining and expressing quantitatively the brittleness of photographic film and papers. It does not, however, specify a universal brittleness test for all types of stress encountered for which special tests can be required to correctly rate the material for brittleness.

The method is applicable to films with or without a gelatin backing and to fibre-based or resin-coated (RC) photographic papers. It may also be applied to either raw or processed materials although the brittleness level can be quite different after processing from that before processing.

2 Normative references

The following documents, in whole or in part, are normatively referenced in this document and are indispensable for its application. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 483, *Plastics — Small enclosures for conditioning and testing using aqueous solutions to maintain the humidity at a constant value*

3 Terms and definitions

For the purposes of this document, the following terms and definitions apply.

3.1

brittleness

property of materials that causes them to break or crack when deformed by bending

4 Principle

Measurement of the opening of a wedge at which a specimen loop fails when subjected to high strains.

5 Apparatus

5.1 Wedge tester for brittleness

The wedge tester for brittleness consists of two non-parallel metal plates or jaws, which form a wedge or V as shown in [Figures 1](#) and [2](#). A clamp is attached to one jaw at the narrow end of the wedge to hold one end of the specimen. A scale is provided which gives the wedge separation between the two jaws at any point (see Reference[1]).

The dimensions for the wedge tester are standardized for both a narrow and a wide tester. The narrow wedge (see [Figure 1](#)) has a wedge angle of 9° and a maximum wedge opening of 25 mm. It is generally satisfactory for most films. For more brittle films and papers, a wide wedge (see [Figure 2](#)) is recommended. It has a wedge angle of 28° and a maximum wedge opening of 74 mm.

5.2 Test chamber

An air-conditioned box or walk-in room shall be used for both conditioning and testing. The temperature shall be controlled within ± 1 °C and the relative humidity to within ± 1 % of the specified values. The linear air velocity shall be at least 15 cm/s.

NOTE To control the relative humidity to this accuracy usually requires a dew point method.

If a walk-in conditioned room is used, the air velocity shall be adequate to maintain the conditions specified. The number of personnel permitted in the room during testing shall be limited and precautions shall be taken to prevent the operator's breath reaching the material.

6 Sampling

6.1 Preparation of specimens

Specimens shall be cut in an atmosphere of 20 °C to 23 °C and from 40 % to 55 % relative humidity.

NOTE If the specimens are cut at relative humidities lower than 40 %, it can be difficult to obtain smooth edges. Handling under these conditions can also cause emulsion cracking, which will affect the subsequent brittleness results. Exposure to relative humidities greater than 55 % can permanently alter the subsequent brittleness behaviour of some films and photographic papers.

The cutter shall be of a precision type and shall be kept sharp so that the specimens' edges are smooth and free of nicks. Rubber gloves shall be worn by the operator when handling the specimens, both in their preparation and testing.


6.2 Selection of specimens

A set of 10 specimens shall be prepared for each test. If there is sufficient material, one set of specimens should be cut in the machine direction and a second set in the transverse (cross) direction. If the film has a discrete backing layer, a separate set of specimens shall be cut in at least one of the two principal directions to enable testing with the backing convex.

6.3 Size of specimens

The standard specimen size shall be 350 mm long by 15 mm to 16 mm wide. If the sample size available does not permit a 350 mm specimen length, the length can be effectively increased by taping a film or paper leader to the specimen and placing the specimen end in the clamp.

Although not recommended, 16 mm perforated film may be tested for comparative purposes only, by cutting off the perforated edges and testing a specimen 9 mm wide. Similarly, 35 mm film may be tested, but the results are not necessarily comparable to the standard 15 mm to 16 mm width.

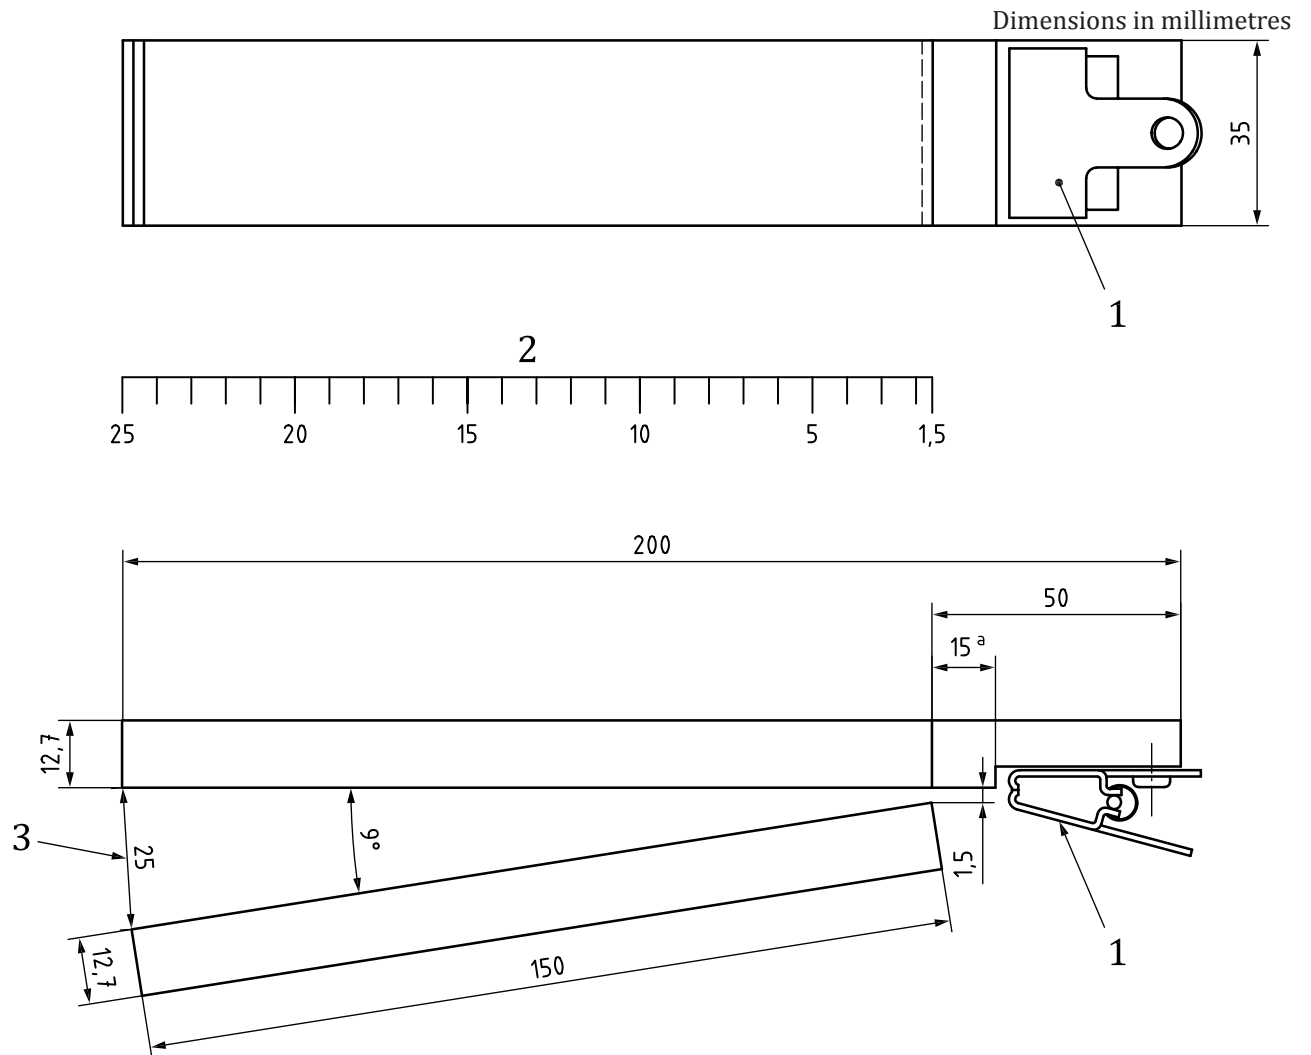


Key

- 1 clamp
- 2 wedge opening scale
- 3 wedge opening

^a This dimension may vary from 2,5 mm to 25 mm.

Figure 1 — Narrow-wedge tester for brittleness

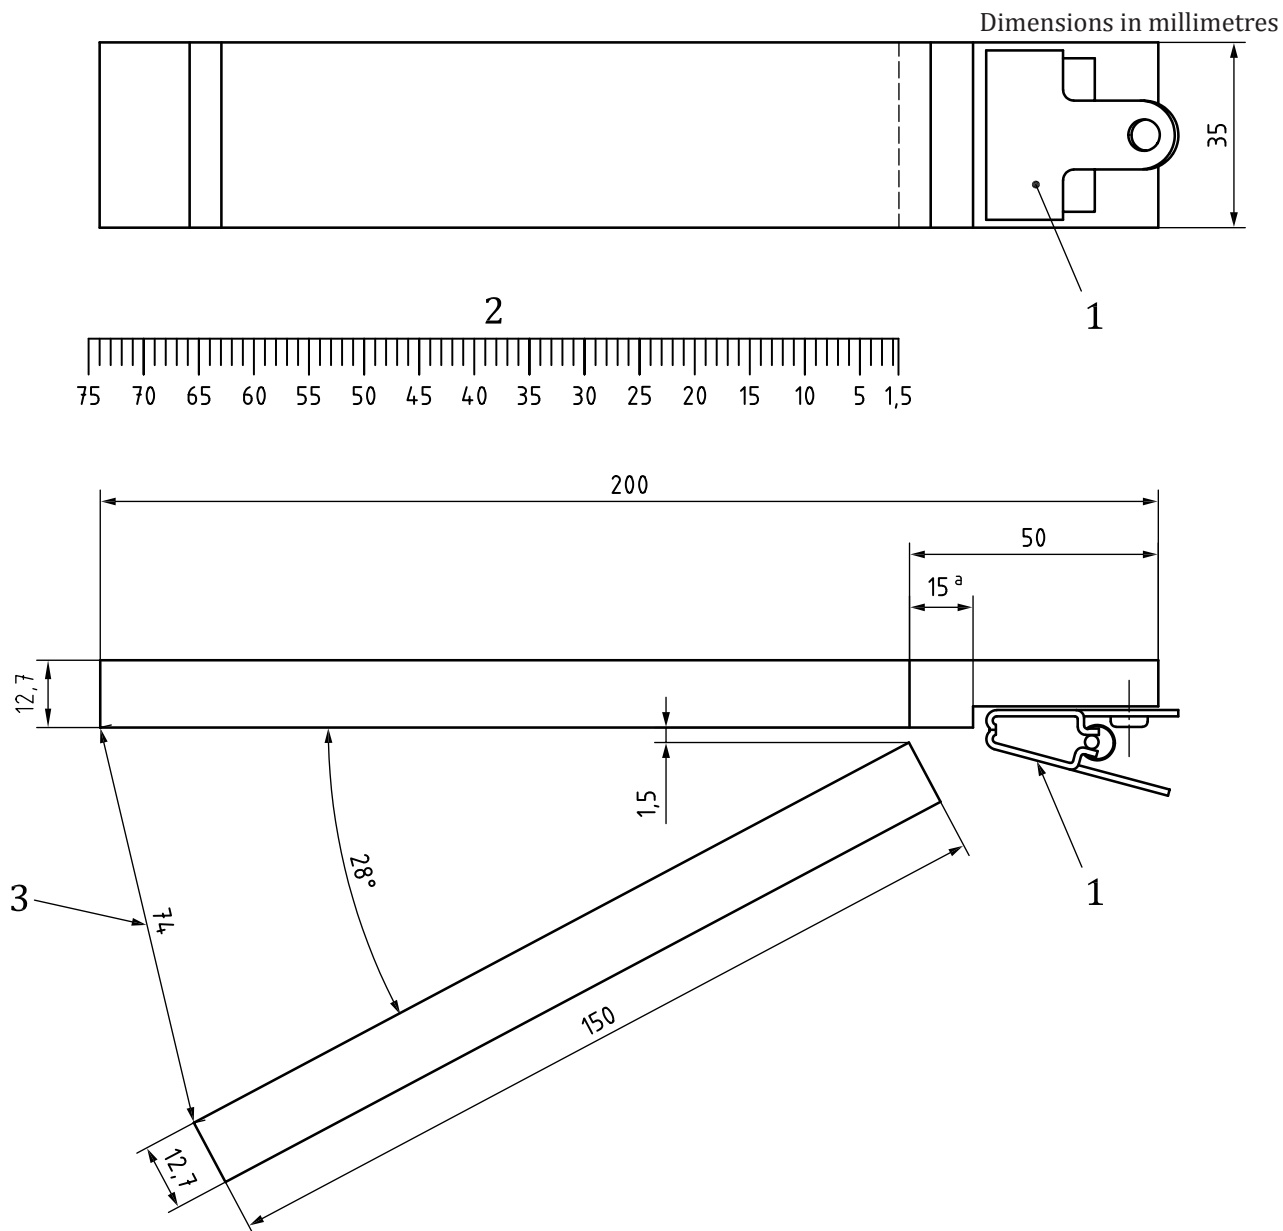

Key

- 1 clamp
- 2 wedge opening scale
- 3 wedge opening

a This dimension may vary from 2,5 mm to 25 mm.

Figure 2 — Wide-wedge tester for brittleness

7 Conditioning and test conditions

7.1 Conditioning of specimens

Specimens shall be conditioned in the test chamber until practicable moisture equilibrium has been reached. This may be determined by weighing the specimens at regular intervals and determining the time at which further conditioning does not appreciably change the mass. In many instances, this time will

be in the vicinity of 4 h for photographic film, 1 d for fibre-based papers, and 7 d for RC papers. However, actual times will vary due to access of the conditioning air and the type and thickness of the material.

The specimens shall be held in racks permitting free circulation of air.

7.2 Test conditions

The standard relative humidity for testing shall be (15 ± 1) %. However, other relative humidities such as 10 %, 20 %, and 35 %, or approximations thereof, utilizing stable saturated solutions in a closed box, can prove useful (see ISO 483).

The standard temperature for testing shall be $23 \text{ }^\circ\text{C} \pm 1 \text{ }^\circ\text{C}$. However, other temperatures may be used where the effect of temperature is to be investigated.

The specimen shall not be removed from the conditioning atmosphere for testing except at a temperature of $0 \text{ }^\circ\text{C}$. For testing film at $0 \text{ }^\circ\text{C}$ or below, the specimens shall be conditioned at the desired relative humidity at $23 \text{ }^\circ\text{C}$, sealed in small, taped cans, cooled long enough to reach the test temperature, and then removed, one at a time, for testing.

NOTE Direct control of relative humidity at temperatures of $0 \text{ }^\circ\text{C}$ or below is impracticable, but once photographic material is conditioned, the rate of gain or loss of moisture is much lower at low temperatures.

8 Procedure

Fasten one end of the specimen in the clamp at the narrow end of the wedge. Loop the material, emulsion side out, within the wedge, with a sufficient length at the free end extending through the narrow opening of the wedge to allow it to be pulled. Make a mark on the clamped end of the specimen at the point where the narrow end of the wedge starts (at the 1,5 mm scale marking). Pull the specimen by the free end completely through the narrow opening of the wedge using a smooth, rapid motion completed within 1 s.

NOTE 1 The speed of testing in the range from 1 s to 6 s had relatively little effect on the brittleness values obtained with several films investigated.

Remove the specimen from the clamp and lay it on the scale with the mark aligned at the end corresponding to 1,5 mm. Read the wedge separation at the point of specimen failure directly from the scale to the nearest 0,5 mm.

If emulsion cracks occur, record the wedge separation for both the first emulsion crack and the complete material break. The former can also be found from the broken specimen by examining both pieces of the material.

NOTE 2 Emulsion cracks can be seen best under strong illumination by a direct (parallel, collimated) light beam. Frequently, emulsion cracks can be examined most easily from the back of the specimen, provided it does not have a backing layer. Holding the material under a slight tension or viewing with transmitted light is sometimes helpful.

Films that have emulsion on both sides or a discrete backing layer shall be tested in duplicate, with each side tested separately.

Photographic film and paper shall have satisfactory adhesion between the emulsion and the support for the wedge separation to reflect brittleness. If the adhesion is not satisfactory, the emulsion will strip from the support during the test and the wedge separation at stripping will be very dependent upon the emulsion-base adhesion and will not reflect brittleness of the complete laminate.

9 Test report

9.1 Test data

Specimens that pass through the narrowest part of the wedge (1,5 mm) without failure shall be arbitrarily assigned a value of 1 mm to enable an arithmetic mean to be calculated with the values for those specimens which fail by breaking.

The following values shall be reported for each manner in which the material was tested (for example, lengthwise, widthwise, emulsion convex, and backing convex):

- mean wedge separation for the first emulsion crack for those specimens that exhibit cracks;
- percentage of specimens showing emulsion cracks;
- mean wedge separation for complete breaks (including values of 1 mm for those specimens which did not break);
- percentage of specimens showing complete breaks;
- mean wedge separation for first failure, whether a crack or break (including values of 1 mm for those specimens which did not fail);
- temperature and relative humidity at which the test was carried out;
- average thickness of the specimen (and width, if not 15 mm to 16 mm);
- whether the narrow or wide wedge was used.

9.2 Significance

It is important to note whether the sample fails by emulsion cracks or by a complete break since this can give information about the reasons for brittleness. Emulsion cracks are influenced by the brittleness of the emulsion layer and the emulsion-base adhesion. Breaks are affected by these two factors together with the brittleness of the base. First-failure measurements give a single value for the brittleness of the laminate but no information as to the cause of the brittleness.

A difference in the mean wedge-test brittleness between two materials of less than 1 mm is not believed to be significant.

A qualitative judgement of the acceptable wedge-test brittleness of a material is very dependent upon its nature and use. For example, a motion-picture film requires a low level of brittleness as it is transported and flexed over small diameter rollers and sprockets when in use. However, a thick-base photographic paper can tolerate much higher wedge values as it is generally not flexed during use.

Bibliography

- [1] ADELSTEIN P.Z. Wedge brittleness test for photographic film. *Photographic Science and Engineering*. 1957 October, **1** (2) pp. 63–68

British Standards Institution (BSI)

BSI is the national body responsible for preparing British Standards and other standards-related publications, information and services.

BSI is incorporated by Royal Charter. British Standards and other standardization products are published by BSI Standards Limited.

About us

We bring together business, industry, government, consumers, innovators and others to shape their combined experience and expertise into standards-based solutions.

The knowledge embodied in our standards has been carefully assembled in a dependable format and refined through our open consultation process. Organizations of all sizes and across all sectors choose standards to help them achieve their goals.

Information on standards

We can provide you with the knowledge that your organization needs to succeed. Find out more about British Standards by visiting our website at bsigroup.com/standards or contacting our Customer Services team or Knowledge Centre.

Buying standards

You can buy and download PDF versions of BSI publications, including British and adopted European and international standards, through our website at bsigroup.com/shop, where hard copies can also be purchased.

If you need international and foreign standards from other Standards Development Organizations, hard copies can be ordered from our Customer Services team.

Subscriptions

Our range of subscription services are designed to make using standards easier for you. For further information on our subscription products go to bsigroup.com/subscriptions.

With **British Standards Online (BSOL)** you'll have instant access to over 55,000 British and adopted European and international standards from your desktop. It's available 24/7 and is refreshed daily so you'll always be up to date.

You can keep in touch with standards developments and receive substantial discounts on the purchase price of standards, both in single copy and subscription format, by becoming a **BSI Subscribing Member**.

PLUS is an updating service exclusive to BSI Subscribing Members. You will automatically receive the latest hard copy of your standards when they're revised or replaced.

To find out more about becoming a BSI Subscribing Member and the benefits of membership, please visit bsigroup.com/shop.

With a **Multi-User Network Licence (MUNL)** you are able to host standards publications on your intranet. Licences can cover as few or as many users as you wish. With updates supplied as soon as they're available, you can be sure your documentation is current. For further information, email bsmusales@bsigroup.com.

BSI Group Headquarters

389 Chiswick High Road London W4 4AL UK

Revisions

Our British Standards and other publications are updated by amendment or revision.

We continually improve the quality of our products and services to benefit your business. If you find an inaccuracy or ambiguity within a British Standard or other BSI publication please inform the Knowledge Centre.

Copyright

All the data, software and documentation set out in all British Standards and other BSI publications are the property of and copyrighted by BSI, or some person or entity that owns copyright in the information used (such as the international standardization bodies) and has formally licensed such information to BSI for commercial publication and use. Except as permitted under the Copyright, Designs and Patents Act 1988 no extract may be reproduced, stored in a retrieval system or transmitted in any form or by any means – electronic, photocopying, recording or otherwise – without prior written permission from BSI. Details and advice can be obtained from the Copyright & Licensing Department.

Useful Contacts:

Customer Services

Tel: +44 845 086 9001

Email (orders): orders@bsigroup.com

Email (enquiries): cservices@bsigroup.com

Subscriptions

Tel: +44 845 086 9001

Email: subscriptions@bsigroup.com

Knowledge Centre

Tel: +44 20 8996 7004

Email: knowledgecentre@bsigroup.com

Copyright & Licensing

Tel: +44 20 8996 7070

Email: copyright@bsigroup.com



...making excellence a habit.™