

**Methods of testing
plastics —
Optical and colour
properties,
weathering —
Determination of
changes in colour and
variations in properties
after exposure to
daylight under glass,
natural weathering or
laboratory light sources**

ICS 83.080.01

National foreword

This British Standard reproduces verbatim ISO 4582:1998 and implements it as the UK national standard. It supersedes BS 2782-5:Method 552A:1981 which is withdrawn.

The UK participation in its preparation was entrusted to Technical Committee PRI/21, Methods of testing plastics, which has the responsibility to:

- aid enquirers to understand the text;
- present to the responsible international/European committee any enquiries on the interpretation, or proposals for change, and keep the UK interests informed;
- monitor related international and European developments and promulgate them in the UK.

A list of organizations represented on this committee can be obtained on request to its secretary.

Cross-references

The British Standards which implement international or European publications referred to in this document may be found in the BSI Standards Catalogue under the section entitled “International Standards Correspondence Index”, or by using the “Find” facility of the BSI Standards Electronic Catalogue.

A British Standard does not purport to include all the necessary provisions of a contract. Users of British Standards are responsible for their correct application.

Compliance with a British Standard does not of itself confer immunity from legal obligations.

Summary of pages

This document comprises a front cover, an inside front cover, pages i and ii, the ISO title page, pages ii to iv, pages 1 to 10 and a back cover.

This standard has been updated (see copyright date) and may have had amendments incorporated. This will be indicated in the amendment table on the inside front cover.

This British Standard, having been prepared under the direction of the Sector Committee for Materials and Chemicals, was published under the authority of the Standards Committee and comes into effect on 15 May 1999

© BSI 02-2000

ISBN 0 580 30286 5

Amendments issued since publication

Amd. No.	Date	Comments

Contents

	Page
National foreword	Inside front cover
Foreword	iii
Text of ISO 4582	1

INTERNATIONAL
STANDARD

ISO
4582

Second edition
1998-07-15

**Plastics — Determination of changes in
colour and variations in properties after
exposure to daylight under glass, natural
weathering or laboratory light sources**

*Plastiques — Détermination des changements de coloration et des
variations de propriétés après exposition à la lumière du jour sous verre,
aux agents atmosphériques ou aux sources lumineuses de laboratoire*



Reference number
ISO 4582:1998(E)

Contents

	Page
Foreword	iii
Introduction	1
1 Scope	1
2 Normative references	1
3 Definitions	2
4 Determination of changes in colour or other appearance attributes	2
4.1 Changes in colour	2
4.1.1 Principles	2
4.1.2 Apparatus	2
4.1.3 Test specimens	2
4.1.4 Procedure	3
4.2 Changes in other appearance properties	3
5 Determination of changes in mechanical or other properties	3
5.1 Principles	3
5.2 Apparatus	4
5.3 Test specimens	4
5.4 Procedure	5
5.4.1 Determination of initial properties	5
5.4.2 Storage of file specimens	5
5.4.3 Determination of properties after exposure	5
6 Expression of results	5
6.1 Changes in colour	5
6.1.1 Instrumental measurements	5
6.1.2 Visual assessment	5
6.2 Changes in other appearance properties	5
6.2.1 Instrumental measurements	5
6.2.2 Visual assessment of change in appearance attributes	5
6.3 Changes in mechanical and other properties	6
7 Precision	6
8 Test report	6
Annex A (normative) Statistical formulae based on ISO 2602 for determination of mean and standard deviation and procedure for determination of time to 50 % loss of property	8
Annex B (informative) Possible effects of surface cleaning on assessment of exposure	10
Figure A.1 — Calculation of exposure time or radiant exposure needed to produce a defined level of a measured property	10
Table 1 — Methods used to measure change in typical appearance properties	4
Table 2 — Typical mechanical-property tests used to assess the effect of exposure on plastics	4

Descriptors: Plastics, tests, environmental tests, daylight tests, artificial light tests, determination, colour fastness, deterioration.

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

International Standard ISO 4582 was prepared by Technical Committee ISO/TC 61, *Plastics*, Subcommittee SC 6, *Ageing, chemical and environmental resistance*.

This second edition cancels and replaces the first edition (ISO 4582:1980), which has been technically revised.

Annex A forms an integral part of this International Standard. Annex B is for information only.

Introduction

A number of different exposure techniques can be used to provide information on the effects of environmental stresses such as light, heat and water on plastics (see ISO 877 and ISO 4892). Each exposure test has its own particular application and relevance. When determining changes in a particular property or attribute of a material subjected to different exposures, the same evaluation methods should be used after all exposures to ensure meaningful results.

Results for plastics subjected to exposure tests are strongly dependent on the type of exposure conditions used, the type of plastic being tested and the property being evaluated. A result obtained for one property may not be the same as that for a different property of the same material, even if the same exposure test is used. This standard is not intended to establish a fixed procedure for conducting the exposure test, but is intended to provide a set of specific procedures used to express the results for change in a characteristic property of the material after it has been exposed. It is up to the user to determine which exposure test conditions are most relevant to the specific material and the service conditions being used.

Test methods should be selected to determine changes in appearance and properties of the exposed material with consideration for its proposed application. The exposure test used should be devised to discriminate among materials based on such changes. This standard suggests typical properties that can be used to determine change in plastics which have been subjected to exposure tests.

NOTE Because of large differences in the spectral distribution of the light sources used, there can be large differences in results for the same plastics exposed in the various devices described in ISO 4892. Therefore, comparisons between plastics should only be made based on results from exposures in the same type of device and under the same conditions. For optimum comparisons, plastics should be exposed at the same time in the same device.

1 Scope

This International Standard describes procedures used to determine changes in colour and other appearance properties, and variations in mechanical or other properties, of plastics that have been exposed to daylight behind glass, natural weathering or light from a laboratory source. The procedure used to analyse data depends on whether the test used to characterize the materials being exposed is destructive or non-destructive. The exposures are conducted under conditions described in specific exposure standards.

2 Normative references

The following standards contain provisions which, through reference in this text, constitute provisions of this International Standard. At the time of publication, the editions indicated were valid. All standards are subject to revision, and parties to agreements based on this International Standard are encouraged to investigate the possibility of applying the most recent editions of the standards indicated below. Members of IEC and ISO maintain registers of currently valid International Standards.

ISO 75 (all parts), *Plastics — Determination of temperature of deflection under load*.

ISO 105-A01:1994, *Textiles — Tests for colour fastness — Part A01: General principles of testing*.

ISO 105-A02:1993, *Textiles — Tests for colour fastness — Part A02: Grey scale for assessing change in colour*.

ISO 105-A03:1993, *Textiles — Tests for colour fastness — Part A03: Grey scale for assessing staining*.

ISO 178:1993, *Plastics — Determination of flexural properties*.

ISO 179 (both parts), *Plastics — Determination of Charpy impact properties*.

ISO 180:—, *Plastics — Determination of Izod impact strength¹⁾*.

ISO 291:1997, *Plastics — Standard atmospheres for conditioning and testing*.

ISO 306:1994, *Plastics — Thermoplastic materials — Determination of Vicat softening temperature (VST)*.

ISO 527 (all parts), *Plastics — Determination of tensile properties*.

ISO 877:1994, *Plastics — Methods of exposure to direct weathering, to indirect weathering using glass-filtered daylight, and to intensified weathering by daylight using Fresnel mirrors*.

ISO 2602:1980, *Statistical interpretation of test results — Estimation of the mean — Confidence interval*.

ISO 2813:1994, *Paints and varnishes — Determination of specular gloss of non-metallic paint films at 20°, 60° and 85°*.

ISO 2818:1994, *Plastics — Preparation of test specimens by machining*.

ISO 4628-6:1990, *Paints and varnishes — Evaluation of degradation of paint coatings — Designation of intensity, quantity and size of common types of defect — Part 6: Rating of degree of chalking by tape method*.

¹⁾ To be published. (Revision of ISO 180:1993)

ISO 4892 (all parts), *Plastics — Methods of exposure to laboratory light sources*.

ISO 6603-1:—, *Plastics — Determination of puncture impact behaviour of rigid plastics — Part 1: Non-instrumented impact test²⁾*.

ISO 6603-2:—, *Plastics — Determination of puncture impact behaviour of rigid plastics — Part 2: Instrumented puncture test³⁾*.

ISO 6721-1:1994, *Plastics — Determination of dynamic mechanical properties — Part 1: General principles*.

ISO 6721-3:1994, *Plastics — Determination of dynamic mechanical properties — Part 3: Flexural vibration — Resonance-curve method*.

ISO 6721-5:1996, *Plastics — Determination of dynamic mechanical properties — Part 5: Flexural vibration — Non-resonance method*.

ISO 7724 (all parts), *Paints and varnishes — Colorimetry*.

ISO 8256:1990, *Plastics — Determination of tensile-impact strength*.

ISO 13468-1:1996, *Plastics — Determination of the total luminous transmittance of transparent materials — Part 1: Single-beam instrument*.

ISO 14782:—, *Plastics — Determination of haze of transparent materials⁴⁾*.

NOTE The above list is not exhaustive and other standard methods for the determination of properties may also be suitable (see 5.1).

3 Definitions

For the purposes of this International Standard, the following definitions apply.

3.1

control

a material which is of similar composition and construction to the test material, used for comparison and exposed at the same time as the test material

3.2

file specimen

a portion of the material to be tested which is stored under conditions in which it is stable, and is used for comparison between the exposed and the original state

3.3

masked area

a portion of the exposed specimen which is protected from light exposure by masking. The masked area is not protected from heat and moisture

3.4

test specimen

a specific portion of the material upon which the testing is to be performed

3.5

replicate specimens

identical pieces of the test material being evaluated which are all exposed, conditioned and tested at the same time

4 Determination of changes in colour or other appearance attributes

4.1 Changes in colour

4.1.1 Principles

Changes in colour of plastics test specimens exposed in accordance with the specific exposure standard (see clause 2) are determined by one of the following methods:

- a) instrumental methods;
- b) visual assessment using a scale.

4.1.2 Apparatus

4.1.2.1 Instruments for measuring colour or changes in colour, conforming to the requirements specified in ISO 7724.

4.1.2.2 Grey scale for assessing change in colour in accordance with ISO 105-A02 or ISO 105-A03 (see also Annex B to this International Standard). In this scale, grade 1 corresponds to the strongest contrast, and grade 5 to zero contrast (two samples with identical colour).

NOTE The dark grey scale of ISO 105-A02 is well suited to assessing the extent of fading of relatively strong colours or deep shades. The use of the near-white grey scale of ISO 105-A03 may be found preferable for assessing the discolouration, e.g. yellowing, of white or near-white specimens.

4.1.3 Test specimens

Specimens of test and control materials shall conform to the requirements of the appropriate International Standard dealing with the specific exposure method used (see clause 2). Whenever possible, a control material of known weathering properties shall be included in the exposure experiment. Unless otherwise specified, at least three replicate specimens of each material being exposed shall be used.

²⁾ To be published. (Revision of ISO 6603-1:1985)

³⁾ To be published. (Revision of ISO 6603-2:1989)

⁴⁾ To be published.

4.1.4 Procedure

4.1.4.1 General

The specific procedure used for assessment of colour changes and any surface cleaning shall be agreed upon by all interested parties and shall be included in the test report. Determine colour changes as specified in the appropriate International Standard.

NOTE 1 Typically, colour changes are determined at a series of exposure stages in order to evaluate the rate of colour change caused by exposure. In some cases, colour change is determined after a predetermined or specified exposure increment. Measurement or visual assessment of colour should be made as soon as possible after specimens are removed from exposure in order to minimize the effect of dark reactions.

NOTE 2 Because of variability in exposure results, comparison of colour change of different materials is best done when the materials are simultaneously exposed in a single exposure device or at the same exterior location.

4.1.4.2 Instrumental assessment

Measure colour on all specimens before exposure and after each exposure stage. If required, measure colour on file specimens of each material when measuring colour on exposed specimens. Follow the procedures described in ISO 7724 when measuring colour and determining colour change with instruments.

4.1.4.3 Visual assessment

Follow the procedure described in ISO 105-A01 when determining colour change by visual assessment. Use a grey scale meeting the requirements of ISO 105-A02 or ISO 105-A03. Compare the contrast rating of the exposed specimen and file specimens using the grey scale. The rating of colour change is the grade on the grey scale which shows the same contrast as between the exposed test specimen and an unexposed file specimen of the same material.

NOTE Current information about suppliers of grey scales can be obtained from the secretariat of ISO/TC 38/SC 1.

If the contrast observed lies between two ratings on the grey scale, it can be characterized by an intermediate rating. For example, a 3-4 rating signifies that, at the given exposure stage, the contrast between the exposed test specimen and the unexposed file specimen is greater than that of rating 4 on the grey scale, but less than that of rating 3.

Report the nature of the colour change in terms of the rating on the grey scale. In addition, the type of colour change shall also be determined and reported. Use the following terms to describe changes in hue, saturation, lightness or combinations of these changes.

- | | |
|------------------------------|----------------------------|
| a) for hue changes: | more blue or less blue |
| | more green or less green |
| | more red or less red |
| | more yellow or less yellow |
| b) for saturation changes: | less intense |
| | more intense |
| c) for changes in lightness: | lighter |
| | darker |

A typical report of colour change by visual assessment would be as follows: "more yellow, less intense, lighter, ISO 105-A02/A03 grey scale 2-3".

4.2 Changes in other appearance properties

In addition to colour change, other appearance properties of plastics may change as a result of exposure. Determine changes in these appearance properties in accordance with relevant International Standards. If the method used to assess property change is not described in an International Standard, include a description of the method used when reporting results. Examples of tests used to determine change in typical appearance properties are shown in Table 1.

5 Determination of changes in mechanical or other properties

5.1 Principles

Surface properties of a plastic can be much more sensitive to changes caused by weathering than bulk properties. Measurement of surface properties, or material properties greatly affected by surface properties, may be more informative in evaluating rigid plastics. The mechanical or other properties measured using destructive tests are determined on several sets of specimens:

- on specimens selected as representative of the material prior to exposure (initial property determination);
- on test specimens exposed for a chosen period in accordance with an appropriate International Standard for the specific exposure used;
- (if required) on file specimens stored in the dark for the same period for which the corresponding test specimens have been exposed.

It is very important that all tests be conducted using exactly the same test procedure and the same specimen-conditioning environment.

Examples of mechanical-property tests which may be used to assess the effect of exposure are shown in Table 2. Such tests yield quantitative data but are destructive so that, if it is required to follow changes through the course of the exposure, an adequate number of replicate test pieces are needed for each exposure increment.

If a property is measured with a non-destructive test, it is recommended that the property be measured on each test specimen prior to exposure and after each exposure increment. Typical properties measured using non-destructive tests include mass, dimensions, surface gloss, transmittance and haze.

5.2 Apparatus

The apparatus shall conform to the appropriate International Standard for the determination of the property being measured.

5.3 Test specimens

For measurement of the property of interest, test specimens shall conform to the appropriate International Standard dealing with the property measurement method. Unless otherwise specified, use at least three replicate specimens of each material being evaluated when non-destructive tests are used. Use at least five replicates of each material being evaluated when destructive tests are used.

Table 1 — Methods used to measure change in typical appearance properties

Property assessed	ISO standard	Quantitative data
Gloss retention	ISO 2813 ^a	yes
Light transmission	ISO 13468-1	yes
Haze	ISO 14782	yes
Chalking	ISO 4628-6 ^a	scale ^b
Mass		yes
Dimensions		yes
Cracking or crazing		scale ^b
Delamination		scale ^b
Warping		scale ^b
Growth of microorganisms		scale ^b
Migration of components to surface		scale ^b

^a Methods for paints applicable to plastics.
^b See 6.2.2 for recommended descriptive scale.

Table 2 — Typical mechanical-property tests used to assess the effect of exposure on plastics

Property assessed	ISO standard
Tensile properties, particularly extension at break	ISO 527
Flexural properties	ISO 178
Impact strength	
Charpy impact strength	ISO 179
Izod impact strength	ISO 180
Non-instrumented puncture test	ISO 6603-1
Instrumented puncture test	ISO 6603-2
Tensile impact test	ISO 8256
Vicat softening temperature	ISO 306
Temperature of deflection under load	ISO 75
Dynamic mechanical thermal analysis	ISO 6721, parts 1, 3 and 5
Chemical changes (for example infrared spectroscopy)	

NOTE For properties measured with destructive tests, exposed specimens may be in the form of a sheet from which the specimens for the particular test have to be cut. However, there may be differences in results between tests conducted where individual test specimens are directly exposed, and tests where individual test specimens are cut from a larger piece that has been subjected to the exposure test.

Test specimens shall be conditioned after machining (see ISO 2818). In addition, it may also be necessary to precondition the sheets prior to machining to facilitate specimen preparation.

5.4 Procedure

5.4.1 Determination of initial properties

Unless otherwise specified, condition the test specimens prior to the determination of initial properties in one of the atmospheres and using the tolerances and the appropriate period specified in ISO 291, or as agreed between the interested parties. For hygroscopic plastics, comparative testing of moisture-sensitive properties (i.e. mechanical, electrical) should be done after the samples have been brought to the same moisture content, preferably the one that corresponds to the equilibrium at 50 % RH and 23 °C.

Determine the property or properties to be evaluated in accordance with the relevant International Standards, or as agreed between the interested parties (see 5.1).

5.4.2 Storage of file specimens

Store file specimens in the dark under normal laboratory conditions, using one of the standard atmospheres specified in ISO 291. Store moisture-sensitive materials in an atmosphere that will not produce changes due to water absorption. This can be accomplished by storing at low relative humidity or in a moisture-proof container. The storage conditions used for reference specimens shall be agreed upon by all interested parties and shall be stated in the test report.

5.4.3 Determination of properties after exposure

Condition the exposed test specimens and the file specimens (see 5.1) under the same conditions as those used for the determination of the initial properties (see 5.4.1) or under conditions agreed upon by all interested parties. Any difference in the conditioning procedures used for initial property determination and for exposed specimens shall be included in the test report.

Using the same measurement method, determine the same property (or properties) on both exposed and, if required, file specimens as was determined on the initial test specimens (see 5.4.1).

NOTE With some tests, the results depend upon which side of the test specimen is exposed. In bending tests, for example, different results are obtained according to whether the exposed surface or the unexposed surface of the test specimen is placed under tension.

6 Expression of results

6.1 Changes in colour

6.1.1 Instrumental measurements

Using the instrumentally measured colour coordinates, determine the colour difference of each replicate specimen in accordance with ISO 7724-3. Calculate the mean colour difference and the standard deviation of the mean.

6.1.2 Visual assessment

Determine the change in colour as described in 4.1.4.3.

6.2 Changes in other appearance properties

6.2.1 Instrumental measurements

Instrumental methods used to characterize appearance properties such as gloss or transparency are typically non-destructive. When non-destructive tests are used, the property is measured on all test specimens before exposure and after each exposure increment.

If change in appearance property is measured by a non-destructive instrumental method, determine the mean and standard deviation for the property change in accordance with the procedures given in ISO 2602. For properties measured using non-destructive tests, the formulae for determining the mean and the standard deviation for the property change are given in clause A.1. If required, calculate the 95 % confidence interval for the property change as well.

In some cases, it may be useful to determine the percent retention of an appearance property after exposure. When percent property retention is determined using a non-destructive test, calculate the mean and standard deviation using the formulae given in clause A.2 at each exposure period where properties are measured.

6.2.2 Visual assessment of change in appearance attributes

Changes in appearance and surface properties which have been estimated qualitatively shall be expressed on a scale agreed between the interested parties. The following is recommended:

- none;
- barely perceptible;
- slight;
- moderate;
- substantial.

When visual assessments of appearance attributes are made, it is recommended to use a comparative reference guide such as photographic standards which illustrate the subjective scale.

NOTE This scale is arbitrary and is best used when one individual assesses several test specimens at the same time. Because of differences between individuals conducting visual assessments, great care is necessary in interpreting results from different observations.

6.3 Changes in mechanical and other properties

Determine the mechanical or other properties of each test specimen in accordance with the relevant International Standards. Determination of mechanical properties often involves destructive tests on individual specimens. When destructive tests are used, compare the results obtained for the exposed specimens with those obtained for the same property measured on file specimens. This comparison can be made in three ways:

a) Measurements of the property of interest made on all replicates from the exposed specimens are compared with measurements of the property made on a set of specimens tested prior to exposure or with measurements made on file specimens made at the same time as the test specimens.

Comparison of data is made using analysis of variance. Unless otherwise specified, the difference in the means of the property measured on exposed and initial or file specimens shall be different at the 95 % confidence level before any change can be considered statistically significant. Use the procedure for analysis of variance given in ISO 2602.

b) The mean and standard deviation for retention of the measured property are determined using data from measurements made on each replicate of the exposed specimens compared to the mean value of the property measured in the initial measurement or on file specimens. When a property is measured with a destructive test, use the equations given in clause **A.3** to determine the mean and standard deviation for the percent property retention.

c) The mean and standard deviation for change in the property are determined using data from measurements made on each replicate of the exposed specimens compared to the mean value of the property measured in the initial property determination or on file specimens. When a property is measured with a destructive test, use the equations given in clause **A.4** to determine the mean and standard deviation for the change in the measured property.

For some properties, for example change in surface gloss, mass or dimensions, results can also be expressed in the form of change in property, measured with non-destructive tests. When non-destructive tests are used, use the equations given in clause **A.1** to determine the mean and standard deviation for the property change or the equations in clause **A.2** to determine the mean and standard deviation for the percent property retention.

It may also be useful to plot change in property against time or radiant energy, but in many cases there can be a considerable spread of results within each set of test specimens and, unless this is taken into account, misleading conclusions can be drawn from a plot of arithmetic means. For some applications, calculation of the time or radiant exposure needed to produce a defined level of the measured property is required. When this type of data is to be reported, the mean and tolerance interval for the exposure time or radiant exposure shall be determined using the procedure described in clause **A.5**.

7 Precision

The precision of the results reported in accordance with this standard depends on the precision of the specific test methods used to measure the properties evaluated and the variability of the exposure test. Therefore, no specific precision statement is possible. The procedures specified in this standard attempt to give the user an indication of the precision of the results obtained by requiring reporting both the mean and standard deviation for all test results.

8 Test report

The test report shall include the following:

- a) reference to this International Standard;
- b) all details necessary for identification of the product tested;
- c) a complete description of the exposure test used, including the following:
 - 1) for exposure to laboratory light sources the type of exposure device used, the light source and filters used, a complete description of the exposure cycle (temperature, period of light exposure, dark exposure and moisture exposure, etc.), the length of the exposure stage, a reference to the relevant International Standard,
 - 2) for exposure to natural weathering or daylight behind glass

the exposure location,
the dates of exposure,
the total exposure time,
if required, the radiant energy of exposure and
the bandpass in which it was measured,
a description of the conditions in which the
specimens were mounted on the exposure
rack,
a reference to the relevant International
Standard;
d) a complete description of the methods used to
measure reported properties, with reference to
the appropriate International Standard where
appropriate;

e) the conditioning procedures used (where
appropriate, by reference to the relevant
International Standard);
f) if applicable, the procedure used for cleaning
the test specimens (see the note);
g) the colour change, from instrumental or visual
assessment, at each exposure stage;
h) the mean and standard deviation for results
determined in accordance with **5.4** and/or
clause **6**.

NOTE Cleaning the surface of exposed specimens can affect
appearance. More information about the possible effects of
cleaning specimens prior to testing can be found in Annex B.

Annex A (normative)

Statistical formulae based on ISO 2602 for determination of mean and standard deviation and procedure for determination of time to 50 % loss of property

A.1 Calculation of mean and standard deviation for property changes measured using non-destructive tests

Calculate the change c_i for each replicate specimen as follows:

$$c_i = x_{0,i} - x_{t,i}$$

where

$x_{0,i}$ is the initial property value;

$x_{t,i}$ is the value of the property at exposure time t .

Determine the mean property change \bar{c} using the equation

$$\bar{c} = \frac{\sum_{i=1}^n c_i}{n}$$

where n is the number of replicates.

Calculate the standard deviation $s_{\bar{c}}$ of the mean property change using the equation

$$s_{\bar{c}} = \sqrt{\frac{\sum_{i=1}^n (c_i - \bar{c})^2}{n - 1}}$$

A.2 Calculation of mean and standard deviation for percent property retention measured using non-destructive tests

Calculate the percent property retention R_i for each replicate specimen as follows:

$$R_i = \frac{x_{t,i}}{x_{0,i}} \times 100$$

where

$x_{0,i}$ is the initial property value;

$x_{t,i}$ is the value of the property at exposure time t .

Calculate the mean percent property retention \bar{R} as follows:

$$\bar{R} = \frac{\sum_{i=1}^n R_i}{n}$$

where n is the number of replicates.

Calculate the standard deviation $s_{\bar{R}}$ for the percent property retention as follows:

$$s_{\bar{R}} = \sqrt{\frac{\sum_{i=1}^n (R_i - \bar{R})^2}{n - 1}}$$

A.3 Calculation of mean and standard deviation for percent property retention for properties measured using destructive tests

Calculate the mean of the measured property from the initial determination or from measurements on the file specimens, using the following equations:

When using initial property measurements

$$\bar{x}_0 = \frac{\sum_{i=1}^n x_{0,i}}{n}$$

where

$x_{0,i}$ is the initial property value;

n is the number of replicates.

When using measurements made on file specimens

$$\bar{x}_f = \frac{\sum_{i=1}^n x_{f,i}}{n}$$

where

$x_{f,i}$ is the value of the property for each file specimen;

n is the number of replicate file specimens.

Determine the percent retention $R_{e,i}$ for each of the exposed specimens using either the equation

$$R_{e,i} = \frac{x_{e,i}}{\bar{x}_0} \times 100$$

or the equation

$$R_{e,i} = \frac{x_{e,i}}{\bar{x}_f} \times 100$$

depending whether retention is expressed as a percentage of the initial value obtained for the specimens exposed or as a percentage of the value measured on file specimens,

where $x_{e,i}$ is the value of the property for each exposed specimen.

Determine the mean percentage property retention \bar{R}_e using the equation

$$\bar{R}_e = \frac{\sum_{i=1}^n R_{e,i}}{n}$$

where n is the number of replicate exposed specimens.

NOTE The mean percent property retention can be obtained from measurements made using non-destructive tests (see clause A.2) or destructive tests (this clause).

Use the following equation to determine the standard deviation $s_{\bar{R}_e}$ for percent property retention:

$$s_{\bar{R}_e} = \sqrt{\frac{\sum_{i=1}^n (R_{e,i} - \bar{R}_e)^2}{n-1}}$$

A.4 Calculation of mean and standard deviation for the change in property measured by destructive tests, when the change is relative to the mean of the initial values of the property or to the mean of the values obtained on file specimens

Determine the mean initial value of the property or the mean value from file specimens as described in clause A.3.

Use one of the following equations to determine the change in property $c_{e,i}$ of each of the exposed specimens:

$$c_{e,i} = x_{e,i} - \bar{x}_0$$

$$c_{e,i} = x_{e,i} - \bar{x}_f$$

where

$x_{e,i}$ is the value of the property for each exposed specimen;

\bar{x}_0 is the mean of the initial values of the property;

\bar{x}_f is the mean of the values obtained on file specimens.

Determine the mean change in the property $\bar{c}_{e,i}$ using the equation

$$\bar{c}_{e,i} = \frac{\sum_{i=1}^n c_{e,i}}{n}$$

where n is the number of exposed specimens.

Determine the standard deviation of the mean change in the property using the equation

$$s_{\bar{c}_{e,i}} = \sqrt{\frac{\sum_{i=1}^n (c_i - \bar{c}_{e,i})^2}{n-1}}$$


A.5 Calculation of exposure time or radiant exposure to 50 % loss of property

Use the following procedure to determine the mean exposure time or the mean radiant energy necessary to produce the defined property change, plus the corresponding tolerance interval:

- Prepare at least five separate sets of specimens for exposure. Each specimen set shall contain at least three replicate specimens of the material being exposed.
- Expose all the specimen sets at the same time in a single exposure device. Remove specimen sets sequentially so that the last set removed has been exposed sufficiently to produce more than a 50 % loss in the property of interest. Remove specimens at the end of an appropriate dry period in the exposure and store specimens in the dark at 20 °C to 25 °C and 50 % relative humidity until the property has been measured.
- After each specimen set has been removed from the exposure device, determine the mean and standard deviation for the property of interest.
- When all exposures have been completed, plot all data points, the mean, mean – 2 × standard deviation and mean + 2 × standard deviation for the property of interest as a function of exposure time in hours or radiant exposure.
- Use graphical interpolation of the plots of mean – 2 × standard deviation and mean + 2 × standard deviation to determine the tolerance interval for the time or radiant exposure needed for the property of interest to fall to the defined value. Figure A.1 shows a typical plot and illustrates how the tolerance interval for the exposure time or radiant exposure necessary to produce a 50 % loss in the property is determined.

Report the mean and upper and lower limits of the tolerance interval for the exposure time or radiant exposure to produce the defined change in the property.

NOTE This procedure is used for the data for a single experiment in a single laboratory. When the results from additional exposures in different laboratories are taken into consideration, the range of possible exposure times will be larger.

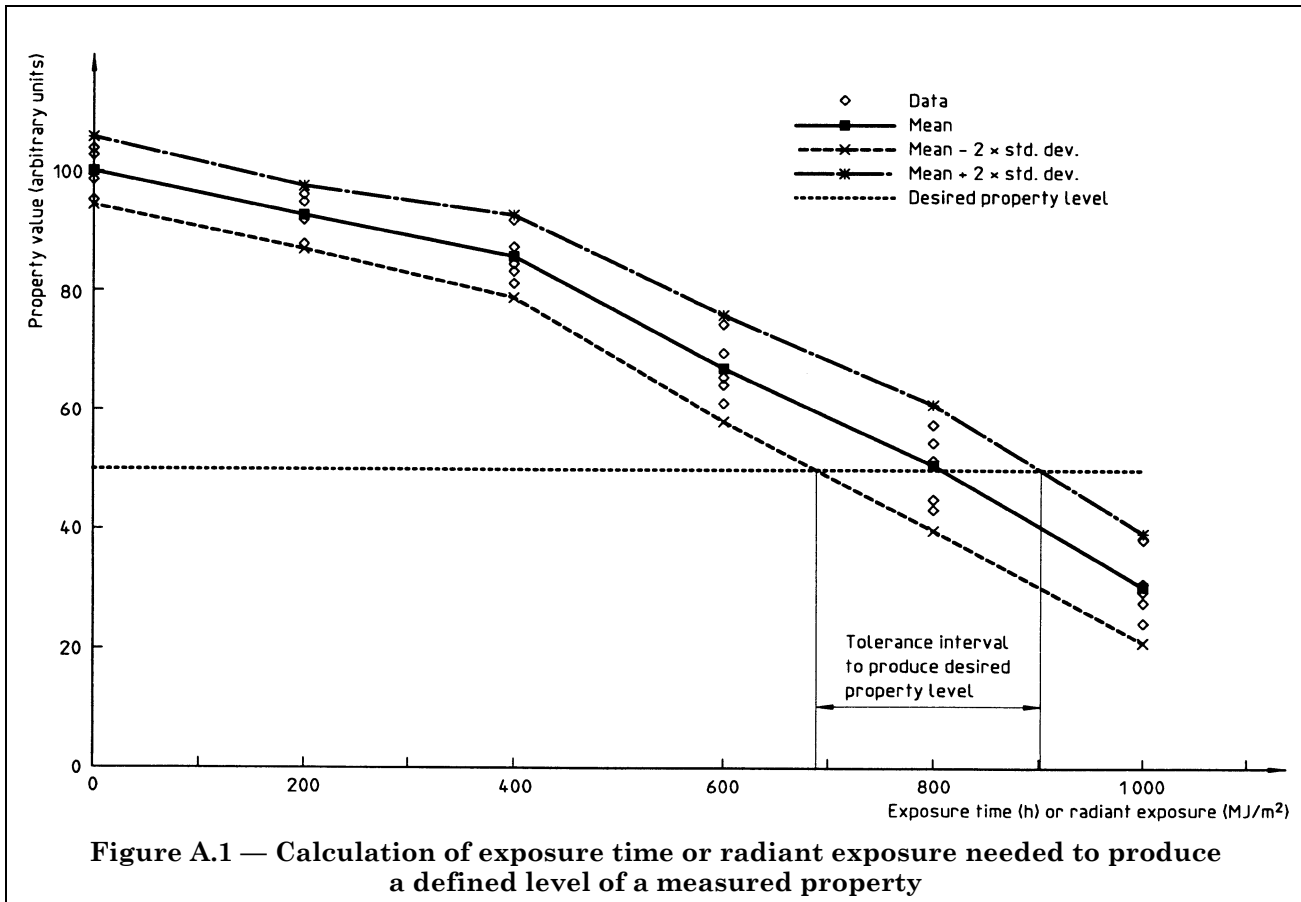

Annex B (informative)

Possible effects of surface cleaning on assessment of exposure

Surfaces should preferably be cleaned using soft tissue paper soaked in distilled or deionized water with no additives and using the least abrasive/polishing action needed to be effective. However, cleaning the exposed surfaces of test specimens is likely to affect the appearance. This is particularly the case with naturally weathered specimens since the exposed surfaces are likely to become contaminated by dirt, microorganisms, etc. Cleaning is then needed to assess the underlying colour change of the test surfaces of opaque materials or the light transmission of transparent materials.

Cleaning may have a polishing effect on the surface that produces measurably increased gloss. It will also tend to remove microbiological growth together with any loosely adhering breakdown products of the material itself, commonly known as “chalking” (see ISO 4628-6). As a result, it can be difficult to compare results between natural-weathering sites or between laboratory-accelerated exposures. The latter should not require cleaning to remove dirt, although chalking can occur. Accumulated dirt or chalking residues may have a protective effect on the exposed surface.

In order to examine more clearly the effects of cleaning, it is suggested that duplicate specimens be exposed, both in natural and laboratory tests. One specimen should be left uncleaned for the whole exposure (see ISO 877:1994, subclause 9.4) measuring, say, colour and gloss and noting any microorganism growth at the prescribed intervals. The other specimen should be measured in the uncleaned condition, then carefully cleaned and measured at the same intervals.

BSI — British Standards Institution

BSI is the independent national body responsible for preparing British Standards. It presents the UK view on standards in Europe and at the international level. It is incorporated by Royal Charter.

Revisions

British Standards are updated by amendment or revision. Users of British Standards should make sure that they possess the latest amendments or editions.

It is the constant aim of BSI to improve the quality of our products and services. We would be grateful if anyone finding an inaccuracy or ambiguity while using this British Standard would inform the Secretary of the technical committee responsible, the identity of which can be found on the inside front cover. Tel: 020 8996 9000. Fax: 020 8996 7400.

BSI offers members an individual updating service called PLUS which ensures that subscribers automatically receive the latest editions of standards.

Buying standards

Orders for all BSI, international and foreign standards publications should be addressed to Customer Services. Tel: 020 8996 9001. Fax: 020 8996 7001.

In response to orders for international standards, it is BSI policy to supply the BSI implementation of those that have been published as British Standards, unless otherwise requested.

Information on standards

BSI provides a wide range of information on national, European and international standards through its Library and its Technical Help to Exporters Service. Various BSI electronic information services are also available which give details on all its products and services. Contact the Information Centre. Tel: 020 8996 7111. Fax: 020 8996 7048.

Subscribing members of BSI are kept up to date with standards developments and receive substantial discounts on the purchase price of standards. For details of these and other benefits contact Membership Administration. Tel: 020 8996 7002. Fax: 020 8996 7001.

Copyright

Copyright subsists in all BSI publications. BSI also holds the copyright, in the UK, of the publications of the international standardization bodies. Except as permitted under the Copyright, Designs and Patents Act 1988 no extract may be reproduced, stored in a retrieval system or transmitted in any form or by any means – electronic, photocopying, recording or otherwise – without prior written permission from BSI.

This does not preclude the free use, in the course of implementing the standard, of necessary details such as symbols, and size, type or grade designations. If these details are to be used for any other purpose than implementation then the prior written permission of BSI must be obtained.

If permission is granted, the terms may include royalty payments or a licensing agreement. Details and advice can be obtained from the Copyright Manager. Tel: 020 8996 7070.