### International Standard



INTERNATIONAL ORGANIZATION FOR STANDARDIZATION●MEЖДУНАРОДНАЯ ОРГАНИЗАЦИЯ ПО СТАНДАРТИЗАЦИИ●ORGANISATION INTERNATIONALE DE NORMALISATION

# Modular units for machine tool construction — Spindle noses and adjustable adaptors for multi-spindle heads

Éléments standards pour la construction des machines-outils — Nez de broches et douilles de réglage pour têtes multibroches

Second edition - 1985-12-01

#### **Foreword**

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work.

Draft International Standards adopted by the technical committees are circulated to the member bodies for approval before their acceptance as International Standards by the ISO Council. They are approved in accordance with ISO procedures requiring at least 75 % approval by the member bodies voting.

International Standard ISO 2905 was prepared by Technical Committee ISO/TC 39, *Machine tools*.

ISO 2905 was first published in 1974. This second edition cancels and replaces the first edition, of which the tolerance on the adjustable adaptor outside diameter, d, has been technically revised.

Users should note that all International Standards undergo revision from time to time and that any reference made herein to any other International Standard implies its latest edition, unless otherwise stated.

🕒 International Organization for Standardization, 1985 🏽 •

## Modular units for machine tool construction — Spindle noses and adjustable adaptors for multi-spindle heads

#### 1 Scope and field of application

This International Standard specifies dimensions for spindle noses for use with adjustable adaptors and quick-change adaptors used in multi-spindle heads.

It specifies requirements for three types of adjustable adaptors to fit taper shank drills, reamers and spot-facing cutters, used in multi-spindle heads.

#### 2 References

ISO 296, Machine tools - Self-holding tapers for tool shanks.

ISO 2901, ISO metric trapezoidal screw threads — Basic profile and maximum material profiles.

ISO 2903, ISO metric trapezoidal screw threads — Tolerances.

#### 3 Spindle noses

#### 3.1 Nominal sizes

The nominal size of the spindle nose shall be its nominal bore, which shall be identical with the nominal diameter of the adjustable adaptor with which it is to be used.

The range of nominal sizes is as follows:

8, 10, 12, 16, 20, 25, 28, 36 and 48 mm

#### 3.2 Interchangeability

Spindle noses shall be capable of accepting adjustable adaptors manufactured in accordance with clause 4.

#### 3.3 Dimensions

Dimensions shall comply with those given in table 1.

#### 3.4 Locking screw

For reasons of safety, it is important that the locking screw when tightened does not protrude beyond the outside diameter of the spindle nose. Locking screws are therefore to be reduced in length if necessary; this correction should be carried out when the position of the adjustable adaptor in the spindle nose corresponds with the maximum wear of the tool.

#### 4 Adjustable adaptors

#### 4.1 Nominal sizes

The nominal size of an adaptor shall be its nominal outside diameter, which shall be identical with the nominal bore of the spindle nose with which it is to be used.

The range of nominal sizes is as follows:

8, 10, 12, 16, 20, 25, 28, 36 and 48 mm.

#### 4.2 Interchangeability

Adaptors shall be capable of fitting spindle noses manufactured in accordance with clause 3.

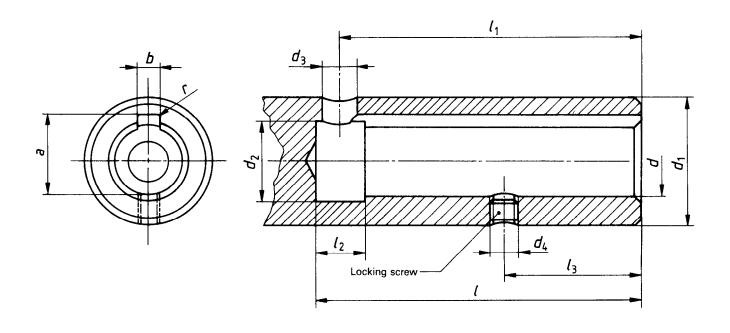


Table 1

Dimensions in millimetres

d	<i>a</i>	b	d <sub>1</sub> <sup>1)</sup>	d <sub>2</sub> <sup>2)</sup>	<i>d</i> <sub>3</sub>	d <sub>4</sub>	l	/1	l <sub>2</sub>	/3	r	Locking
Н7	+ 0,3 0	C11				6Н	min.			±0,1	max.	screw
8	9	2	15	8,6	3,5	M4	42	35	8	16	0,2	M4 - 5
10	11	3	18	10,6	5	M5	52	48	8	22	0,2	M5 - 5
12	13	3	20	12,6	5	M5	52	48	8	22	0,2	M5 - 5
16	17,3	5	25	16,4	6	M6	74	70	8	34	0,2	M6 - 6
20	21,3	5	32	20,4	6	M6	77	73	8	34	0,2	M6 - 6
25	26,7	6	37	25,4	8	M8	85	80	10	38	0,4	M8 - 6
28	29,7	6	40	28,4	8	M8	85	80	10	38	0,4	M8 - 8
36	37,7	8	50	36,6	10	M8	106	101	10	45	0,4	M8 - 8
48	50,1	10	67	48,6	12	M10	129	123	12	57	0,4	M10 - 10

<sup>1)</sup> For nominal diameters 8 to 12, diameter  $d_1$  depends on the design requirements; the values are therefore given for information only. For nominal diameters 16 to 48, the tolerance on  $d_1$  is f7 only if quick-change adaptors are to be used.

<sup>2)</sup> These values are given for information only.

#### 4.3 Dimensions

Dimensions shall comply with those given in tables 2 and 3.

#### 4.4 Threads

Threads shall comply with ISO 2901 and ISO 2903, except in the case of special material requirements for the major diameter on which the tolerance shall be g6 and for the pitch of 1 mm provided for the nominal size of 8 mm.

#### 4.5 Bore taper

The bore of the adaptor body shall be tapered in accordance with ISO 296.

#### 4.6 Drift slot

The drift slot of the appropriate self-holding taper complying with ISO 296 shall be provided 90° from the Woodruff key.

#### 4.7 Locking screw (for nominal diameters 16 to 48)

For reasons of safety, it is important that the locking screw when tightened does not protrude beyond the outside diameter of the knurled portion of the nut. Locking screws are therefore to be reduced in length if necessary so that they do not protrude when the nut is locked.

### 4.8 Lead-in of the adjustable adaptors in the spindle noses

For types A and B, a suitable form of lead-in shall be machined on the closed end of the adaptor body, to facilitate insertion into the spindle nose.

#### 4.9 Marking

The body of the adaptor shall be marked with the type, nominal size, size of Morse taper and, for type B adaptors only, the extension length.


Examples: A 10/Metr. 6

B 20/1/50 C 28/3

#### Type A - Short

#### Type B — Long

For other dimensions, see type A

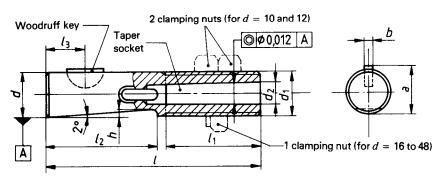

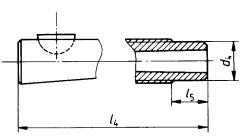


Table 2

Dimensions in millimetres


d	d <sub>1</sub> *	d	2 Basic	(	7	b	h	l	<i>l</i> <sub>1</sub>	12	<i>l</i> <sub>3</sub>	$d_4$	14	l <sub>5</sub>	Woodruff	Range of	
g6		Taper	diameter		tol.	P9/h9	max.								key	adjustment	
													72	10			
10	Tr 10 × 1,5	5 Metr. No. 6 6 10,9 0 3 1 62 28 32	32	10	8	82	20	3 × 5	16								
													92	30			
													72	10			
12	Tr 12 × 1,5	Metr. No. 6	6	12,9	0	3	1	62	28	32	10	10	82	20	3 × 5	16	
'-	11 12 / 1,0		· ·	,	- 0,20		•						92	30			
										<u></u>			102	40			
													110	25			
16	Tr 16 × 1,5	1,5 Morse 9,045 or 17,1 0 5 1,3 85	40	43	11	14	135 5	50	5 × 6,5	28							
	,	No. 0 or 1	12,065		-0,25		,						160	75			
				-		ļ					_		185	100			
	Tr 20 × 2		12,065		0 -0,25		1,3	88		46			113	25	5 × 7,5		
20		Morse No. 1		21,1		5			40		13	17	138	50		28	
													163 188	75 100			
<b></b>				-								-	120	25			
	Tr 25 × 2	Morse No. 1 or 2	12,065 or 17,780						42				145	50	6 × 9		
25				26,5	0 - 0,25	6	1,5	95		51	15	22	170	75		30	
			17,700										195	100			
ļ										-			120	25			
		Morse	12,065										145	50	6 × 9		
28	Tr 28 × 2	No. 1 or 2	or 17,780	29,5	0 - 0,25	6	1,5	95	42	51	15	25	170	75		30	
			,.										195	100			
											<u> </u>	ļ	148	30			
		Morse	17,780		0								178	60			
36	Tr 36 × 2	No. 2 or 3	or 23,825	37,5	- 0,35	8	1,7	118	50	65	20	33	208	90	8 × 11	36	
													238	120			
	T- 49 × 2											1	184	40	- 10 × 13		
48		Morse	23,825 or 31,267	40.0	0 - 0,35	10	22	144	6=	76	24	AE.	224	80		47	
**	Tr 48 × 2	No. 3 or 4		49,9		10	2,2	144	05	76	24	43	264	120		"'	
										<u> </u>			304	160			

Tolerance g6 on the major diameter.

Dimensions and tolerances in millimetres

#### Type C - Extra long

d = 8 to 12

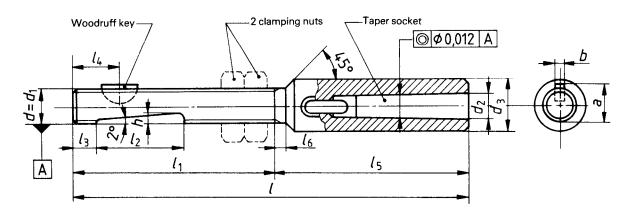

d = 16 to 36




Table 3

Dimensions in millimetres

d	<i>d</i> <sub>1</sub>	$d_2$		d <sub>3</sub>	C	7	b	h	1	11	12	<i>l</i> <sub>3</sub>	14	l <sub>5</sub>	16	Woodruff	Range of
g6		Taper	Basic diameter			tol.	P9/h9	max.								key	adjust- ment
8	Tr 8 × 1	Metr. No. 6	6	12	8,8	0 - 0,1	2	1,5	96	50	22	4	10	46	2	2 × 3,7	12
10	Tr 10 × 1,5	Morse No. 0	9,045	18	10,9	0 - 0,15	3	2	135	62	28	4	10	73	3	3 × 5	16
12	Tr 12 × 1,5	Morse No. 0	9,045	18	12,9	0 - 0,2	3	2	135	62	28	4	10	73	3	3 × 5	16
16	Tr 16 × 1,5	Morse No. 2	17,780	28	17,1	0 0,25	5	1,3	182	88	43	_	11	94	3	5 × 6,5	28
20	Tr 20 × 2	Morse No. 2	17,780	28	21,1	0 - 0,25	5	1,3	182	88	46	-	13	94	3	5 × 7,5	28
25	Tr 25 × 2	Morse No. 3	23,825	36	26,5	0 - 0,25	6	1,5	212	95	51	_	15	117	3	6 × 9	30
28	Tr 28 × 2	Morse No. 3	23,825	36	29,5	0 - 0,25	6	1,5	212	95	51	_	15	117	3	6 × 9	30
36	Tr 36 × 2	Morse No. 4	31,267	48	37,5	0 - 0,35	8	1,7	264	118	65	-	20	146	3	8 × 11	36

#### 5 Clamping nuts

#### Dimensions and tolerances in millimetres

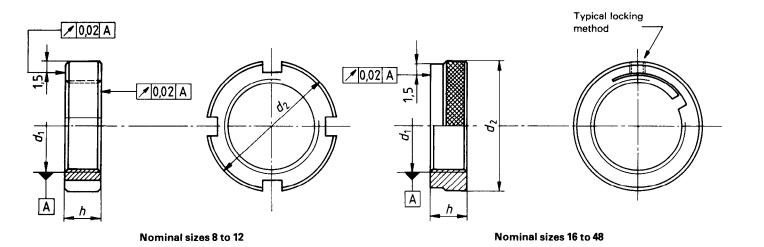


Table 4 Dimensions in millimetres

Nominal size	Thread d <sub>1</sub>	d <sub>2</sub>	h
8	Tr 8 × 1	14,8 0	5
10	Tr 10 × 1,5	17,8 0 -0,2	6
12	Tr 12 × 1,5	19,7 0	6
16	Tr 16 × 1,5	24,6	12
20	Tr 20 × 2	31,6	12
25	Tr 25 × 2	36,6	12
28	Tr 28 × 2	39,6	12
36	Tr 36 × 2	49,6	14
48	Tr 48 × 2	66,6	18