

Plastics — Determination of resistance to environmental stress cracking (ESC) —

Part 4: Ball or pin impression method

The European Standard EN ISO 22088-4:2006 has the status of a British Standard

ICS 83.080.01

National foreword

This British Standard was published by BSI. It is the UK implementation of EN ISO 22088-4:2006. It supersedes BS EN ISO 4600:1998 which is withdrawn.

The UK participation in its preparation was entrusted to Technical Committee PRI/21, Testing of plastics.

A list of organizations represented on PRI/21 can be obtained on request to its secretary.

This publication does not purport to include all the necessary provisions of a contract. Users are responsible for its correct application.

Compliance with a British Standard cannot confer immunity from legal obligations.

This British Standard was published under the authority of the Standards Policy and Strategy Committee on 29 September 2006

© BSI 2006

ISBN 0 580 48765 2

Amendments issued since publication

Amd. No.	Date	Comments

English Version

**Plastics - Determination of resistance to environmental stress
cracking (ESC) - Part 4: Ball or pin impression method (ISO
22088-4:2006)**

Plastiques - Détermination de la fissuration sous contrainte
dans un environnement donné (ESC) - Partie 4: Méthode
par enfoncement de billes ou de goupilles (ISO 22088-
4:2006)

Kunststoffe - Bestimmung der Beständigkeit gegen
umgebungsbedingte Spannungsrissbildung (ESC) - Teil 4:
Kugel- oder Stifteindruckverfahren (ISO 22088-4:2006)

This European Standard was approved by CEN on 21 July 2006.

CEN members are bound to comply with the CEN/CENELEC Internal Regulations which stipulate the conditions for giving this European Standard the status of a national standard without any alteration. Up-to-date lists and bibliographical references concerning such national standards may be obtained on application to the Central Secretariat or to any CEN member.

This European Standard exists in three official versions (English, French, German). A version in any other language made by translation under the responsibility of a CEN member into its own language and notified to the Central Secretariat has the same status as the official versions.

CEN members are the national standards bodies of Austria, Belgium, Cyprus, Czech Republic, Denmark, Estonia, Finland, France, Germany, Greece, Hungary, Iceland, Ireland, Italy, Latvia, Lithuania, Luxembourg, Malta, Netherlands, Norway, Poland, Portugal, Romania, Slovakia, Slovenia, Spain, Sweden, Switzerland and United Kingdom.



EUROPEAN COMMITTEE FOR STANDARDIZATION
COMITÉ EUROPÉEN DE NORMALISATION
EUROPÄISCHES KOMITEE FÜR NORMUNG

Management Centre: rue de Stassart, 36 B-1050 Brussels

Foreword

This document (EN ISO 22088-4:2006) has been prepared by Technical Committee ISO/TC 61 "Plastics" in collaboration with Technical Committee CEN/TC 249 "Plastics", the secretariat of which is held by IBN.

This European Standard shall be given the status of a national standard, either by publication of an identical text or by endorsement, at the latest by February 2007, and conflicting national standards shall be withdrawn at the latest by February 2007.

This document supersedes EN ISO 4600:1997.

According to the CEN/CENELEC Internal Regulations, the national standards organizations of the following countries are bound to implement this European Standard: Austria, Belgium, Cyprus, Czech Republic, Denmark, Estonia, Finland, France, Germany, Greece, Hungary, Iceland, Ireland, Italy, Latvia, Lithuania, Luxembourg, Malta, Netherlands, Norway, Poland, Portugal, Romania, Slovakia, Slovenia, Spain, Sweden, Switzerland and United Kingdom.

Endorsement notice

The text of ISO 22088-4:2006 has been approved by CEN as EN ISO 22088-4:2006 without any modifications.

INTERNATIONAL
STANDARD

ISO
22088-4

First edition
2006-08-15

**Plastics — Determination of resistance to
environmental stress cracking (ESC) —**

Part 4:

Ball or pin impression method

*Plastiques — Détermination de la fissuration sous contrainte dans un
environnement donné (ESC) —*

Partie 4: Méthode par enfoncement de billes ou de goupilles



Reference number
ISO 22088-4:2006(E)

Contents

Page

Foreword.....	iv
1 Scope	1
2 Normative references	2
3 Terms and definitions.....	2
4 Principle.....	4
5 Apparatus	4
6 Test specimens	6
6.1 Shape	6
6.2 State	6
6.3 Number of test specimens.....	7
7 Conditioning and test conditions.....	7
7.1 Conditioning.....	7
7.2 Test temperature.....	7
7.3 Chemical medium	7
8 Procedure	8
8.1 Cleanness	8
8.2 Drilling the test specimens	8
8.3 Insertion of balls or pins	8
8.4 Immersion in the chemical medium.....	9
8.5 Exposure in air	10
8.6 Determination of stress cracking.....	10
9 Expression of results	10
9.1 Type A test specimen	10
9.2 Type B test specimen — Graphical evaluation.....	10
10 Precision.....	10
11 Test report	11
Bibliography	13

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 22088-4 was prepared by Technical Committee ISO/TC 61, *Plastics*, Subcommittee SC 6, *Ageing, chemical and environmental resistance*.

It cancels and replaces ISO 4600:1992, which has been technically revised.

ISO 22088 consists of the following parts, under the general title *Plastics — Determination of resistance to environmental stress cracking (ESC)*:

- *Part 1: General guidance*
- *Part 2: Constant tensile load method* (replacement of ISO 6252:1992)
- *Part 3: Bent strip method* (replacement of ISO 4599:1986)
- *Part 4: Ball or pin impression method* (replacement of ISO 4600:1992)
- *Part 5: Constant tensile deformation method* (new test method)
- *Part 6: Slow strain rate method* (new test method)

Plastics — Determination of resistance to environmental stress cracking (ESC) —

Part 4: Ball or pin impression method

1 Scope

1.1 This part of ISO 22088 specifies a ball or pin impression method for the determination of the environmental stress cracking (ESC) behaviour of plastics by means of a constant-strain test.

1.2 The method is applicable to finished products and to test specimens prepared by moulding and/or machining, and can be used for the assessment of the ESC behaviour of a plastic product or material exposed to different environments, as well as for the determination of the ESC behaviour of different plastics materials exposed to a specific environment.

NOTE Alternative methods for the determination of environmental stress cracking by means of a constant-strain test are specified in ISO 22088-3 and ISO 22088-5. A method for the determination of environmental stress cracking by means of a constant-stress test is specified in ISO 22088-2.

1.3 The ball and pin impression methods are both quick and sensitive procedures for assessing the ESC behaviour of plastics. The methods are well suited for amorphous plastics. They are less appropriate for materials displaying a pronounced tendency for creep and/or stress relaxation, i.e. for semi-crystalline materials. If semi-crystalline materials are tested, pins are more appropriate than balls.

1.4 The ball impression method is useful for assessing the principal ESC behaviour of the material/chemical combination under consideration. It is less influenced by the near-surface orientation state of the specimens than the pin impression method and the methods in the other parts of this International Standard, where the chemical attacks only the original surface of the material. This, depending on the manner of specimen preparation, may show a considerable degree of orientation.

1.5 The pin impression method is useful for testing specimens of small thickness and finished parts.

2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 178, *Plastics — Determination of flexural properties*

ISO 291, *Plastics — Standard atmospheres for conditioning and testing*

ISO 293, *Plastics — Compression moulding of test specimens of thermoplastic materials*

ISO 294-1, *Plastics — Injection moulding of test specimens of thermoplastic materials — Part 1: General principles, and moulding of multipurpose and bar test specimens*

ISO 527-1, *Plastics — Determination of tensile properties — Part 1: General principles*

ISO 527-2, *Plastics — Determination of tensile properties — Part 2: Test conditions for moulding and extrusion plastics*

ISO 2557-1, *Plastics — Amorphous thermoplastics — Preparation of test specimens with a specified maximum reversion — Part 1: Bars*

ISO 2818, *Plastics — Preparation of test specimens by machining*

ISO 3167, *Plastics — Multipurpose test specimens*

ISO 3290, *Rolling bearings — Balls — Dimensions and tolerances*

ISO 4287, *Geometrical Product Specifications (GPS) — Surface texture: Profile method — Terms, definitions and surface texture parameters*

3 Terms and definitions

For the purposes of this document, the following terms and definitions apply.

3.1

oversize

d_d
difference between the diameter of an impressed ball or pin (d_b) and the diameter of the drilled and reamed hole (d_h) in the test specimen:

$$d_d = d_b - d_h \quad (1)$$

3.2

deformation step

determination made at a defined oversize

3.3

deformation step zero

determination made using test specimens that are drilled and reamed only, i.e. without impressing a ball or pin

3.4

deformation series

number of successive deformation steps beginning with deformation step zero

NOTE Normally, a deformation series consists of seven deformation steps of increasing severity.

3.5 failure limit

oversize in a deformation series that produces failure, as specified in terms of the following failure criteria:

- a) for type A test specimens (test specimens taken from products), as visible cracks, observable by means of a lens of magnification $\times 5$;
- b) for type B test specimens (moulded or machined test specimens), by the following criteria (see 9.2 and Figure 4):
 - 1) a 5 % reduction in the maximum tensile force measured at deformation step zero (criterion B1 in Figure 1),
 - 2) a 5 % reduction in the maximum flexural force measured at deformation step zero (criterion B2 in Figure 1),
 - 3) a 20 % reduction in the tensile elongation at rupture measured at deformation step zero (criterion B3 in Figure 1).

NOTE 1 If there is no rupture immediately after application of the maximum tensile force, the tensile elongation at 50 % of the preceding maximum tensile force (see Figure 1) may be measured. Failure is then defined by a 20 % reduction in the value at deformation step zero (criterion B4).


NOTE 2 It is sufficient to measure the elongation at break between the grips.

NOTE 3 If the value of the tensile stress is required, refer the force to the smallest cross-sectional area of the specimen at the location of the hole. Calculate the tensile stress in accordance with Equation (2):

$$\sigma = \frac{F}{h \cdot (w - d_h)} \tag{2}$$

where

- σ is the tensile stress, in MPa or $N \cdot mm^{-2}$;
- F is the tensile force, in N;
- h is the thickness of the specimen, in mm;
- d_h is the diameter of the hole, after reaming, in mm;
- w is the width of the specimen, in mm.

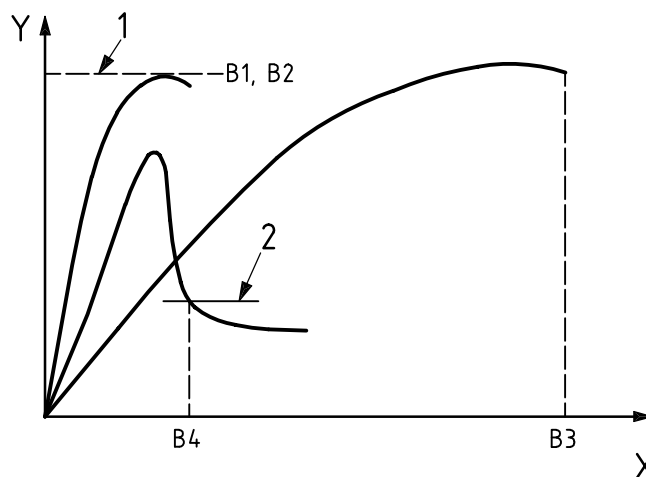

Key

- | | | | |
|---|---|----|---|
| X | elongation | B1 | 5 % reduction in the maximum tensile force |
| Y | stress | B2 | 5 % reduction in the maximum flexural force |
| 1 | maximum | B3 | 20 % reduction in the tensile elongation at rupture |
| 2 | $0,5 \times$ preceding max. tensile force | B4 | tensile elongation at 50 % of the preceding maximum tensile force |

Figure 1 — Failure criteria for type B test specimens

3.6 relative stress-cracking factor
ratio of the failure limit in the test environment to that in a reference environment, for example air, measured at the same test temperature after the same test time

4 Principle

A constant strain, produced by impressed balls or pins in a test specimen in a test environment, often generates micro-cracks that may, in time, develop into visible cracks. To shorten the time for the test, failure may be accelerated by subsequent mechanical testing. If products cannot be assessed by mechanical tests, visual examination for cracks around the balls or pins may be undertaken.

A hole of specified diameter is drilled in a test specimen, an oversize ball or pin is inserted into the hole and the specimen is brought into contact with a chemical medium. This procedure is repeated using balls or pins of progressively greater diameter. After a specified time, the effect of the interaction is determined by visual examination (type A test specimens) or by the determination of the tensile or flexural properties (type B test specimens). A parallel series of tests may be performed in which the test specimens are exposed to air, and the comparative behaviour determined.

NOTE Pins are suitable for a single series of test specimens or articles of thickness greater than 1 mm. The deformation of the test specimen is the same along the whole length of the hole. Balls are suitable for thicknesses greater than 2 mm. The preferred thickness is 4 mm.

5 Apparatus

5.1 Drilling machine, operating at a suitable frequency of rotation, for example at 1 000 min⁻¹.

5.2 Drills, of diameter (2,8 ± 0,1) mm.

5.3 Reamer, suitable for finishing a hole of diameter (3,00 ± 0,05) mm.

NOTE A 3H7 reamer (3,004 mm to 3,008 mm) is suitable.

5.4 Plug gauges, or other suitable devices, for measuring the diameters of the reamed holes to within 0,005 mm.

5.5 Micrometer, for determining the diameters of the pins with an accuracy of 0,001 mm.

5.6 Polished steel balls or pins, having tolerances of ± 0,001 mm on diameters up to 4 mm and ± 0,01 mm on diameters greater than 4 mm.

NOTE If steel is attacked in the test environment, other suitable hard materials, for example glass, may be used for the balls or pins.

The use of the ranges of diameters given in Table 1 is recommended.

5.6.1 Balls, conforming to ISO 3290 grade G20 for diameters up to 4 mm and grade G200 for diameters greater than 4 mm.

5.6.2 Pins, free of roughness or sharp edges, having a parallel-sided part 10 mm to 50 mm long and a taper (1:5) at one end to reduce the entry diameter to 2,5 mm (see Figure 2). The surface roughness of the pins shall be equal, preferably with $Ra < 0,02 \mu\text{m}$ (see ISO 4287).

NOTE A longer parallel-sided part of the pin will allow several test specimens to be tested with the same pin.

5.7 Jig, for drilling and reaming the holes (a typical fixture is shown in Figure 3).

5.8 Apparatus for pressing the balls or pins into the hole.


The spindle of the drilling machine or the tensile-testing machine itself may be used.

Table 1 — Recommended ranges of diameter for balls and pins

Dimensions in millimetres

Diameter	Increment
2,98 to 3,20	0,01
3,20 to 3,50	0,05
3,50 to 4,00	0,10
4,0 to 6,0	0,50

Dimensions in millimetres

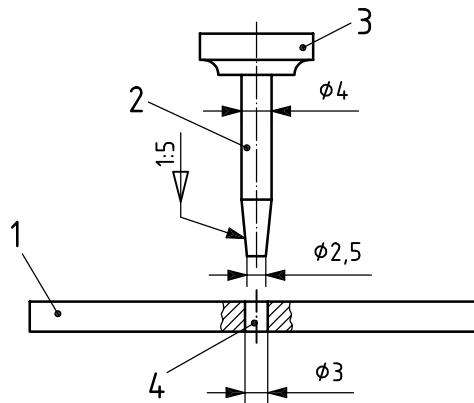


Key

- 1 test specimen
- 2 pin
- 3 presser foot of test machine
- 4 drill hole

Figure 2 — Example of pin construction and insertion of the pin

Dimensions in millimetres

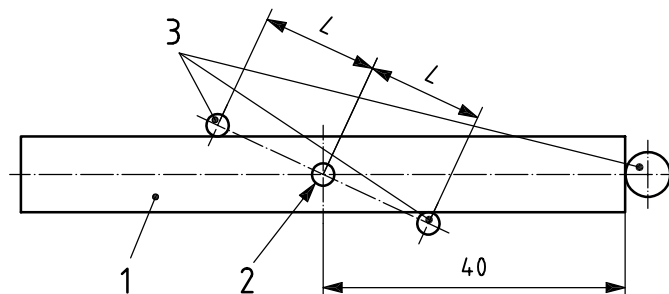

Key

- 1 test specimen
- 2 hole
- 3 holding pins

Figure 3 — Typical fixture for drilling holes in test specimens

5.9 Vessels, for immersion of the specimens. Vessels shall be made of suitable material, which is not attacked by the test environment and will not interact with the immersion liquid.

5.10 Clock.

5.11 Flexural- or tensile-testing machine (see ISO 178 or ISO 527-1, respectively), for the determination of flexural or tensile properties.

6 Test specimens

6.1 Shape

6.1.1 General

In general, use test specimens of the shape and method of preparation specified in the International Standard appropriate to the material or product concerned.

If the relevant International Standard contains no such specifications, test specimens of the following shape shall be used.

6.1.2 Type A test specimen

Use the product or part of it as the test specimen.

6.1.3 Type B test specimen

Use moulded or machined test specimens conforming to ISO 293, ISO 294-1 or ISO 2818, as applicable.

Test specimens shall not be machined on the faces where the holes will be drilled. If test specimen dimensions are not specified, for flexural testing use a bar of dimensions 80 mm × 10 mm × 4 mm, as specified in ISO 178, and for tensile testing use the appropriate test specimen specified in ISO 527-1 and ISO 527-2. Attention is drawn to the multipurpose specimen specified in ISO 3167.

NOTE 1 Flexural testing has the following disadvantages:

In three-point flexure, the load is introduced directly at the hole. This may interfere with balls in the specimen.

Ductile specimens do not always break in flexure. It may therefore be impossible to determine the relative stress-cracking factor due to the fact that the deformation step zero value is missing.

NOTE 2 Tensile testing may also be performed using specimens measuring 80 mm × 10 mm × 4 mm, prepared directly or cut from the central part of the multipurpose test specimen. This allows smaller vessels and a smaller amount of immersion liquid to be used.

6.2 State

For tests which are intended to be comparable, the test specimens shall be in the same state. Attention is drawn to ISO 2557-1 for the determination of level of shrinkage and to ISO 294-1 for the state of the specimens. If finished articles are tested, the holes shall be drilled in the same area, or in areas agreed upon by the interested parties, especially if critical regions, such as weld lines, are to be examined.

The level of shrinkage of the test specimens, whether compression moulded, injection moulded or machined from sheet, shall be determined on five test specimens before they are drilled and reamed.

When evaluating moulding materials made of crystalline polymers, such as polyethylene and polypropylene, the amount of crystallinity shall be controlled by following the instructions given in the standard relevant to the material being tested, or as agreed between the interested parties.

NOTE The numerical value of the failure limit depends upon the method of determination and the distance between the edge of each hole and the side of the specimen. The value decreases as this distance decreases.

6.3 Number of test specimens

6.3.1 General considerations

The number of test specimens required depends upon the duration of the test, i.e. short (see 8.4.2) or long (see 8.4.3), and the method used. Three deformation steps shall lie on either side of the expected approximate failure limit. When a long exposure is carried out with evaluation at intermediate intervals, additional specimens will be necessary.

6.3.2 Short-duration test (5 min to 24 h in the test environment) (see 8.4.2)

6.3.2.1 Selection of chemical medium

In view of the handling operations required for immersing the specimens in the chemical medium and removing them again, it has been found that 5 min is the shortest practical length of time for immersion. If it is possible to choose between different chemical media, it is recommended that one be selected which gives a measurable amount of stress cracking in not less than 1 h.

6.3.2.2 Type A test specimen

Three complete deformation-step series shall be used for testing. The required number of test specimens depends on the number of holes that can be drilled in the homogeneous region of each specimen.

6.3.2.3 Type B test specimen

Five test specimens shall be used for each deformation step.

6.3.3 Long-duration test

The number of test specimens depends upon the test conditions (see 8.4.3).

7 Conditioning and test conditions

7.1 Conditioning

Unless otherwise agreed between the interested parties (e.g. for polyamides or ABS), the test specimens shall be conditioned for at least 24 h at (23 ± 2) °C and (50 ± 10) % relative humidity before testing.

7.2 Test temperature

7.2.1 Unless otherwise agreed between the interested parties (for example for polyethylene), the temperature during insertion of the pin shall be (23 ± 2) °C.

7.2.2 The temperature during immersion shall be (23 ± 2) °C, unless otherwise specified or agreed upon by the interested parties, in which case the temperature can be (40 ± 1) °C or another temperature. Prior to immersion, the test specimens shall be stored in air at (23 ± 2) °C and (50 ± 10) % relative humidity. During storage in the reference environment (normally air), the same temperature shall be used as during immersion.

7.2.3 Tensile (preferred) or flexural testing shall be performed at (23 ± 2) °C and (50 ± 10) % relative humidity, or (23 ± 2) °C if the relative humidity is not critical.

7.3 Chemical medium

The chemical medium used for the test shall be that specified in the relevant International Standard. If there is no such specification, use either the chemical medium with which the material will be in contact in the expected application or a product agreed upon between the interested parties.

8 Procedure

8.1 Cleanness

Test specimens, balls and pins shall be clean and free of grease, fat, perspiration and other substances that could affect the test result.

NOTE Exposure of test specimens to intense artificial light or sunlight could also affect the result.

8.2 Drilling the test specimens

8.2.1 General

Care shall be taken to avoid heating of the specimens during drilling. Select a drill speed, drill feed and drill geometry so that drilling produces a continuous chip that does not melt. Cool using an appropriate coolant (for example, oil-free compressed air, water or another coolant known to have no effect on the material under test). Specimens may be stored at temperatures lower than ambient before drilling. With ductile materials, this helps in controlling the dimensions of the hole.

8.2.2 Type A test specimen

Drill holes of diameter 2,8 mm in each test specimen and ream them to 3,0 mm. The holes shall be perpendicular to the surface of the test specimens, at least 15 mm apart and at least 15 mm from the edges of the test specimen.

NOTE Specimen preparation is difficult and critical and care is necessary.

8.2.3 Type B test specimen

Drill a hole of diameter 2,8 mm in each test specimen and ream the hole to 3,0 mm. Drill the hole perpendicularly to the surface of the test specimen, so that it passes through the intersection of the axes of symmetry to within 0,2 mm longitudinally and 0,02 mm transversely. Drill the set of test specimens for each deformation series consecutively with the minimum time delay.

NOTE To centre the hole when drilling, the type of fixture shown in Figure 3 is recommended.

8.2.4 Measurement of hole diameter

Condition the drilled and reamed test specimens for at least 24 h in the atmosphere specified in 7.2.2.

Measure the diameter of five holes selected at random to within 0,005 mm. Check that the range of values is less than 0,01 mm and then calculate the arithmetic mean. This mean value shall be taken as the hole diameter for the series.

8.3 Insertion of balls or pins

8.3.1 Definition of the deformation steps

If the failure limit is not known from previous tests or from experience, it is recommended that preliminary tests be performed using one specimen per deformation step.

NOTE Experience gathered testing amorphous plastics shows that the largest decrease in the indicative property occurs at a circumferential strain caused by impression of the ball or pin about 1/10th of the strain at yield in a tensile test. For the majority of plastics, strain at yield is less than 10 %. Based on a hole diameter of 3 mm, severe ESC damage can be expected to become visible at oversizes not larger than 0,3 mm.

8.3.2 Balls

Insert one ball into each hole using a ball impression apparatus or other suitable means, for example the spindle feed of the drilling machine (see 5.8). Ensure that the position of each ball is symmetrical to the thickness of the test specimen to within $\pm 0,2$ mm.

8.3.3 Pins

Insert the tapered end into the hole in the test specimen and press it in until there is firm contact between the pin and the wall of the hole along the entire length of the wall (see Figure 2). If several test specimens are mounted on the same pin, the distance between the test specimens shall be ≥ 20 mm.

Do not wet the pin with the chemical medium selected for the test, since this will make it impossible to achieve reproducible exposure of the surface of the hole.

8.4 Immersion in the chemical medium

8.4.1 Conditioning

Store the prepared test specimen for (60 ± 5) min in the atmosphere specified in 7.2.2 prior to immersion in the test medium.

8.4.2 Short-duration test

8.4.2.1 Non-viscous liquid medium

Immerse the test specimens in the medium contained in a vessel (5.9) for up to 24 h at the specified temperature (see 7.2.2). Remove the specimens, wipe off the liquid using blotting-paper and allow the specimens to stand for (30 ± 5) min in the atmosphere specified in 7.2.2 before determining the stress-cracking behaviour.

8.4.2.2 Viscous medium

If the medium is viscous (for example paste or grease), cover the area of the hole on both sides of the test specimen with the medium. Store at the specified temperature up to 24 h, then wipe off the medium using blotting-paper and allow the specimens to stand for (30 ± 5) min in the atmosphere specified in 7.2.2 before determining the stress-cracking behaviour.

8.4.3 Long-duration test

Proceed as described in 8.4.2, exposing the test specimens to the medium for a specified or agreed period. If no period of contact is specified or agreed, it has been found convenient to carry out the test using periods of 1 day, 2 days, 4 days, 8 days, 16 days, etc., to determine the influence of time on the failure limit.

Before determining the failure limit (see 3.5), wipe off the medium using blotting-paper and allow the test specimens to stand for 2 h to 3 h in the atmosphere specified in 7.2.2.

NOTE 1 The immersion time of up to 24 h specified in 8.4.2.1 and 8.4.2.2 may be reduced if the medium is so aggressive that catastrophic failure occurs during the immersion period, and the failure limit cannot be determined in subsequent tests. For many chemical media, immersion times of 1 h have been found to be suitable.

NOTE 2 To obtain comparable results, especially in short-duration tests, it may be necessary to schedule impression of the balls or pins, immersion and testing in such a manner that the time between impression of the balls or pins and the test is equal for all oversize series in the test.

8.5 Exposure in air

If a simultaneous test in air is to be performed, store the test specimens in the atmosphere specified in 7.2.2 for $(24,0 \pm 0,5)$ h for the short-duration test or for the test period(s) used for the long-duration test.

8.6 Determination of stress cracking

8.6.1 Type A test specimen

Determine the failure limit for products exposed to air and immersed in the chemical medium by visual observation, or by means of a lens of magnification $\times 5$.

8.6.2 Type B test specimen

Determine the failure limit by the selected method (see 3.5).

The pin shall always be removed before flexural tests. For tensile tests, balls and pins may remain in the test specimens. When removing the balls or pins before the test, ensure that the removal process does not influence the test result.

NOTE Often the results of the flexural or tensile test on test specimens at deformation step zero are equivalent, whether determined in air or in a chemical medium. If the value determined in the chemical medium is higher, additional embrittlement should be suspected and, if it is lower, a softening of the material has occurred.

9 Expression of results

9.1 Type A test specimen

Record the oversize at which the first crack is visible. Record the time for the appearance of cracking either as the time when the first crack is detected or when half of the test specimens show at least one crack.

NOTE For routine testing, it is usually sufficient simply to record whether or not a crack is visible after exposure under the chosen conditions, i.e. oversize, chemical medium and time.

9.2 Type B test specimen — Graphical evaluation

Plot the arithmetical means of the tensile or flexural values determined at each deformation step as ordinates against the oversize of the corresponding pin as abscissa. Draw a smooth curve through the points (see Figure 4 for an example).


Calculate the failure limit as follows:

Draw a line parallel to the X-axis through the point on the Y-axis corresponding to the failure limit. At the point of intersection of this line with the curve, draw a line perpendicular to the X-axis. The oversize value at the point of intersection of this line with the X-axis is the failure limit, in millimetres. Record this value to the nearest hundredth of a millimetre.

NOTE This may be done electronically using a suitable programme.

10 Precision

The precision of these methods is not known because interlaboratory data are not available in view of the variety of plastics materials and conditions. These methods may not be suitable for use in the event of disputed results as long as no precision data are available.

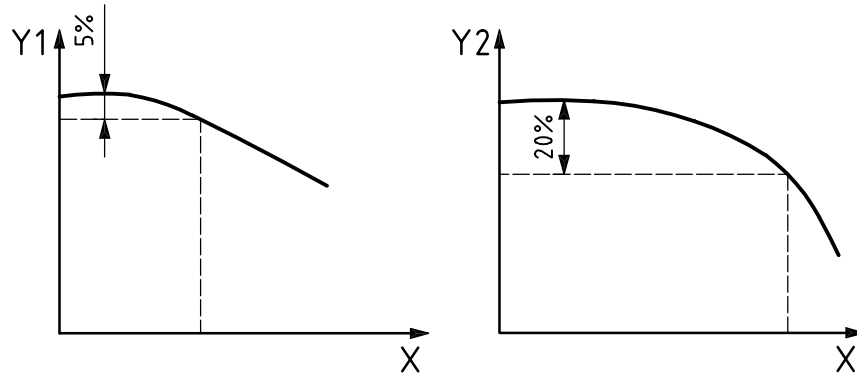**Key**

X pin oversize, mm

Y1 tensile or flexural force at rupture

Y2 tensile elongation at rupture

Figure 4 — Example of graphical evaluation of results

11 Test report

The test report shall include the following particulars:

- a) a reference to this part of ISO 22088;
- b) all details necessary to identify the material tested;
- c) the chemical medium used;
- d) the test temperature;
- e) the number of specimens tested (if applicable, in each direction of anisotropy) and their width and thickness;
- f) the procedure used for preparation of the specimens and, whenever relevant, the elapsed time between their preparation and the beginning of testing;
- g) the state of the specimens;
- h) a description of the conditioning method used, and the conditioning atmosphere and time.

In addition, the following shall be included, depending on the test method used:

- a) details of the deformation series [the mean diameter of the holes (see 8.2.4) and the diameters of the oversize balls or pins (5.6) used];
- b) for test specimen type A only:
 - 1) the oversize at which the first crack was observed, and the time to the appearance of cracking,
 - 2) for routine testing:
 - the test conditions, i.e. oversize, medium and time,
 - whether cracks were visible or not;

- c) for test specimen type B only:
 - 1) the mechanical test used,
 - 2) the failure criterion used and the oversize value recorded as the failure limit in 9.2 for each method used, for example: ESC, failure criterion B2 (23 °C, 2 days), 3,35 mm,
 - 3) a graphical presentation of the results as described in 9.2,
 - 4) the relative stress-cracking factor, if requested, together with the reference environment used;
- d) the date of testing.

Bibliography

- [1] ISO 22088-2, *Plastics — Determination of resistance to environmental stress cracking (ESC) — Part 2: Constant tensile load method*
- [2] ISO 22088-3, *Plastics — Determination of resistance to environmental stress cracking (ESC) — Part 3: Bent strip method*
- [3] ISO 22088-5, *Plastics — Determination of resistance to environmental stress cracking (ESC) — Part 5: Constant tensile deformation method*

BSI — British Standards Institution

BSI is the independent national body responsible for preparing British Standards. It presents the UK view on standards in Europe and at the international level. It is incorporated by Royal Charter.

Revisions

British Standards are updated by amendment or revision. Users of British Standards should make sure that they possess the latest amendments or editions.

It is the constant aim of BSI to improve the quality of our products and services. We would be grateful if anyone finding an inaccuracy or ambiguity while using this British Standard would inform the Secretary of the technical committee responsible, the identity of which can be found on the inside front cover. Tel: +44 (0)20 8996 9000. Fax: +44 (0)20 8996 7400.

BSI offers members an individual updating service called PLUS which ensures that subscribers automatically receive the latest editions of standards.

Buying standards

Orders for all BSI, international and foreign standards publications should be addressed to Customer Services. Tel: +44 (0)20 8996 9001. Fax: +44 (0)20 8996 7001. Email: orders@bsi-global.com. Standards are also available from the BSI website at <http://www.bsi-global.com>.

In response to orders for international standards, it is BSI policy to supply the BSI implementation of those that have been published as British Standards, unless otherwise requested.

Information on standards

BSI provides a wide range of information on national, European and international standards through its Library and its Technical Help to Exporters Service. Various BSI electronic information services are also available which give details on all its products and services. Contact the Information Centre. Tel: +44 (0)20 8996 7111. Fax: +44 (0)20 8996 7048. Email: info@bsi-global.com.

Subscribing members of BSI are kept up to date with standards developments and receive substantial discounts on the purchase price of standards. For details of these and other benefits contact Membership Administration. Tel: +44 (0)20 8996 7002. Fax: +44 (0)20 8996 7001. Email: membership@bsi-global.com.

Information regarding online access to British Standards via British Standards Online can be found at <http://www.bsi-global.com/bsonline>.

Further information about BSI is available on the BSI website at <http://www.bsi-global.com>.

Copyright

Copyright subsists in all BSI publications. BSI also holds the copyright, in the UK, of the publications of the international standardization bodies. Except as permitted under the Copyright, Designs and Patents Act 1988 no extract may be reproduced, stored in a retrieval system or transmitted in any form or by any means – electronic, photocopying, recording or otherwise – without prior written permission from BSI.

This does not preclude the free use, in the course of implementing the standard, of necessary details such as symbols, and size, type or grade designations. If these details are to be used for any other purpose than implementation then the prior written permission of BSI must be obtained.

Details and advice can be obtained from the Copyright & Licensing Manager. Tel: +44 (0)20 8996 7070. Fax: +44 (0)20 8996 7553. Email: copyright@bsi-global.com.