

BS EN 14869-2:2011



BSI Standards Publication

Structural adhesives — Determination of shear behaviour of structural bonds

Part 2: Thick adherends shear test
(ISO 11003-2:2001, modified)

bsi.

...making excellence a habit.™

National foreword

This British Standard is the UK implementation of EN 14869-2:2011. It was derived from ISO 11003-2:2001. It supersedes BS EN 14869-2:2004 and BS ISO 11003-2:2001, which are withdrawn.

The UK participation in its preparation was entrusted to Technical Committee PRI/52, Adhesives.

A list of organizations represented on this committee can be obtained on request to its secretary.

This publication does not purport to include all the necessary provisions of a contract. Users are responsible for its correct application.

© BSI 2011

ISBN 978 0 580 72244 8

ICS 83.180

Compliance with a British Standard cannot confer immunity from legal obligations.

This British Standard was published under the authority of the Standards Policy and Strategy Committee on 30 June 2011.

Amendments issued since publication

Date	Text affected
------	---------------

English Version

Structural adhesives - Determination of shear behaviour of structural bonds - Part 2: Thick adherends shear test (ISO 11003-2:2001, modified)

Adhésifs structuraux - Détermination du comportement en cisaillement d'adhésifs structuraux - Partie 2 : Méthode d'essai en traction sur éprouvette épaisse (ISO 11003-2:2001, modifié)

Strukturklebstoffe - Bestimmung des Scherverhaltens struktureller Klebungen - Teil 2: Scherprüfung für dicke Fügeiteile (ISO 11003-2:2001, modifiziert)

This European Standard was approved by CEN on 10 March 2011.

CEN members are bound to comply with the CEN/CENELEC Internal Regulations which stipulate the conditions for giving this European Standard the status of a national standard without any alteration. Up-to-date lists and bibliographical references concerning such national standards may be obtained on application to the CEN-CENELEC Management Centre or to any CEN member.

This European Standard exists in three official versions (English, French, German). A version in any other language made by translation under the responsibility of a CEN member into its own language and notified to the CEN-CENELEC Management Centre has the same status as the official versions.

CEN members are the national standards bodies of Austria, Belgium, Bulgaria, Croatia, Cyprus, Czech Republic, Denmark, Estonia, Finland, France, Germany, Greece, Hungary, Iceland, Ireland, Italy, Latvia, Lithuania, Luxembourg, Malta, Netherlands, Norway, Poland, Portugal, Romania, Slovakia, Slovenia, Spain, Sweden, Switzerland and United Kingdom.



EUROPEAN COMMITTEE FOR STANDARDIZATION
COMITÉ EUROPÉEN DE NORMALISATION
EUROPÄISCHES KOMITEE FÜR NORMUNG

Management Centre: Avenue Marnix 17, B-1000 Brussels

Contents

Page

Foreword.....	3
1 Scope	4
2 Normative references	4
3 Terms and definitions	4
4 Principle.....	4
5 Apparatus	6
6 Specimen	6
6.1 Specimen dimensions and configurations	6
6.2 Adherends	7
6.3 Preparation of surfaces before bonding	7
7 Test specimen	9
7.1 Preparation	9
7.1.1 Specimens with flat-ended adherends	9
7.1.2 Specimens with stepped adherends.....	10
7.2 Number of specimens	10
8 Procedure	13
9 Calculations.....	15
9.1 Symbols used.....	15
9.2 Average shear stress τ in the adhesive.....	15
9.3 Shear strain γ in the adhesive.....	15
9.4 Stress strain curve.....	17
9.5 Shear modulus of the adhesive.....	18
10 Precision.....	18
11 Test report	18
Annex A (informative) Suitable extensometer design.....	20

Foreword

This document (EN 14869-2:2011) has been prepared by Technical Committee CEN/TC 193 “Adhesives”, the secretariat of which is held by AENOR.

This European Standard shall be given the status of a national standard, either by publication of an identical text or by endorsement, at the latest by November 2011, and conflicting national standards shall be withdrawn at the latest by November 2011.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. CEN [and/or CENELEC] shall not be held responsible for identifying any or all such patent rights.

This document supersedes EN 14869-2:2004.

SAFETY STATEMENT — Persons using this document should be familiar with the normal laboratory practice, if applicable. This document does not purport to address all of the safety problems, if any, associated with its use. It is the responsibility of the user to establish appropriate safety and health practices and to ensure compliance with any regulatory conditions.

ENVIRONMENTAL STATEMENT — It is understood that some of the material permitted in this standard may have negative environmental impact. As technological advantages lead to acceptable alternatives for these materials, they will be eliminated from this standard to the extent possible.

At the end of the test, the user of the standard should take care to carry out an appropriate disposal of the wastes, according to local regulation.

According to the CEN/CENELEC Internal Regulations, the national standards organizations of the following countries are bound to implement this European Standard: Austria, Belgium, Bulgaria, Croatia, Cyprus, Czech Republic, Denmark, Estonia, Finland, France, Germany, Greece, Hungary, Iceland, Ireland, Italy, Latvia, Lithuania, Luxembourg, Malta, Netherlands, Norway, Poland, Portugal, Romania, Slovakia, Slovenia, Spain, Sweden, Switzerland and the United Kingdom.

1 Scope

This European Standard specifies a test method for determining the shear behaviour of an adhesive in a single lap joint bonded assembly when subjected to a tensile force.

The test is performed on specimens consisting of thick, rigid adherends, with a short length of overlap, in order to obtain the most uniform distribution of shear stresses possible and to minimize other stress states which initiate failure.

This test method may be used to determine:

- the shear-stress against shear-strain curve to failure of the adhesive;
- the shear modulus of the adhesive;
- other adhesive properties that can be derived from the stress/strain curve such as the maximum shear stress and shear strain;
- the effect of temperature, environment, test speed, etc. on these properties.

2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

EN 923:2005+A1:2008, *Adhesives — Terms and definitions*

EN 13887, *Structural Adhesives — Guidelines for surface preparation of metals and plastics prior to adhesive bonding*

EN ISO 291, *Plastics — Standard atmospheres for conditioning and testing (ISO 291:2008)*

EN ISO 10365, *Adhesives — Designation of main failure patterns (ISO 10365:1992)*

ISO 683-11, *Heat-treatable steels, alloy steels and free-cutting steels — Part 11: Wrought case-hardening steels*

ISO 1052, *Steels for general engineering purposes*

ISO 4995, *Hot-rolled steel sheet of structural quality*

3 Terms and definitions


For the purposes of this document, the terms and definitions given in EN 923:2005+A1:2008 apply.

4 Principle

An adhesively bonded test specimen (see Figure 1) is subjected to a tensile force so that the adhesive is stressed in shear.

The relative displacement of the adherends is measured using a purpose-built transducer located in the central region of the specimen. Force and displacement are measured from the start of application of the load until fracture of the specimen. The shear stresses and strains are then calculated from the bond dimensions.

Dimensions in millimetres

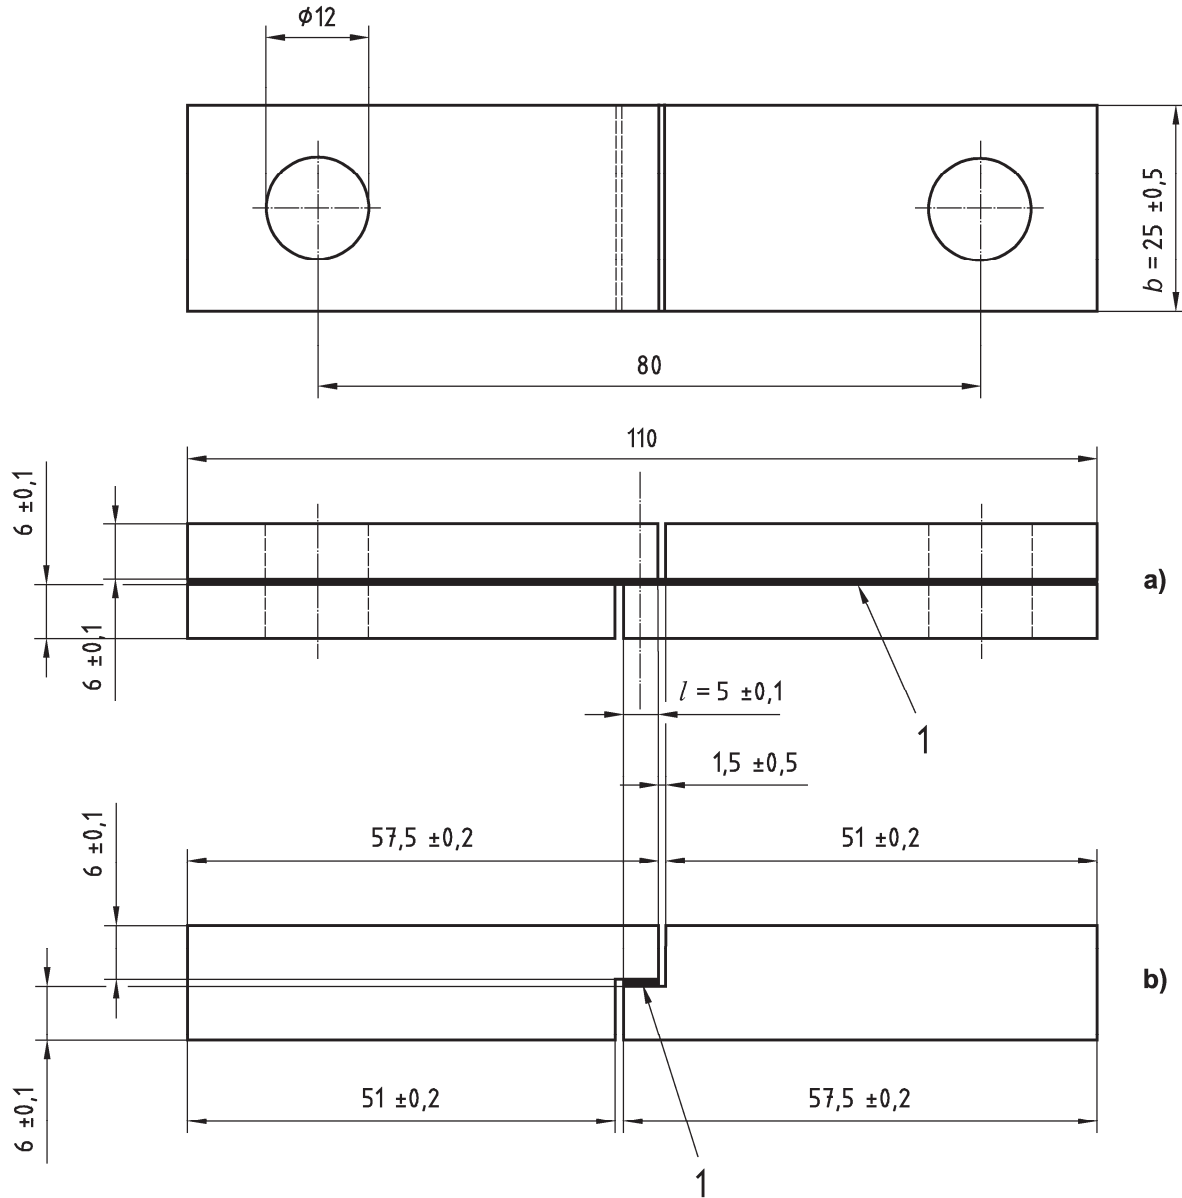

Key

- a) Bonded adherends
- b) Machined adherends
- 1 Adhesive bond
- b* Width of adhesive
- l* Length of adhesive

Figure 1 — Specimen dimensions and configuration

5 Apparatus

5.1 Tensile-testing machine, capable of producing fracture in the specimen at a tensile force between 10 % and 80 % of the full-scale range of the force transducer.

5.2 Device for introducing a force into the specimen, so that negligible torque develops when force (F) is applied to the specimen.

For this purpose, the simple universal-joint design shown in Figure 2 is satisfactory.

5.3 Force transducer, capable of measuring the force in the specimen with an accuracy of 1 % of the force at a shear strain of 0,01.

5.4 One or two extensometers (see Note 2), for measuring the shear displacement between points of known separation on each adherend in the central region of the bond (see Figure 3 and Annex A).

The points of contact with the adherends shall be within a distance of 2 mm from the bonded faces. The device(s) shall be capable of measuring the shear displacement to an accuracy of 1 μm .

NOTE 1 During loading, each adherend will bend slightly, leading to a small rotation of the central (bonded) region of the test specimen. In order to achieve high accuracy in displacement measurements, the extensometer(s) should rotate with the specimen. This has been achieved in the design shown in Figure 3 by double-pin contact with one of the adherends.

NOTE 2 The use of two extensometers on opposing faces of the specimen is recommended to minimize, by averaging the extensometer readings, any contribution to measurements from a twisting moment applied to the specimen. The use of two extensometers will also serve to indicate any malfunctioning of one of the extensometers as revealed by significantly different readings from the two devices.

5.5 Data-logging equipment, to continuously record the relative displacement of the adherends and the applied load, from the start of application of the load until the specimen breaks.

5.6 Micrometer, having an accuracy of better than 0,002 mm, to measure the dimensions of the adherends.

5.7 Optical microscope, having an accuracy of better than 0,002 mm, to measure the thickness of the adhesive bond when the specimen configuration shown in Figure 1a) is used.

6 Specimen

6.1 Specimen dimensions and configurations

Specimens shall be prepared either by bonding metal plates or strips together to produce the configuration shown in Figure 1a) or by bonding adherends that have been machined to the shape shown in Figure 1b). The dimensions of the specimen are given in Figure 1 and are the same, within variations in the bond thickness, for both preparation methods.

The bond thickness shall not be less than 0,05 mm.

NOTE The adherends shown in Figure 1a) have a lower bending stiffness than the continuous geometry shown in Figure 1b). Consequently, the peel stresses at the ends of the adhesive in the specimen in Figure 1a) will be higher than those in the specimen in Figure 1b). However, these differences in stiffness are likely to cause a trivial deviation in the comparative results.

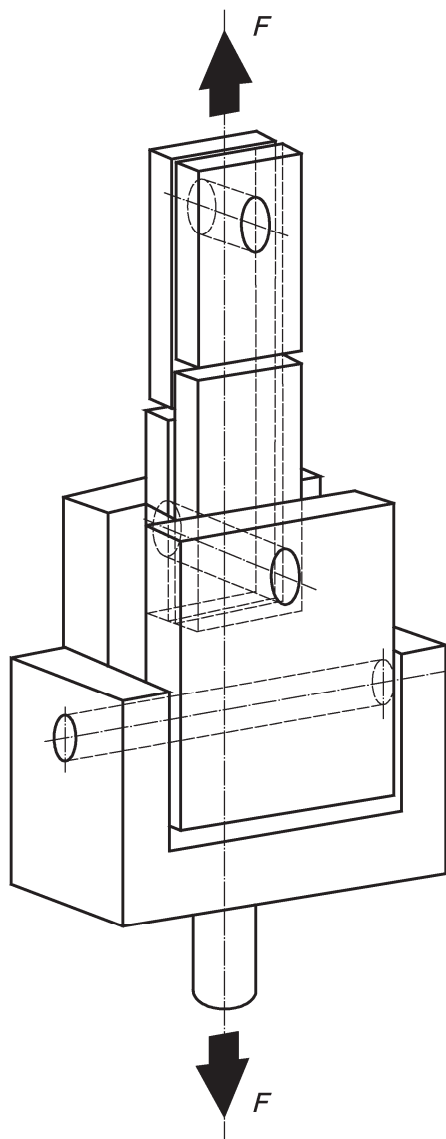


Figure 2 — Example of device for loading the specimen in a tensile-testing machine


6.2 Adherends

For the purpose of the measurement of the properties of the adhesive, steel adherends are recommended because of their high modulus.

Machine the panels or bars to be used for the adherends in accordance with ISO 683-11, ISO 1052 and ISO 4995 to the dimensions given in Figure 1a) or 1b) depending on which specimen configuration is chosen.

6.3 Preparation of surfaces before bonding

The surfaces to be bonded shall be prepared in accordance with EN 13887 or by any other method leading to cohesive failure within the adhesive layer.

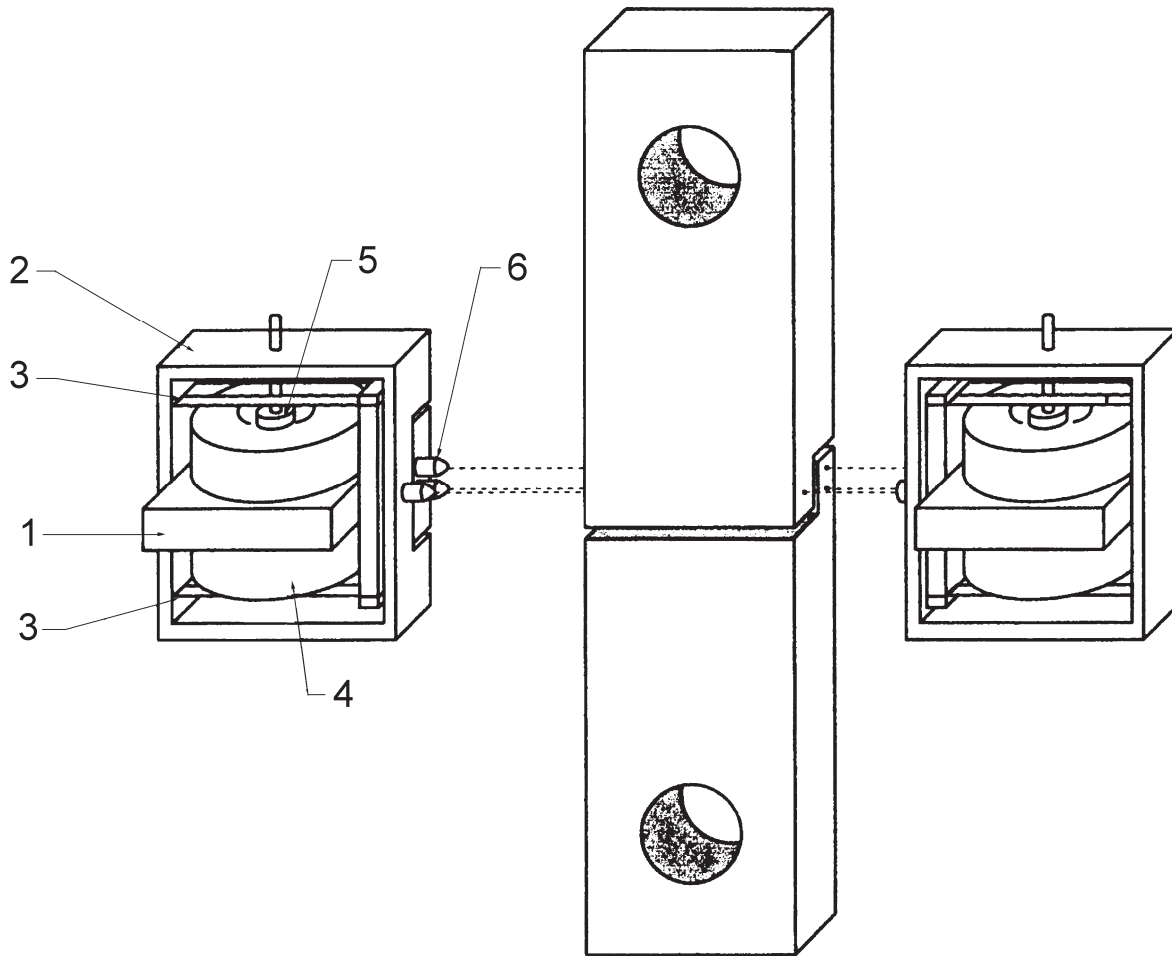

Key

- 1 Mobile inner part
- 2 Rigid outer frame
- 3 Steel leaf spring
- 4 Transducer coil
- 5 Transducer core
- 6 Turgsten pins

Figure 3 — Example of extensometer positioning

7 Test specimen

7.1 Preparation

7.1.1 Specimens with flat-ended adherends

7.1.1.1 General

Specimens with flat-ended adherends shall have the configuration shown in Figure 1a) and may be prepared from uncut panels, from pre-cut panels or as individual specimens from machined plates.

7.1.1.2 Uncut panels

The panels from which the specimens are cut shall consist of two sheets with dimensions in accordance with Figure 4, bonded together in accordance with the adhesive manufacturer's instructions.

In order to define the thickness of the adhesive, shims or spacers (metal foil) or calibrated metal wires may be incorporated outside the area which will become the overlap zone.

Cut the bonded panels into specimens using a suitable tool such as a band saw. Then subject the specimens to the required machining. Perform the last pass on the edge of the specimen parallel to the longitudinal direction of the specimen so as to avoid any metal burrs along the bonded joint.

Drill holes at the ends of each specimen for pins to hold the specimen to the tensile-testing machine.

Delineate the overlap zone by milling two grooves as shown in Figure 5.

When the specimens are machined, care shall be taken to ensure that the assembly is not heated above 50 °C. No liquid shall be used for cooling.

7.1.1.3 Pre-cut panels

Proceed as in 7.1.1.2, using two pre-cut sheets so as to obtain a panel in accordance with Figure 6.

Two holes shall be provided in each sheet so that the two sheets can be superposed correctly using an assembly with two centring lugs.

Cut out and machine specimens as explained in 7.1.1.2.

7.1.1.4 Individual specimens

Bond two plates of dimensions 110 mm × 25 mm × 6 mm in accordance with the adhesive manufacturer's instructions, defining the thickness of the adhesive joint as indicated in 7.1.1.2. Ensure that the sides of the adherends are parallel to the nearest 0,1 mm.

Machine each specimen to the required size.

Drill holes for applying the load.

Make two grooves by milling to delineate the overlap.

Take the same precautions as in 7.1.1.2.

7.1.2 Specimens with stepped adherends

The adherends for this specimen type shall be machined to the dimensions given in Figure 1b) prior to bonding. The adherends shall be bonded whilst held securely in a frame that ensures accurate alignment of the adherends.


In order to produce a bond of well-defined shape and length, strips of steel or PTFE of thickness 1,5 mm shall be inserted in the gaps between the adherends after the application of the adhesive and prior to curing. They shall be removed after the adhesive has cured. If steel strips are used, they shall be coated with a release agent.

NOTE It is recommended that such strips have a 45° tapered edge so that a triangular fillet is formed at the end of the bond. This fillet reduces the strain concentration at the end of the bond which can extend the life of the test specimen.

7.2 Number of specimens

At least five specimens shall be tested for a given adhesive.

Dimensions in millimetres

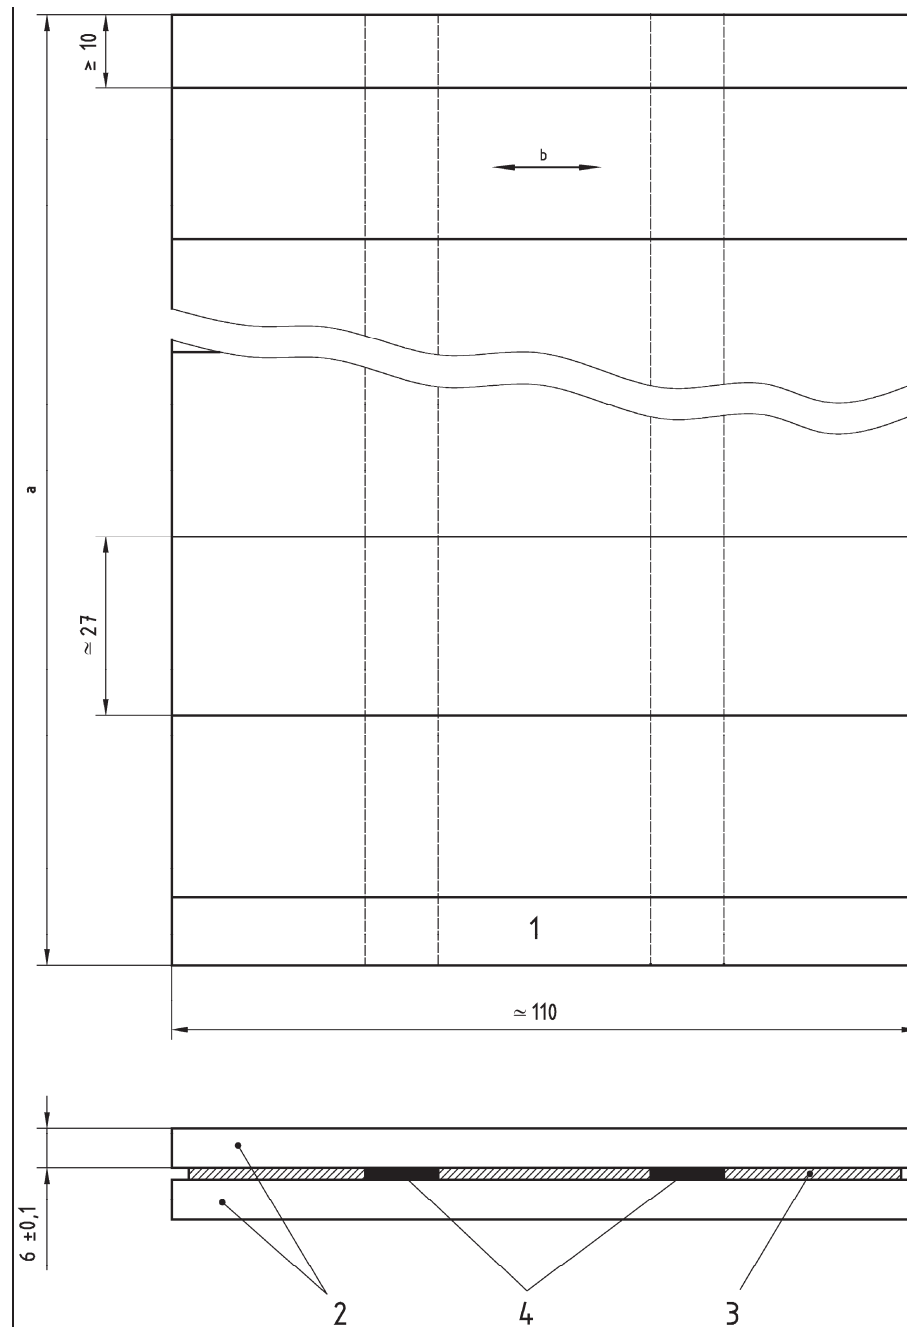


Key

- 1 Trim to waste
- 2 Adherends
- 3 Adhesive
- 4 Shim (optional)
- ^a Depends on number of specimens
- ^b Direction of roll during metal manufacture

Figure 4 — Uncut panel for making specimen assemblies

Dimensions in millimetres

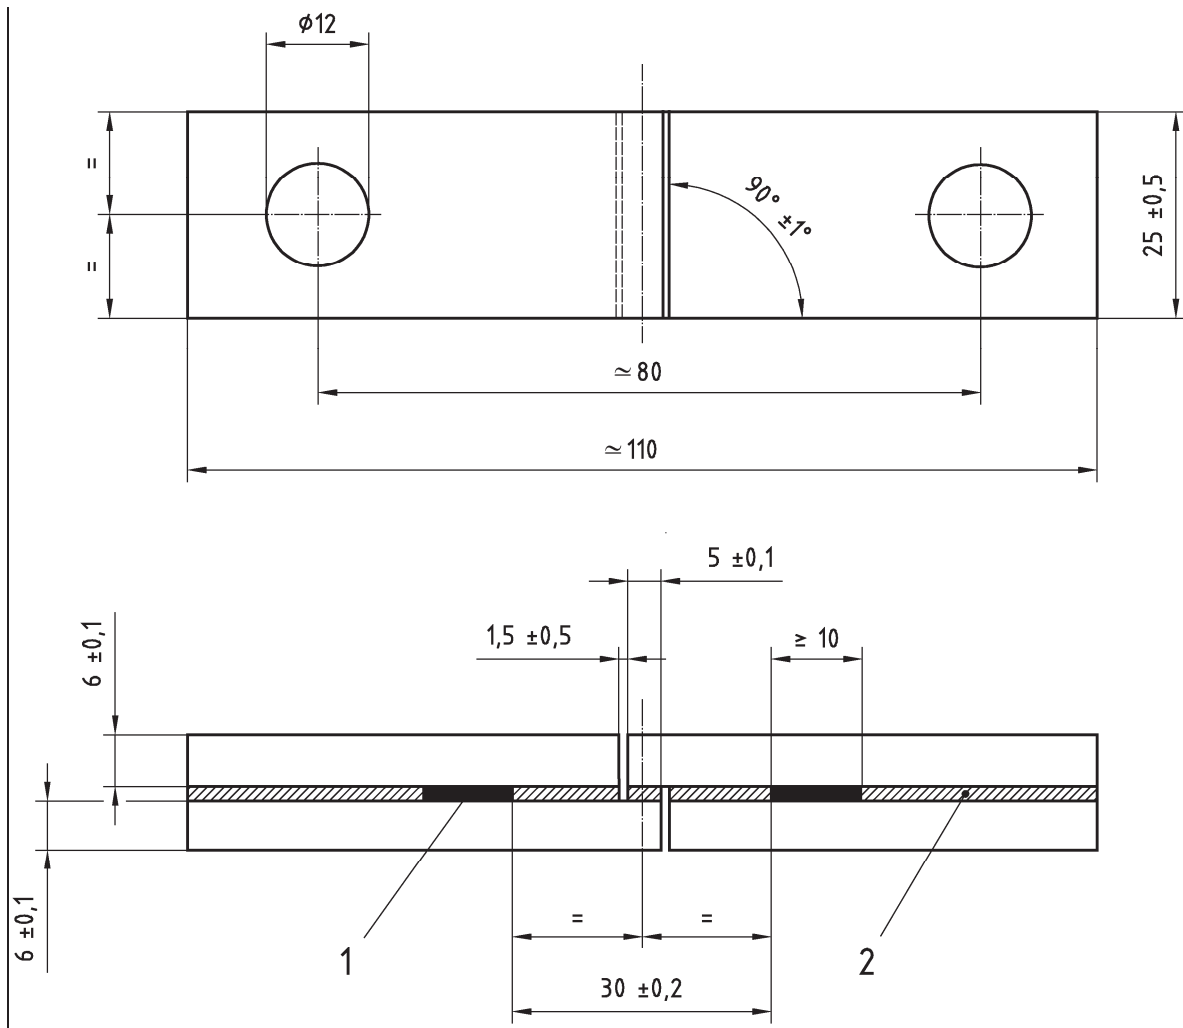

Key

- 1 Shim (optional)
- 2 Adhesive

Figure 5 — Specimen with flat-ended adherends

8 Procedure

The temperature of the test shall be one of the standard temperatures specified in EN ISO 291.

Measure the length l of the overlap and the width b of each specimen to the nearest 0,1 mm.


Where flat-ended specimens are used [see Figure 1a)] measure the thickness of the adhesive joint in the overlap zone at both ends and on each side of the specimen with an accuracy of 0,01 mm. Record the average value of the four measurements. If the difference between the end values is greater than 20 % of the average value, discard the specimen. Where specimens having stepped adherends [see Figure 1b)] are used, the bond thickness may be obtained from measurements, prior to bonding, of the thickness of the stepped ends of the adherends and of the thickness of the bonded specimen in the overlap region.

Place an extensometer on one or both sides of the specimen (see Figure 3).

Test the specimen in a tensile-testing machine at a constant machine speed. For purposes of comparison of results on different materials, a speed of 0,5 mm/min is recommended.

Record the force and the displacement of the specimen as it is loaded to fracture. Record the temperature also.

Dimensions in millimetres

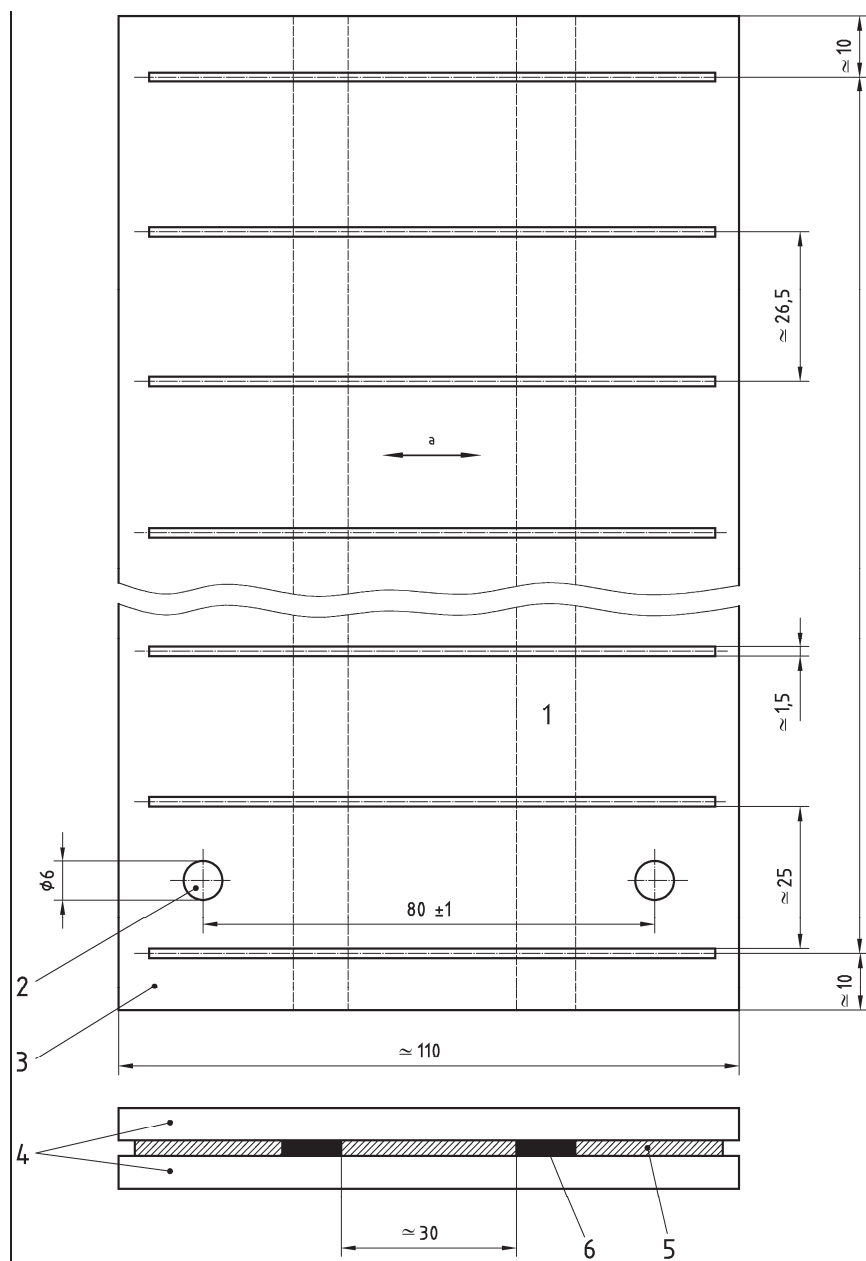

Key

- 1 Shim
- 2 Fastening hole
- 3 Border section
- 4 Adherends
- 5 Adhesive
- 6 Shim (optional)
- ^a Direction of roll during metal manufacture

Figure 6 — Pre-cut panel for making specimen assemblies

9 Calculations

9.1 Symbols used

Symbol	Meaning	Units	Reference
b	Width of the specimen	metres (m)	Figure 1
l	Bond length	metres (m)	Figure 1
d	Bond thickness	metres (m)	Figure 7
t_a	Extensometer pin separation	metres (m)	Figure 7
d_m	Measured displacement	metres (m)	Figure 7
d_s	Shear displacement of the adhesive	metres (m)	Figure 7
F	Force applied to the specimen	newtons (N)	
τ	Average shear stress in the adhesive	pascals (Pa)	
γ	Shear strain in the adhesive along the centreline of the specimen	non-dimensional	
G	Shear modulus of the adhesive	pascals (Pa)	
G_a	Shear modulus of the adherend	pascals (Pa)	

9.2 Average shear stress τ in the adhesive

At any force F applied to the specimen, the average shear stress τ in the adhesive is given by Equation (1):

$$\tau = \frac{F}{l \times b} \quad (1)$$

9.3 Shear strain γ in the adhesive

The shear strain γ in the adhesive is given by Equation (2):

$$\tan \gamma = \frac{d_s}{t} \cong \gamma \quad (2)$$

where

d is the average value of the thickness measurements made (see Clause 8);

NOTE 1 The shear displacement of the adhesive d_s is less than the measured displacement because of a contribution to d_m from deformation of the adherends (see Figure 7).

d_s can be calculated to a good approximation by assuming a uniform shear stress τ acts in the region of the adherend that is spanned by the extensometer.

This equation is only valid for small values of γ .


Equation (3) then enables d_s to be calculated:

$$d_s = d_m - \frac{\tau(t_a - t)}{G_a} \quad (3)$$

where

τ is the shear stress corresponding to the measured displacement.

NOTE 2 This simple correction gives a more accurate value for d_s than is obtained from measurements on a dummy specimen that has the same geometry as the bonded specimen but is machined from a single piece of the adherend material. The shear stress distribution in this dummy specimen is highly non-uniform and, for a particular applied load, the stress in the central region will be lower than that obtained in a bonded specimen under the same load.

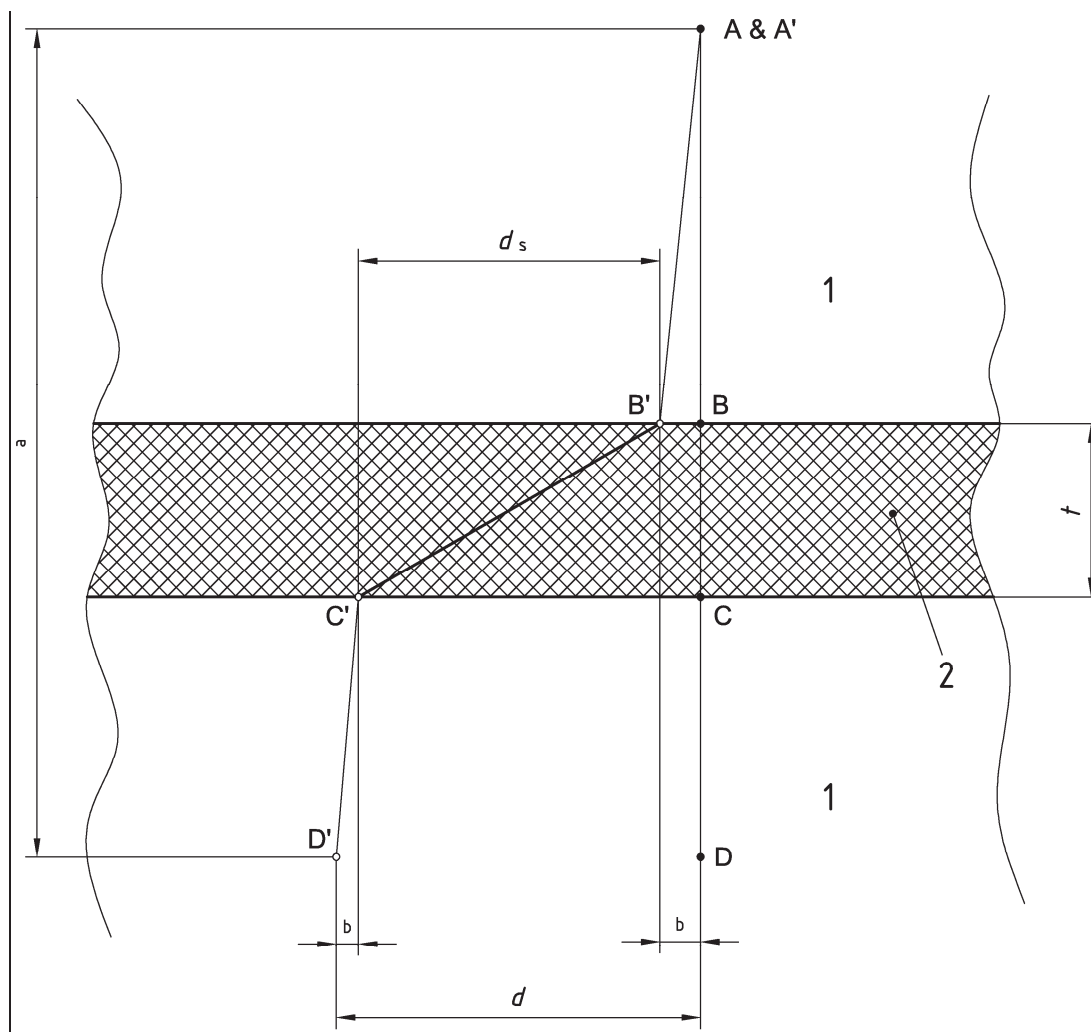

Key

- 1 Adherend
- 2 Adhesive

The section line ABCD deforms to the line A'B'C'D' on application of a force.

- ^a Distance between pins t_a
- ^b Contribution from adherends

Figure 7 — Deformation measured by the extensometer

9.4 Stress strain curve

A plot of the shear stress against the shear strain illustrates the mechanical behaviour of the adhesive at a constant deformation rate and can be used to derive certain data needed for design.

NOTE After the initial linear response of the adhesive, its stiffness decreases progressively with increasing strain. As the stiffness decreases, a greater proportion of the total displacement produced by the test machine is developed across the adhesive. Thus, in a test carried out at constant speed, the strain rate in the adhesive is not constant but increases until the stress maximum is reached. The relevant rate is therefore the strain rate at yield.

9.5 Shear modulus of the adhesive

The shear modulus is equal to the gradient of the linear, low-strain region of a plot of shear stress against shear strain.

NOTE 1 Because of the difficulties in the measurement of small strains in the specimen, a stress vs strain plot is unlikely to pass through the origin without some manipulation of the raw data. Where such manipulation has been correctly undertaken, the shear modulus may be obtained using Equation (4):

$$G = \frac{\tau}{\gamma} \quad (4)$$

where

τ and γ correspond to a point in the linear region of the curve.

NOTE 2 When the adhesive is being tested under conditions where it is significantly viscoelastic (e.g. at temperatures approaching its glass-to-rubber transition temperature), there is no region of the stress/strain curve that is linear, even at low strains where behaviour is linear viscoelastic. Furthermore, under these conditions, stress/strain behaviour is highly dependent upon strain rate and temperature. The derivation of a modulus from a test carried out at constant strain rate is then not appropriate, and dynamic mechanical or stress relaxation tests should be carried out to characterize linear viscoelastic behaviour.

10 Precision

The precision of this test method is not known because interlaboratory data are not available. When interlaboratory data are obtained, a precision statement will be added at the following revision.

11 Test report

The test report shall contain the following items:

- a) a reference to this European Standard, i.e. EN 14869-2;
- b) all the information necessary for the complete identification of the adhesive tested;
- c) identification of the adherends and their method of manufacture for the test, including information on the presence of fillets at each end of the bond;
- d) detailed information on any surface preparation carried out;
- e) the curing conditions used for the adhesive;
- f) the test temperature;
- g) information on the conditioning of the specimens;
- h) the speed of the test (speed of machine travel);
- i) the dimensions of the specimens (length of overlap and width of specimen);
- j) the thickness of the adhesive of each specimen;
- k) the number of specimens tested;
- l) the type of test machine used;

- m) a description of the instrument used for measuring strain;
- n) the designation of the specimen failure pattern in accordance with EN ISO 10365;
- o) the individual values of the properties of the adhesive determined on each specimen in accordance with Clause 9;
- p) the date of the test.

Annex A (informative)

Suitable extensometer design

This annex describes an extensometer design that has been successfully used to measure strain in this test method. However, other extensometer designs can be used.

The extensometer (see Figure 3) consists of a rigid frame and an internal part which can move parallel to the frame on spring blades. The body of a linear-displacement transducer is mounted on the internal moving part, while the core of the transducer is mounted on the rigid frame.

Three measurement pins are mounted on one side of the extensometer, one on the rigid frame and the other two on the internal moving part.

While the specimen is being stressed, the two halves of the specimen move away from each other. The relative movement of the two halves of the specimen causes the pins to move relative to each other, thus making a solenoid plunger move in the electrical coil of the transducer.

The transducer is connected to an amplifier whose output signal is proportional to the relative movement between the pins. The display can be calibrated to read directly in millimetres.

Two extensometers of this type are fixed to the specimen by means of a special mount (one on each side of the specimen).

A calibration assembly with a precision micrometer screw makes it possible to calibrate the extensometers before the test.

Using such extensometers, displacements of 1 mm can be measured with an accuracy of 1 μm within a temperature range from - 100 °C to + 200 °C depending on the sensors used.

British Standards Institution (BSI)

BSI is the national body responsible for preparing British Standards and other standards-related publications, information and services.

BSI is incorporated by Royal Charter. British Standards and other standardization products are published by BSI Standards Limited.

About us

We bring together business, industry, government, consumers, innovators and others to shape their combined experience and expertise into standards-based solutions.

The knowledge embodied in our standards has been carefully assembled in a dependable format and refined through our open consultation process. Organizations of all sizes and across all sectors choose standards to help them achieve their goals.

Information on standards

We can provide you with the knowledge that your organization needs to succeed. Find out more about British Standards by visiting our website at bsigroup.com/standards or contacting our Customer Services team or Knowledge Centre.

Buying standards

You can buy and download PDF versions of BSI publications, including British and adopted European and international standards, through our website at bsigroup.com/shop, where hard copies can also be purchased.

If you need international and foreign standards from other Standards Development Organizations, hard copies can be ordered from our Customer Services team.

Subscriptions

Our range of subscription services are designed to make using standards easier for you. For further information on our subscription products go to bsigroup.com/subscriptions.

With **British Standards Online (BSOL)** you'll have instant access to over 55,000 British and adopted European and international standards from your desktop. It's available 24/7 and is refreshed daily so you'll always be up to date.

You can keep in touch with standards developments and receive substantial discounts on the purchase price of standards, both in single copy and subscription format, by becoming a **BSI Subscribing Member**.

PLUS is an updating service exclusive to BSI Subscribing Members. You will automatically receive the latest hard copy of your standards when they're revised or replaced.

To find out more about becoming a BSI Subscribing Member and the benefits of membership, please visit bsigroup.com/shop.

With a **Multi-User Network Licence (MUNL)** you are able to host standards publications on your intranet. Licences can cover as few or as many users as you wish. With updates supplied as soon as they're available, you can be sure your documentation is current. For further information, email bsmusales@bsigroup.com.

BSI Group Headquarters

389 Chiswick High Road London W4 4AL UK

Revisions

Our British Standards and other publications are updated by amendment or revision.

We continually improve the quality of our products and services to benefit your business. If you find an inaccuracy or ambiguity within a British Standard or other BSI publication please inform the Knowledge Centre.

Copyright

All the data, software and documentation set out in all British Standards and other BSI publications are the property of and copyrighted by BSI, or some person or entity that owns copyright in the information used (such as the international standardization bodies) and has formally licensed such information to BSI for commercial publication and use. Except as permitted under the Copyright, Designs and Patents Act 1988 no extract may be reproduced, stored in a retrieval system or transmitted in any form or by any means – electronic, photocopying, recording or otherwise – without prior written permission from BSI. Details and advice can be obtained from the Copyright & Licensing Department.

Useful Contacts:

Customer Services

Tel: +44 845 086 9001

Email (orders): orders@bsigroup.com

Email (enquiries): cservices@bsigroup.com

Subscriptions

Tel: +44 845 086 9001

Email: subscriptions@bsigroup.com

Knowledge Centre

Tel: +44 20 8996 7004

Email: knowledgecentre@bsigroup.com

Copyright & Licensing

Tel: +44 20 8996 7070

Email: copyright@bsigroup.com



...making excellence a habit.™