



BSI Standards Publication

# Machine-made textile floor coverings — Determination of dimensional changes after exposure to heat and/or water

**National foreword**

This British Standard is the UK implementation of ISO 17984:2014. It supersedes BS ISO/PAS 17984:2001 which is withdrawn.

The UK participation in its preparation was entrusted to Technical Committee PRI/3, Textile floor coverings.

A list of organizations represented on this committee can be obtained on request to its secretary.

This publication does not purport to include all the necessary provisions of a contract. Users are responsible for its correct application.

© The British Standards Institution 2014. Published by BSI Standards Limited 2014

ISBN 978 0 580 78880 2

ICS 59.080.60

**Compliance with a British Standard cannot confer immunity from legal obligations.**

This British Standard was published under the authority of the Standards Policy and Strategy Committee on 30 June 2014.

**Amendments issued since publication**

Date	Text affected
------	---------------

---

---

---

**Machine-made textile floor  
coverings — Determination of  
dimensional changes after exposure to  
heat and/or water**

*Revêtements de sol textiles fabriqués à la machine — Détermination  
de la variation dimensionnelle après exposition à la chaleur et/ou à  
l'eau*





**COPYRIGHT PROTECTED DOCUMENT**

© ISO 2014

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized otherwise in any form or by any means, electronic or mechanical, including photocopying, or posting on the internet or an intranet, without prior written permission. Permission can be requested from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office  
Case postale 56 • CH-1211 Geneva 20  
Tel. + 41 22 749 01 11  
Fax + 41 22 749 09 47  
E-mail [copyright@iso.org](mailto:copyright@iso.org)  
Web [www.iso.org](http://www.iso.org)

Published in Switzerland

# Contents

	Page
<b>Foreword</b> .....	<b>iv</b>
<b>Introduction</b> .....	<b>v</b>
<b>1 Scope</b> .....	<b>1</b>
<b>2 Normative references</b> .....	<b>1</b>
<b>3 Terms and definitions</b> .....	<b>1</b>
<b>4 Principle</b> .....	<b>1</b>
<b>5 Apparatus</b> .....	<b>1</b>
5.1 Methods 1, 2, and 3.....	1
5.2 Methods 1 and 3.....	2
5.3 Methods 2 and 3.....	2
5.4 Method 4 (if used in conjunction with methods 1, 2, or 3).....	2
<b>6 Sampling and selection of test specimens</b> .....	<b>2</b>
6.1 Sampling.....	2
6.2 Number and dimensions of test specimens.....	2
6.3 Conditioning.....	2
<b>7 Procedure</b> .....	<b>2</b>
7.1 Method 1: Determination of dimensional changes after exposure to heat.....	2
7.2 Method 2: Determination of dimensional changes after immersion in water.....	3
7.3 Method 3: Determination of dimensional changes due to the effects of varied heat and water conditions.....	3
7.4 Method 4: Dimensional changes out of the plane.....	4
<b>8 Dimensional stability calculation</b> .....	<b>4</b>
<b>9 Test report</b> .....	<b>4</b>
<b>Annex A (informative) Determination of dimensions of textile floor covering test specimens</b> .....	<b>5</b>
<b>Bibliography</b> .....	<b>9</b>

## Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

The procedures used to develop this document and those intended for its further maintenance are described in the ISO/IEC Directives, Part 1. In particular the different approval criteria needed for the different types of ISO documents should be noted. This document was drafted in accordance with the editorial rules of the ISO/IEC Directives, Part 2 (see [www.iso.org/directives](http://www.iso.org/directives)).

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights. Details of any patent rights identified during the development of the document will be in the Introduction and/or on the ISO list of patent declarations received (see [www.iso.org/patents](http://www.iso.org/patents)).

Any trade name used in this document is information given for the convenience of users and does not constitute an endorsement.

For an explanation on the meaning of ISO specific terms and expressions related to conformity assessment, as well as information about ISO's adherence to the WTO principles in the Technical Barriers to Trade (TBT) see the following URL: Foreword - Supplementary information

The committee responsible for this document is ISO/TC 219, *Floor coverings*.

This first edition of ISO 17984 cancels and replaces ISO/PAS 17984:2001.

## Introduction

When ISO/TC 38/SC 12 reviewed ISO 2551:1981, it decided that because the original method gave rise to technical difficulties, any revision should incorporate a number of test method options for dimensional stability to heat, water and combined heat, and water and stability out of the plane. In order to establish the utility of this new approach, and to allow the precision of each test method to be established, it was decided to initially publish a document that would allow for further development based on some or all of these methods.





# Machine-made textile floor coverings — Determination of dimensional changes after exposure to heat and/or water

## 1 Scope

This International Standard specifies procedures for the determination of both planar and out-of-plane dimensional changes that take place when machine-made textile floor coverings are subjected to heat, water, or varied heat and water conditions.

The following methods are applicable to all machine-made textile floor coverings including those produced in tile form.

- Method 1: Determination of dimensional changes after exposure to heat.
- Method 2: Determination of dimensional changes after immersion in water.
- Method 3: Determination of dimensional changes due to the effects of varied heat and water conditions.
- Method 4: Dimensional changes out of the plane.

## 2 Normative references

The following documents, in whole or in part, are normatively referenced in this document and are indispensable for its application. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 1957, *Machine-made textile floor coverings — Selection and cutting of specimens for physical tests*

ISO 2424, *Textile floor coverings — Vocabulary*

## 3 Terms and definitions

For the purposes of this document, the terms and definitions given in ISO 2424 apply.

## 4 Principle

Comparison is made between either planar or out-of-plane dimensions of a test specimen after conditioning in the standard atmosphere for testing textiles and after being subjected to either heat, water, or specified varied heat and water conditions.

## 5 Apparatus

### 5.1 Methods 1, 2, and 3

**5.1.1 Instrument capable of measuring length to the nearest 0,1 mm**, e.g. an optical bench or mechanical device with gauge.

**5.1.2 Plate glass sheet**, marginally smaller than the test specimen, or other means of keeping the specimen flat while measurements are made.

This will not be required if the instrument in [5.1.1](#) incorporates such a glass or metal plate.

**5.1.3 Steel pins or other appropriate means of indicating the reference points on the test specimen**, if necessary.

NOTE A suitable piece of equipment incorporating [5.1.1](#), [5.1.2](#), and [5.1.3](#) is given in [Annex A](#).

**5.2 Methods 1 and 3**

**5.2.1 Ventilated drying oven**, capable of being controlled at  $60\text{ °C} \pm 2\text{ °C}$ , with perforated and lacquered shelves that can be placed in the oven.

**5.2.2 Desiccator or similar apparatus**, for maintaining specimens in a dry condition.

**5.3 Methods 2 and 3**

**5.3.1 Container**, for holding water at  $20\text{ °C} \pm 2\text{ °C}$ , with dimensions at least 20 mm greater than the test specimen and deep enough to accommodate the submerged test specimen.

**5.3.2 Rigid perforated tray**, of a sufficient size to carry the test specimen.

**5.3.3 Efficient wetting agent**, e.g. sodium dioctyl sulfosuccinate or dodecylbenzene sodium sulfonate.

**5.3.4 Means of ensuring a forced draught of ambient air**, if required.

**5.4 Method 4 (if used in conjunction with methods 1, 2, or 3)**

**5.4.1 Gauge or instrument**, capable of measuring in the vertical dimension, to an accuracy of 0,5 mm.

**6 Sampling and selection of test specimens**

**6.1 Sampling**

Select the specimens in accordance with ISO 1957.

**6.2 Number and dimensions of test specimens**

Take at least three test specimens each measuring not less than 450 mm × 450 mm, noting the direction of manufacture.

**6.3 Conditioning**

Lay out the specimens flat, singly and with the use surface uppermost in the standard atmosphere for testing for at least 48 h and until they reach constant mass (defined as no change in mass greater than 1 %) when determined at hourly intervals over a period of 3 h.

**7 Procedure**

**7.1 Method 1: Determination of dimensional changes after exposure to heat**

Make the first measurements ( $l_0$ ) on the fully conditioned specimen using, e.g. the method described in [Annex A](#).

Place the specimen on the rigid perforated tray (see [5.3.2](#)) with the use surface uppermost, and put it on a shelf in the drying oven (see [5.2.1](#)) at  $60\text{ °C} \pm 2\text{ °C}$ . Keep the specimen in the drying oven for a period of

24 h. Remove it and place it immediately in a desiccator or similar apparatus (see 5.2.2) to allow cooling to take place. When its temperature has reached  $20\text{ °C} \pm 2\text{ °C}$ , remove the specimen from the desiccator and immediately measure the dimensions ( $l_1$ ) using, e.g. the method described in Annex A.

Leave the specimens in the standard atmosphere for testing for 24 h to allow reconditioning to take place, until constant mass is again obtained (see 6.3). Measure the dimensions ( $l_2$ ) to the nearest 0,1 mm using, e.g. the method described in Annex A. Note the final appearance of the specimen.

## 7.2 Method 2: Determination of dimensional changes after immersion in water

Make the first measurements ( $l_0$ ) on the fully conditioned specimen using, e.g. the method described in Annex A.

Place the specimen on the rigid perforated tray with the use surface uppermost, and immerse it, laid flat, in water to which has been added 0,5 g/l of an efficient wetting agent (see 5.3.3), calculated on active matter content, at a temperature of  $20\text{ °C} \pm 2\text{ °C}$ . Allow the specimen to soak in the water for 2 h, ensuring that it remains submerged throughout. Lift the tray with the specimen from the water, taking precautions to avoid distorting its shape. Leave to drain in a horizontal position for  $5\text{ min} \pm 1\text{ min}$ . Place the specimen on the measuring board (see 5.1.1) and again measure the dimensions ( $l_1$ ) using, e.g. the method described in Annex A.

Dry the specimen on the tray in the standard atmosphere for testing, as described in Clause 6, using a forced air draught (see 5.3.4) if necessary, until constant mass is again obtained as in 6.3. Measure the dimensions ( $l_2$ ) using, e.g. the method described in Annex A. Note the final appearance of the specimen.

## 7.3 Method 3: Determination of dimensional changes due to the effects of varied heat and water conditions

### 7.3.1 Initial measurement of the specimen

Make all measurements on the conditioned specimen when it is completely flat; this can be achieved by use of the glass plate (see 5.1.2) or other means.

On the conditioned specimen, measure the distance between the edges parallel to the direction of manufacture and between the edges at right angles to the direction of manufacture, each at two locations approximately 200 mm apart. If required by the method of measuring adopted, mark the pair of reference points, e.g. by the use of steel pins (see 5.1.3), approximately 200 mm apart on the edge parallel to the direction of manufacture and also on the edge at right angles to the direction of manufacture. Make all measurements on the back of the specimen to the nearest 0,1 mm.

Products made of discrete layers, e.g. foam-backed constructions, should be measured on both the backing and the use-surface, and the results of both measurements given in the test report.

### 7.3.2 Determination

Place the test specimen, lying freely on the perforated and lacquered shelves, in the drying oven (see 5.2.1), controlled at  $60\text{ °C} \pm 2\text{ °C}$ . Keep the specimen in the drying oven for 2 h, then remove it and measure the distance between the two parallel edges or the two sets of marks to the nearest 0,1 mm, within 6 min to 7 min of removing the specimen from the oven.

Immerse the test specimen, laid flat, in water at a temperature of  $20\text{ °C} \pm 2\text{ °C}$  and allow it to soak in the water for 2 h. Remove the specimen from the water, taking precautions to avoid distorting its shape. Excess moisture can be removed by placing the specimen between sheets of blotting paper. Within  $5\text{ min} \pm 1\text{ min}$  of removing the specimen from the water, again measure the distance between the two parallel edges or the two sets of marks as specified in 7.1.

Dry the test specimen for 24 h in the drying oven at  $60\text{ °C} \pm 2\text{ °C}$  under the same conditions as before. Within 6 min to 7 min of removing the specimen from the oven again measure the distance between the two parallel edges or two sets of marks as specified in 7.1.

Finally, leave the test specimen for 48 h in the standard atmosphere for testing textiles. Measure the distance between the two parallel edges or the two sets of marks to the nearest 0,1 mm, note the final appearance of the test specimen, and assess the degree of distortion as mild, moderate, or severe and state the nature of the distortion, i.e. dishing, doming, or wrinkling.

#### 7.4 Method 4: Dimensional changes out of the plane

Measure the vertical deformation shown by the specimen initially, and after treatment with the various specified conditions of heat, water or heat and water, using the apparatus described in [5.4.1](#) and a baseboard such as that described in [A.2.1](#).

Lay the specimen on the baseboard, use surface uppermost, and measure the distance between the baseboard and the back of the specimen at various points along the edges.

Record the maximum deviation from the plane to the nearest 0,5 mm for each side of the specimen as being the greatest distance between the back of the sample and the base plate.

### 8 Dimensional stability calculation

Calculate the arithmetic mean of the dimensions obtained for all specimens in the direction of manufacture and in the direction at right angles to this for each of the stages referred to in [Clause 7](#).

Calculate in each case the variations observed and express as a percentage, to the nearest 0,01 % using Formula (1).

$$\frac{l_m - l_0}{l_0} \times 100 \quad (1)$$

where

$l_0$  is the arithmetic mean of the initial measurements;

$l_m$  is the arithmetic mean of measurements at each of the stages referred to in [Clause 7](#).

Indicate shrinkage by a minus sign and an increase in dimensions by a plus sign.

### 9 Test report

The test report shall contain the following information:

- a) which of test method(s) 1, 2, 3, or 4 for dimensional stability has been used, a statement that the procedure was conducted in accordance with this International Standard, and details of any operations not included, or optional;
- b) the individual values for each specimen of the measurements made in the direction of manufacture and in the direction at right angles to the direction of manufacture, together with the results obtained as specified in [Clause 8](#);
- c) a description of the final appearance of the test specimens, i.e. whether they exhibit mild, moderate or severe distortion;
- d) an indication of the type of measuring instrument used;
- e) the maximum edge curl per side per specimen or doming effect in case of the whole tile;
- f) details of any deviations from the standard method procedure.

## Annex A (informative)

### Determination of dimensions of textile floor covering test specimens

#### A.1 Scope

This method is applicable to textile floor coverings of all types, with a maximum thickness of 15 mm.

#### A.2 Apparatus

##### A.2.1 A rigid, durable, smooth, and waterproof baseboard

The baseboard should consist, e.g. of metal or marine plywood coated with a plastic laminate, of a size suitable to accommodate the test specimen. Two stop bars, approximately 25 mm wide and 15 mm high, are fitted at right angles along two adjacent sides with a gap of approximately 1 mm at the corner. On each of the two opposite sides, two cut-outs or slots are made approximately 20 mm wide and at least 20 mm long, to accommodate the presser feet of the dial gauge micrometers. The slots are positioned at 1/3 and 2/3 the nominal specimen size (length of side) from the stop bars, and are required to allow the presser feet to move  $\pm 10$  mm from the nominal size of the specimen (see [Figure A.1](#)).

##### A.2.2 Four dial gauge micrometers

Each micrometer has presser feet 20 mm diameter, traverse  $>20$  mm, capable of measuring to 0,1 mm and operating with a force of between approximately 0,5 N and 1 N. The gauges are mounted centrally within the cut-outs or slots with their axes in a horizontal plane and so that their centres are 5 mm above the level of the base. A means of holding the dial gauge presser foot shafts in their maximum position is required.

A suitable apparatus is shown in [Figures A.1](#) and [A.2](#).

NOTE It can be possible to accommodate more than one nominal specimen size on one apparatus by repositioning the dial gauges and/or by additional stop bars.

##### A.2.3 Metal squares or T-squares

These are of known dimensions equivalent to the nominal specimen dimensions and accurate to 0,25 mm (for calibration of the gauge position).

##### A.2.4 Square flatplates

These are 10 mm smaller than the nominal specimen size, of mass approximately 5 kg/m<sup>2</sup> (for covering specimens during the test).

#### A.3 Test specimens

##### A.3.1 Sampling, number, dimensions, and conditioning

The sampling, number, dimensions and conditioning of test specimens should be in accordance with the standard method being used.

Selection should generally be as described in ISO 1957.

### A.3.2 Marking

Wherever possible, the direction of manufacture should be identified. All measurements should be made with reference to this, and the sides should be marked A, B, C, and D as shown in [Figure A.3](#). If the direction of manufacture cannot be identified, an arbitrary identification of direction and related sides should be made.


## A.4 Procedure

**A.4.1** With the dial gauge presser foot shafts in their maximum positions, place the appropriate calibration square or T-square on the baseboard and ensure that it is in contact with the stop bars. Release the dial gauge shafts and obtain a zero reading for each micrometer. Re-lock the dial gauge shafts in their maximum positions and remove the calibration square.

**A.4.2** Place the specimen, reverse side uppermost, on the apparatus, with side A firmly against the top stop bar and at least part of side D in contact with the side stop bar, taking particular care where direction of pile might cause springing back. Place the appropriately sized flat plate centrally on top of the specimen, ensuring that the specimen remains flat and in position, allow the feet of the dial gauges situated opposite side A to rest against the edge of the specimen, and record the readings on both gauges to the nearest 0,1 mm.

By reference to the calibration, and by the appropriate addition or subtraction of the zero reading, calculate the two values for dimensions in the direction of manufacture.


**A.4.3** Remove the flat plate and re-position the specimen so that side D is firmly against the side stop bar and at least part of side A is in contact with the top stop bar. (No re-positioning will be required if sides A and D are precisely at right angles to each other.) Replace the flat plate and carry out the measurements as described in [7.2](#), but this time using the two dial gauges situated opposite side D. Again calculate the two values for dimensions at right angles to the direction of manufacture.

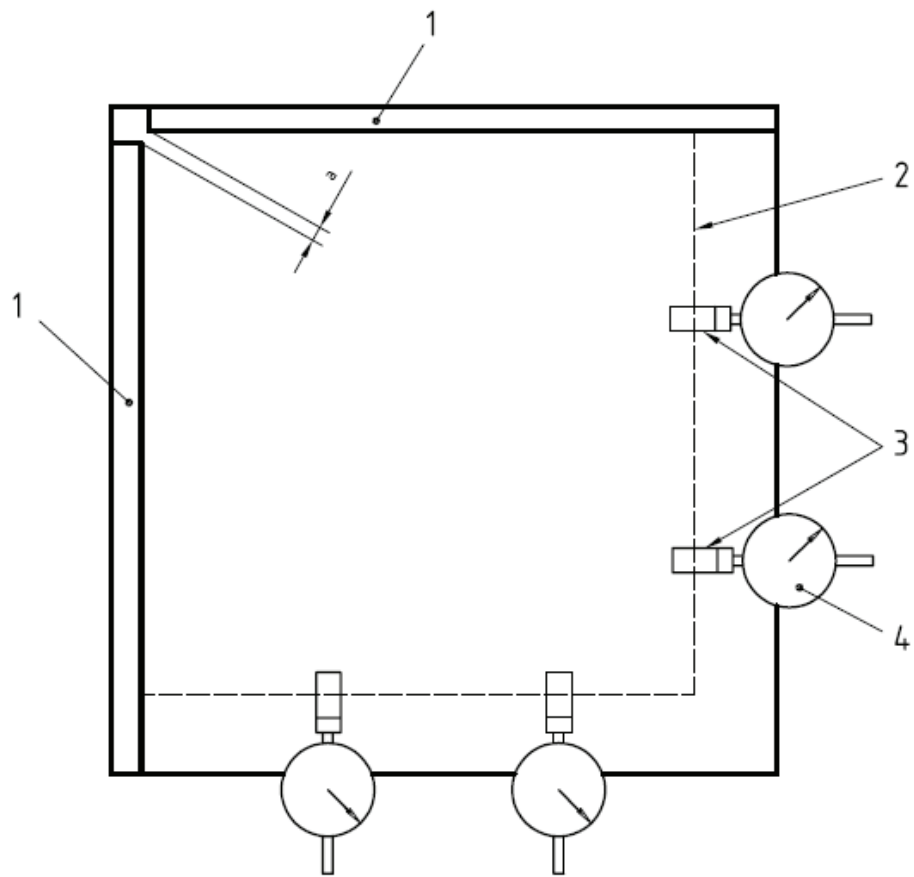

**Key**

- 1 stop bars
- 2 test specimen
- 3 cut outs/slots
- 4 gauges
- a approximately 1 mm


**Figure A.1**

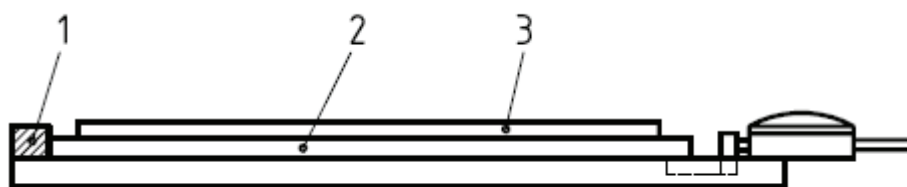

**Key**

- 1 stop bar
- 2 baseboard
- 3 test specimen

**Figure A.2**

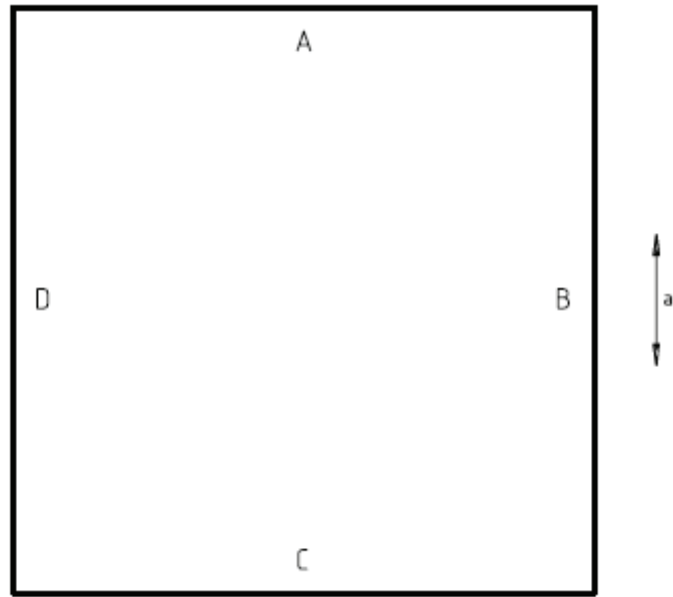

**Key**  
a direction of manufacture

**Figure A.3**



## Bibliography

- [1] ISO 139, *Textiles — Standard atmospheres for conditioning and testing*





# British Standards Institution (BSI)

BSI is the national body responsible for preparing British Standards and other standards-related publications, information and services.

BSI is incorporated by Royal Charter. British Standards and other standardization products are published by BSI Standards Limited.

## About us

We bring together business, industry, government, consumers, innovators and others to shape their combined experience and expertise into standards-based solutions.

The knowledge embodied in our standards has been carefully assembled in a dependable format and refined through our open consultation process. Organizations of all sizes and across all sectors choose standards to help them achieve their goals.

## Information on standards

We can provide you with the knowledge that your organization needs to succeed. Find out more about British Standards by visiting our website at [bsigroup.com/standards](http://bsigroup.com/standards) or contacting our Customer Services team or Knowledge Centre.

## Buying standards

You can buy and download PDF versions of BSI publications, including British and adopted European and international standards, through our website at [bsigroup.com/shop](http://bsigroup.com/shop), where hard copies can also be purchased.

If you need international and foreign standards from other Standards Development Organizations, hard copies can be ordered from our Customer Services team.

## Subscriptions

Our range of subscription services are designed to make using standards easier for you. For further information on our subscription products go to [bsigroup.com/subscriptions](http://bsigroup.com/subscriptions).

With **British Standards Online (BSOL)** you'll have instant access to over 55,000 British and adopted European and international standards from your desktop. It's available 24/7 and is refreshed daily so you'll always be up to date.

You can keep in touch with standards developments and receive substantial discounts on the purchase price of standards, both in single copy and subscription format, by becoming a **BSI Subscribing Member**.

**PLUS** is an updating service exclusive to BSI Subscribing Members. You will automatically receive the latest hard copy of your standards when they're revised or replaced.

To find out more about becoming a BSI Subscribing Member and the benefits of membership, please visit [bsigroup.com/shop](http://bsigroup.com/shop).

With a **Multi-User Network Licence (MUNL)** you are able to host standards publications on your intranet. Licences can cover as few or as many users as you wish. With updates supplied as soon as they're available, you can be sure your documentation is current. For further information, email [bsmusales@bsigroup.com](mailto:bsmusales@bsigroup.com).

## BSI Group Headquarters

389 Chiswick High Road London W4 4AL UK

## Revisions

Our British Standards and other publications are updated by amendment or revision.

We continually improve the quality of our products and services to benefit your business. If you find an inaccuracy or ambiguity within a British Standard or other BSI publication please inform the Knowledge Centre.

## Copyright

All the data, software and documentation set out in all British Standards and other BSI publications are the property of and copyrighted by BSI, or some person or entity that owns copyright in the information used (such as the international standardization bodies) and has formally licensed such information to BSI for commercial publication and use. Except as permitted under the Copyright, Designs and Patents Act 1988 no extract may be reproduced, stored in a retrieval system or transmitted in any form or by any means – electronic, photocopying, recording or otherwise – without prior written permission from BSI. Details and advice can be obtained from the Copyright & Licensing Department.

## Useful Contacts:

### Customer Services

**Tel:** +44 845 086 9001

**Email (orders):** [orders@bsigroup.com](mailto:orders@bsigroup.com)

**Email (enquiries):** [cservices@bsigroup.com](mailto:cservices@bsigroup.com)

### Subscriptions

**Tel:** +44 845 086 9001

**Email:** [subscriptions@bsigroup.com](mailto:subscriptions@bsigroup.com)

### Knowledge Centre

**Tel:** +44 20 8996 7004

**Email:** [knowledgecentre@bsigroup.com](mailto:knowledgecentre@bsigroup.com)

### Copyright & Licensing

**Tel:** +44 20 8996 7070

**Email:** [copyright@bsigroup.com](mailto:copyright@bsigroup.com)



...making excellence a habit.™